

# 3M Occupational Health & Environmental Safety Division

## 3M™ EVM Series Environmental Monitor

### Simultaneous Particulate and Gas Concentration Measurement



## User Manual



Distributed by:  
Air-Met Scientific Pty Ltd

Air-Met Sales/Service  
P: 1800 000 744  
F: 1800 000 774  
E: sales@airmet.com.au

Air-Met Rental  
P: 1300 137 067  
E: hire@airmet.com.au  
W: www.airmet.com.au



## 3M™ EVM series environmental monitor

### Dangers, warnings, & cautions



#### **Danger!**

**Failure to observe the following procedures may result in serious personal injury:**

- Not for use in Explosive or Hazardous locations. This product is NOT Intrinsically Safe.
- Contains built-in lithium ion battery pack. Do not incinerate or dispose of in fire.
- Do not disassemble, alter, or re-construct the li-ion battery.
- Contains Class 3b visible laser radiation source (658 nm, nominal 5 mW). Do not look directly into beam or view with telescopic devices.
- This instrument will NOT detect natural gas.



#### **Warning!**

- Read the manual before operation.
- Do not store in temperatures exceeding 60°C (140°F) and in direct sunlight.
- Do not immerse in liquids.
- The Sensors and batteries in this instrument have limited shelf-life, even if never used.
- Do not disassemble, service, or clean the optical engine internal components while power is applied. The laser source can hurt you.



#### **Caution!**

##### **General**

- Condensation may damage your instrument and its sensors.
- A non-condensing environment is required for proper measurements.
- Do not charge batteries outside the range of 0°C to 40°C (32°F to 104°F).
- Battery run-time may be somewhat reduced at lower than 20°C (68°F) temperatures.

##### **Temp/RH/Dew Point**

- The internal Temp/RH sensor in this instrument is not designed for use in bright sunlight or in the presence of a strong radiant heat sources. It is intended primarily for indoor use. It is not equivalent to a protected dry-bulb thermometer.

##### **PM/dust**

- Clean the optical engine mirror with a soft cloth, if it is dirty. Scratches will affect performance.
- Avoid measuring wet particles, fogs, and liquid mists that will tend to cling to the impactor, optical engine, tubing, and pump surfaces.
- Avoid oily mists as found near some machining operations.
- This monitor is designed to measure dry particulates, not filaments.
- Do not attempt to measure Asbestos with this instrument.
- Keep a "Pump Protection Filter" or other gravimetric filter in place to help prolong the life of the pump.
- You must check & calibrate the flow rate, when using this device as a (gravimetric) sampling pump.

## Dangers, warnings, & cautions (continued)



### Caution!

#### *CO<sub>2</sub>*

- Avoid exposure to condensation, fogs, and liquid mists, that can contaminate the optical path inside the CO<sub>2</sub> sensor.

#### *PID*

- This instrument cannot detect methane gas.
- For best sensor life, avoid acidic condensing gases.
- The presence of moisture can affect performance of the PID.

#### *Toxic*

- Beware of certain cross-sensitivities when measuring toxic gas levels. Readings can be nonspecific in the presence of certain cross-contaminant gases.

#### *Air velocity*

- The tip of the Air velocity probe is very fragile.



### FCC Compliance Statement

- This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to Part 15 of the FCC rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial or residential environment. This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. If harmful interference occurs, the user will be required to correct the interference at his or her expense.

## Table of Contents

Dangers, warnings, & cautions .....	ii
Chapter 1: Introduction .....	1
Particulate sampling (Aerosols/dust vapors) .....	2
Particulate path .....	2
Particulate sizes .....	3
Particulates and cut-point .....	4
Collecting/sensing the particulates .....	4
Gravimetric sampling .....	4
Pump .....	4
Gas sensors sampling .....	5
Gas sensors and path .....	5
Volatile organic compounds (VOC's) sampling .....	6
Temperature, Relative humidity, Dew Point .....	6
What the standards say .....	6
Resources .....	7
EVM Series .....	7
Applications .....	7
Models explained .....	9
Chapter 2: Getting started .....	11
Checking the equipment .....	11
Display and keypad .....	12
Diagram .....	12
Keypad description .....	13
Turning on .....	14
Start screen explanation .....	14
Navigating .....	15
Indicators/icons on the display .....	15
Turning off .....	16
Instrument Information .....	16
Unit information screen .....	16
3M™ Detection Management Software DMS .....	18
Communicating .....	18
Powering and outputs on the EVM .....	19
Battery .....	19
Charging .....	19

Outputs.....	19
<b>Chapter 3: Setting up the EVM .....</b>	<b>21</b>
<b>Setting up parameters via the keypad .....</b>	<b>21</b>
Time and date setting .....	21
Checking battery power .....	22
Display: language, contrast, & key click .....	24
Setting logging and viewing run time .....	25
PID correction – adding/editing.....	27
Changing units (temperature, particulates, PID, and air velocity) .....	29
Setting up particulate settings.....	30
Setting profiles (particulate correction factors) .....	30
How particulate factors are adjusted and calculated.....	30
Dust correction factors (profiles).....	31
Particulate pump: enable or disable .....	33
Resetting the gravimetric filter .....	33
Auxiliary input/output.....	34
Digital output .....	34
Air Velocity .....	36
Analog-out.....	37
Restoring default factory settings .....	38
Backlight setting.....	39
Resetting the EVM.....	39
Lock/secure run and/or setup .....	40
Unlock run and/or setup.....	41
Auto-run .....	42
Auto-run and timed-run mode.....	42
Auto-run with date mode.....	43
Auto-run with day of week (DOW) mode.....	45
<b>Chapter 4: Calibrate sensors.....</b>	<b>47</b>
<b>Placement and calibration of sensors .....</b>	<b>47</b>
Inserting and removing sensors.....	47
Calibrating particulates .....	49
Impactor and use .....	49
Adjusting the impactor/turret setting .....	50
Particulates calibration (zero cal).....	52
Particulate Advanced Calibration (Gravimetric) .....	56
Gravimetric Calibration Overview .....	56
Performing a gravimetric calibration .....	57
Pump flow rate calibration .....	58
Toxic gas sensors .....	59
Cross sensitivity .....	60
How sensors operate.....	60
Quality calibrations.....	60
About sensors and cal storage .....	61
Calibration history and sensor serial numbers .....	61
Applying a gas sensor.....	62
Calibrating toxic gas sensors.....	63
Toxic gas zero calibration.....	63
Ozone calibration for zero and span.....	63
Toxic gas span calibration .....	65

Calibrating CO <sub>2</sub> AND O <sub>2</sub> .....	67
CO <sub>2</sub> Accuracy .....	67
O <sub>2</sub> Accuracy .....	67
Calibrating Photo-Ionization Detector (PID) Sensor .....	71
PID parts per million (ppm) zero calibration .....	71
PID parts per billion (ppb) zero calibration .....	71
PID span calibration .....	72
Calibrating relative humidity and temperature .....	74
Calibration history .....	76
Verify calibration and drifting analysis .....	77
<b>Chapter 5: Measuring and Viewing .....</b>	<b>80</b>
<b>Overview of running a session .....</b>	<b>80</b>
<b>Measuring .....</b>	<b>81</b>
Understanding what data is stored .....	81
Summary data .....	81
Logged data/ Time history .....	81
<b>Running and stopping .....</b>	<b>82</b>
<b>Measurement screens and navigation .....</b>	<b>83</b>
Unit defined .....	84
About the measurement softkeys .....	85
<b>Particulate measurement screen .....</b>	<b>86</b>
Impactors and particulate measuring .....	87
Extending run-time for PM measurements .....	87
Changing particulate measurements .....	88
<b>Relative humidity &amp; temperature measurements .....</b>	<b>89</b>
Relative humidity and temperature screen .....	89
<b>Gas measurements .....</b>	<b>90</b>
Gas screen .....	90
<b>Composite measurement .....</b>	<b>90</b>
Composite screens .....	91
<b>Air velocity measurement screen .....</b>	<b>92</b>
<b>Summary Data .....</b>	<b>93</b>
Viewing details in the measurement screen .....	93
<b>Trend Data .....</b>	<b>93</b>
Viewing trend data in the measurement screen .....	94
<b>Past session .....</b>	<b>95</b>
Summary data screen .....	95
<b>File System menu .....</b>	<b>97</b>
Deleting sessions individually .....	97

Delete all sessions .....	98
Memory remaining and file properties .....	99
Estimated Run Time .....	100
<b>Chapter 6: DMS (Software).....</b>	<b>101</b>
EVM Communication .....	101
Downloading data with the EVM .....	102
<b>EVM: Viewing Data.....</b>	<b>102</b>
Selecting a session/study .....	102
EVM panel layout view (PLV) page .....	103
<b>EVM Reports and Printing.....</b>	<b>104</b>
Customizing reports .....	105
EVM Setup .....	106
Saving and sending configurations .....	106
General EVM setup .....	106
EVM general parameters table .....	107
EVM and logging settings .....	107
EVM logging parameters table .....	108
Figure 6-9: Logging EVM setups EVM and auto-run setting .....	108
EVM and auto-run setting .....	109
Timed-Run and auto-run setting .....	109
Date and auto-run setting .....	109
Day of week and auto-run setting .....	110
EVM and security settings .....	111
EVM and triggering settings .....	111
EVM and particulate settings .....	113
EVM and Particulates setup .....	113
<b>Chapter 7: Maintenance &amp; cleaning .....</b>	<b>115</b>
<b>Overview .....</b>	<b>115</b>
PID sensor .....	115
Removing and installing PID sensor .....	116
Maintenance and cleaning overview of PID .....	117
Cleaning PID sensor .....	117
<b>Optical Engine: maintenance and cleaning .....</b>	<b>120</b>
<b>Impactor care.....</b>	<b>123</b>
Impactors and when to clean .....	124
<b>Gravimetric cassette and filter paper .....</b>	<b>125</b>
<b>Appendix A: Specifications .....</b>	<b>126</b>
<b>Replacement and optional parts .....</b>	<b>136</b>
<b>Appendix B: Customer service .....</b>	<b>138</b>
Contacting 3M Quest Technologies Instrumentation .....	138
International customers .....	138
<b>Calibration .....</b>	<b>138</b>

<b>Warranty</b> .....	<b>139</b>
<b>Appendix B: Glossary of Terms</b> .....	<b>140</b>
<b>Appendix C: PID sensor and correction factors tables</b> .....	<b>146</b>
<b>Appendix D: FAQ's; particulate measurements</b> .....	<b>158</b>
<b>Appendix E: System errors displayed on the EVM series</b> .....	<b>163</b>

## List of Figures

Figure 1-1: Particulate path diagram .....	2
Figure 1-2: Particulates and diameter size .....	3
Figure 2-1: Identifying your equipment .....	11
Figure 2-2: EVM keypad and display explained .....	12
Figure 2-3: Start screen defined .....	14
Figure 2-4: Unit Information screen .....	16
Figure 2-5: Selecting Unit Info. Sensors .....	17
Figure 2-6: Viewing installed sensors .....	17
Figure 2-7: Communicating with QSP-II via USB cable .....	18
Figure 2-8: USB, power jack and digital output port .....	19
Figure 3-1: Time-Date screen parameters .....	22
Figure 3-2: Start screen .....	23
Figure 3-3: Battery screen .....	23
Display: language, contrast, & key click .....	24
Figure 3-4: Screen display settings .....	25
Figure 3-5: Logging screen .....	27
Figure 3-6: Estimated run time for logging screen .....	27
Figure 3-7: PID correction factor .....	28
Figure 3-8: PID correction factor displayed on measurement screens .....	28
Figure 3-9: Units screen .....	29
Figure 3-10: Edit profiles for dust calibration .....	31
Figure 3-11: Entering a profile for particulate calibration .....	32
Figure 3-12: Particulate setup screen .....	34
Figure 3-13: Configuring digital output .....	35
Figure 3-14: Air Velocity setting .....	36
Figure 3-15: Analog out results with temperature as output .....	37
Figure 3-16: Analog-Out screen .....	37
Figure 3-17: Defaults screen (restoring factory settings) .....	38
Figure 3-18: Restoring default calibrations .....	38
Figure 3-19: Backlight key .....	39
Figure 3-20: Lock Softkey .....	40
Figure 3-21: Setting lock/secure .....	41
Figure 3-22: Selecting auto-run with timed-run mode .....	42
Figure 3-23: Setting timed-run and duration .....	43
Figure 3-24: Selecting auto-run with date mode .....	44
Figure 3-25: Setting auto-run date mode .....	44
Figure 3-26: Setting auto-run DOW mode .....	45
Figure 4-1: Sensor housing and manifold .....	48
Figure 4-2: Sensors' locations .....	48
Figure 4-3: How the impactor functions .....	49
Figure 4-4: PM2.5 impactor setting example .....	50
Figure 4-5: Adjusting impactor/turret setting .....	51
Figure 4-6: Particulate zero cal with HEPA filter .....	52
Figure 4-7: Selecting calibration screen .....	53
Figure 4-8: Particulate cal screen .....	53
Figure 4-9: Particulate calibration and ready screen .....	54
Figure 4-10: Particulate calibration and waiting screen .....	54
Figure 4-11: Particulate calibration pause screen .....	55
Figure 4-12: Zero Cal set for Particulates .....	55

Figure 4-13: Reset gravimetric setting .....	57
Figure 4-14: Pump flow rate calibration .....	58
Figure 4-15: Flow Rate Calibration.....	59
Figure 4-16: Calibration history for EVM.....	61
Figure 4-17: Applying a gas sensor.....	62
Figure 4-18: Selecting sensor for calibration process.....	64
Figure 4-19: Calibration zero screen .....	64
Figure 4-20: Calibration zero pause screen .....	65
Figure 4-21: Span Calibration.....	66
Figure 4-22: Saved Calibration screen .....	66
Figure 4-23: Selecting a calibration sensor.....	68
Figure 4-24: Calibration CO2 ready screen .....	69
Figure 4-25: Setting CO <sub>2</sub> Span Cal screen .....	70
Figure 4-26: Saved Calibration.....	70
Figure 4-27: Selecting PID sensor for calibration process .....	72
Figure 4-28: Calibration mode screen.....	72
Figure 4-29: PID Calibration Span softkey.....	73
Figure 4-30: Saved Calibration screen.....	74
Figure 4-31: Temperature calibration.....	75
Figure 4-32: Calibration History screen.....	76
Figure 4-33: Calibrate offset verify screen for PID sensor.....	77
Figure 4-34: Calibrating PID .....	78
Figure 5-1: Quick help list for running a study .....	80
Figure 5-2: Sample summary data from QSP-II reporting.....	81
Figure 5-3: Sample time history data (or logged data) chart .....	82
Figure 5-4: Composite measurement screen in run mode .....	83
Figure 5-5: Example of measurement softkey menus .....	85
Figure 5-6: Particulate Measurement screen.....	86
Figure 5-7: Selecting a measurement calculation.....	88
Figure 5-8: RH and temperature measurement screen.....	89
Figure 5-9: Gas measurement screen .....	90
Figure 5-10: Composite measurement screen.....	91
Figure 5-11: Attaching AirProbe and measuring Air velocity.....	92
Figure 5-12: Details of the composite measurement screen.....	93
Figure 5-13: Selecting Trend softkey .....	94
Figure 5-14: Trend Screen for PM (Dust).....	94
Figure 5-15: Past session screen.....	95
Figure 5-16: Past Session with Files selected .....	96
Figure 5-17: Summary screen of a past session .....	97
Figure 5-18: Delete session message.....	98
Figure 5-19: Delete all sessions message .....	98
Figure 5-20: File Systems properties screen .....	99
Figure 5-21: Viewing estimated run time.....	100
Figure 6: Communicating with the EVM and DMS .....	101
Figure 6-1: DMS Start page and Setup/Download options .....	101
Figure 6-2: EVM and downloading.....	102
Figure 6-3: Data finder page.....	102
Figure 6-4: Charts and Graphs (panels) .....	103
Figure 6-5: EVM data in a report format.....	104
Figure 6-6: Customizing DMS reports.....	105
Figure 6-7: Saving and sending EVM setups.....	106
Figure 6-8: General EVM setups.....	107
Figure 6-9: Logging EVM setups.....	108
Figure 6-10: EVM Timed-Run Auto-Run setting .....	109
Figure 6-11: EVM Auto-Run with Date setting.....	110
Figure 6-12: EVM Auto-Run with Day of Week setting.....	110
Figure 6-13: EVM Auto-Run with Day of Week setting.....	111
Figure 6-14: EVM Triggering setup .....	112
Figure 6-15: EVM Auto-Run with Day of Week.....	113
Figure 7-1: Removing and inserting PID sensor.....	116
Figure 7-2: Removing intelligent-sensor casing with PID .....	118
Figure 7-3: Removing the lamp with removal tool .....	118

Figure 7-4: Remove/insert PID sensor with lamp & pellet .....	119
Figure 7-5: PID sensor cleaning kit .....	119
Figure 7-6: Fitting/Inserting the lamp and pellet.....	120
Figure 7-7: Optical engine and cleaning .....	121
Figure 7-8: Cleaning the optical engine .....	122
Figure 7-9: When to clean impactors .....	124
Figure 7-10: Gravimetric cassette and filter paper maintenance .....	125

## List of Tables

Table 2-1: Keypad/user interface explained	13
Table 2-2: Indicators (i.e., run, stop, battery, Altf)	15
Table 3-1: Display settings explained	24
Table 3-2: Logged intervals and selecting logged measurements	26
Table 3-3: Digital out/Logic settings	35
Table 4-1: Cross-sensitivity table of interfering gas	60
Table 4-2: Gas calibration softkeys explained	65
Table 5-1: Unit abbreviations	84
Table 5-2: Measurement softkeys explained	85
Table 5-2: Measurement softkeys explained (continued)	86
Table 5-3: Measurement values explained	89
Table 5-4: Past session files softkeys explained	96

# Introduction

The EPA (Environmental Protection Agency) conducted a study over the last 25 years (1975-2000) and determined that 107 measurable air pollutants, specifically carcinogens, exist in working environments. Combined with the advent of closed windows, modern office buildings and various cleaning solvents, the outcome has been energy efficient buildings and homes which contain levels of carcinogens. At **high levels, this is known as "Sick Building syndrome" and can cause acute** effects such as headaches, eye/nose/throat irritation, dry cough or itchy skin, fatigue, and trouble concentrating just to name a few. Area monitoring or spot checking for high levels of pollutants, such as particulates , **VOC's, and toxics, should be a common practice to ensure good indoor air** quality exists in your environment. If poor air quality is determined, engineering controls such as proper air ventilation and the removal of toxic gases, would be put into place in order to provide an adequate working/living environment.



The EVM is equipped to measure several different airborne containments or air pollutant applications including:

- Particulate matter sampling (dust monitoring)
- Gas sampling
- Temperature sampling
- Relative Humidity and Dew Point sampling

To get you started quickly with the EVM, the first chapter is dedicated to introducing basic particulate matter and toxic gas information. The subsequent chapters will guide you through setting up the EVM, running studies, and assessing your results with easy to follow steps and illustrations.



**CAUTION:** The EVM is intended to measure gases that are potentially dangerous to human health. To help ensure worker safety through the proper use of your unit, it is important that you not only read but also understand the contents of this manual. Please familiarize yourself with the unit before using it in a potentially hazardous situation.

## Particulate sampling (Aerosols/dust vapors)

The EVM is a portable-area monitoring instrument with a laser-photometer that measures and stores concentration levels of airborne-dust over time. It is designed to measure and help you identify the air pollutants, existing as matter (gases and aerosols) in the environment. The methodology used entails a handful of components including: an air inlet, the impactor (which is the particle size selector), the collection of particulates, gravimetric sampling, and the pump which are addressed in the upcoming sections.

### Particulate path

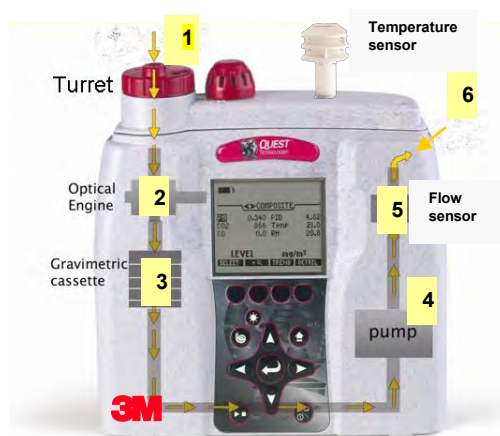
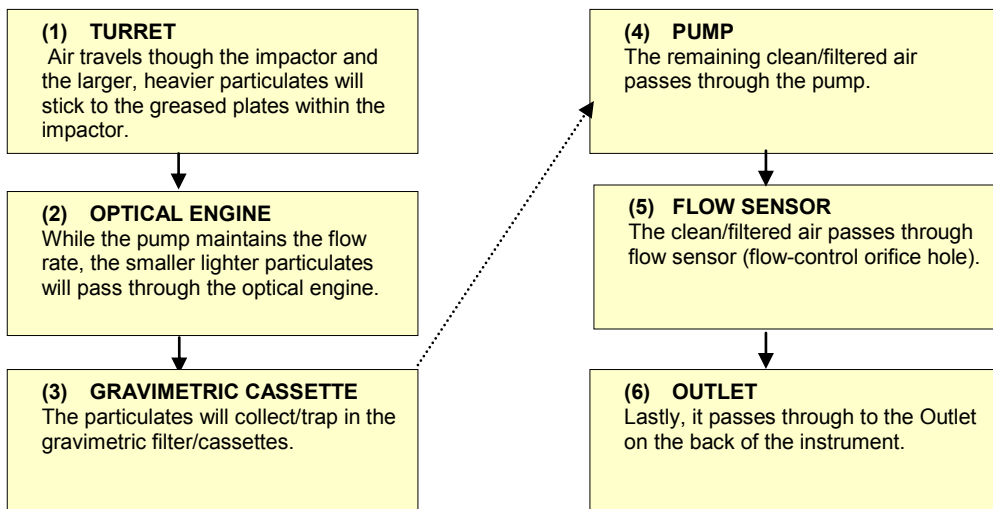


Figure 1-1: Particulate path diagram

## Particulate sizes

Aerosols and gases are experienced in industrial processes, workplaces, and in every day life. Keeping in mind that inhalable dust is 100 microns and smaller, this dust is usually filtered through the hairs and membranes in your sinuses. 10 microns and smaller is considered "thoracic", 4-10 microns is "inhalable" reaching into your windpipe and other regions, and 4 microns and smaller is "respirable". These particulate sizes will represent what you will be measuring.

The figure below identifies different types and sizes of particulates and how it affects the human body.

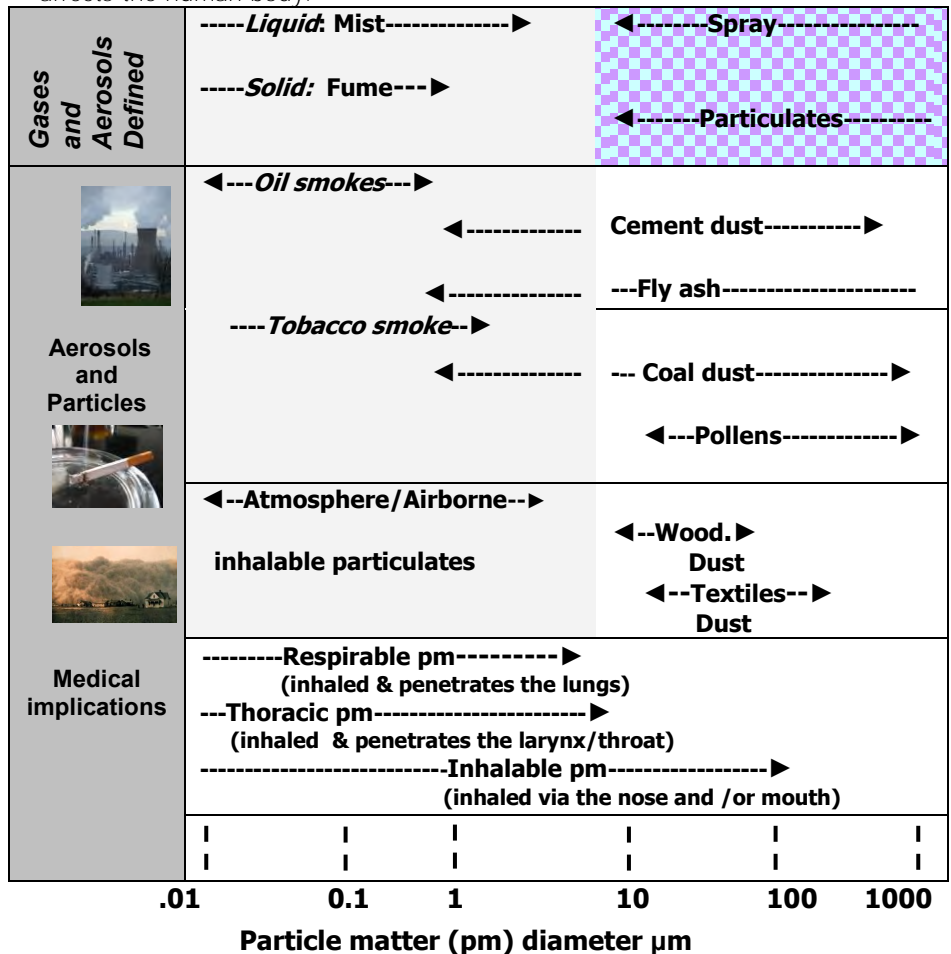


Figure 1-2: Particulates and diameter size

## 4 | Particulate sampling (Aerosols/dust vapors)

### *Particulates and cut-point*

### **Particulates and cut-point**

In consideration of how the size of particulates affect the human body, it is important to select a particulate size cut-point. Essentially, the particle size selector on the EVM is a top-mounted rotary impactor. Based on your setting, it will filter out all particulates at or above the selected size. The instrument has four settings which include 2.5  $\mu\text{m}$ , 4  $\mu\text{m}$ , 10  $\mu\text{m}$ , or none (100  $\mu\text{m}$ ). (This is explained in more detail in Chapter 4.)

### **Collecting/sensing the particulates**

Once the impactor setting is selected, the EVM collects (or measures) real-time aerosol/dust concentration using a 90° optical light scattering photometer to determine the total mass concentration (in units of  $\text{mg} / \text{m}^3$ ) of particulate matter. Additionally, gravimetric sampling, a more accurate method, is also used to determine the mass of particulates.

### **Gravimetric sampling**

Gravimetric sampling is a type of filtering process in which the particulates are collected and filtered into the gravimetric cassette after the dust passes through the optical engine of the EVM. A user supplied sealed gravimetric cassette can be used in place of the cassette provided by Quest. The sealed cassette can be sent to a laboratory for analysis. This testing is typically used to measure personal exposure to inhalable dust concentrations.



### **Pump**

The pump is used in the particulate sampling process as a source of air movement so the particulates are aspirated (or suctioned out) and collected for measurement. The flow rate is 1.67 Liter per minute. The pump is typically calibrated before each gravimetric sampling.

## Gas sensors sampling

The EVM uses a unique smart sensor technology includes automatic sensor recognition and measures up to three gases simultaneously: a selection of optional nine toxic gases, Carbon Dioxide, combustible gases, and VOC's.

## Gas sensors and path

Quest's unique smart sensor technology includes automatic sensor recognition, calibration levels, temperature compensation information and other valuable data that travels with the sensor from one unit to another.

The following diagram illustrates the gas sensor path for Toxic, CO<sub>2</sub>, and PID sensors. It also identifies the temperature sensor for additional analysis/measurements.

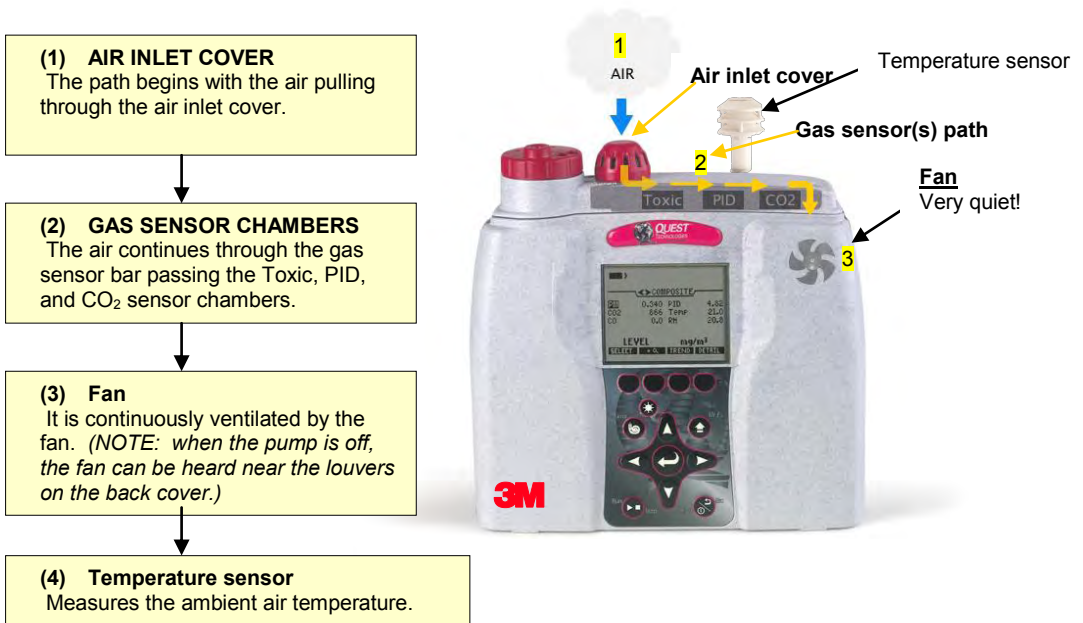


Figure 1-3: Gas sensor path illustration

## **Volatile organic compounds (VOC's) sampling**

According to the American Lung Association, Volatile Organic Compounds (also referred to as VOC's) are one of the top Indoor Air Quality (IAQ) pollutants. These include:

- Biological agents (mold, dust, mites..etc..)
- Formaldehyde
- Second-hand tobacco smoke
- Volatile organic compounds (measured with a PID detector)

Serious, long-term exposure could lead to health affects including leukemia, cancer, eye and respiratory irritations and short term effects such as dizziness, memory loss, and visual impairments.

With the EVM you have the following parameters:

- Range 0 to 2,000 ppm Isobutylene.
- Calibrated with Sensitivity 1.0, using Isobutylene. Response varies with each VOC.
- Units selection: ppm, ppb, mg/m<sup>3</sup> (for ppm PID sensor) or µg/m<sup>3</sup> (for ppb PID sensor).

## **Temperature, Relative humidity, Dew Point**

It is important to monitor temperature, control moisture, relative humidity, and monitor dew point levels in occupied spaces such as office buildings, schools, and hospitals, to name a few. With the presence of too much moisture mixed with dirt/dust particles, this can contaminate the environment and enable mold to thrive. High levels of relative humidity (RH) is a contributor of spreading and growing biological pollutants such as molds, mildew, viruses, mites, building dust, and pollen. Failure to control water leakage from humidifiers, refrigerators, and ventilation equipment can also lead to high levels of RH and high Dew Point. For appropriate air quality control, RH levels should be maintained between 30 to 50 percent in a home/office environment. Some of the common side effects include nausea, headaches, running nose, coughing, and difficulty breathing to name a few.

## **What the standards say**

Many organizations have studied and analyzed the effects of toxic gas and particulate exposures. As a result, standards were developed to regulate exposure. In the United States, the Occupational Safety and

Health Administration (OSHA), the Mine and Safety and Health Administration (MSHA), and the American Conference of Governmental Industrial Hygienists (ACGIH), NFPA (National Fire and Protection Agency), National Institute and Technology (NIST), and American Society of Heating, Refrigeration, and Air-Conditioning (ASHRAE) have all created regulations and limitations on total permissible exposure levels.

International standards are specified by the health and safety regulations such as the European Union (EU) and the European Committee of Air Handling and Refrigeration Equipment Manufacturers (EUROVENT-CEDOMAF). For Canadian standards, the Canadian Standards Association (CSA) specifies air quality guidelines/regulations.

## Resources

To access some of these copyrighted standards, please refer to the following:



• <b>OSHA</b>	<a href="http://www.osha.gov">http://www.osha.gov</a>
• <b>NFPA-654</b>	<a href="http://www.nfpa.org">http://www.nfpa.org</a>
• <b>MSHA</b>	<a href="http://www.msha.gov">http://www.msha.gov</a>
• <b>NIOSH</b>	<a href="http://www.cdc.gov/niosh">http://www.cdc.gov/niosh</a>
• <b>ACGIH</b>	<a href="http://www.cdc.gov/niosh">http://www.cdc.gov/niosh</a>
• <b>ASHRAE</b>	<a href="http://www.ashrae.org">http://www.ashrae.org</a>
• <b>NIST</b>	<a href="http://www.nist.gov">http://www.nist.gov</a>
• <b>IEC</b>	<a href="http://www.iec.ch">http://www.iec.ch</a>
• <b>CSA</b>	<a href="http://www.csa.ca">http://www.csa.ca</a>

## EVM Series

### Applications

A real-time, direct reading dust monitor is used in many different applications such as walk-through surveys in manufacturing, wood making plants and/or bakery shops, background sampling, site dust measurements, assessment of the effectiveness of dust control systems, and measurement of indoor air quality (IAQ). It is also used

to analyze work-place exposure and help identify dust control techniques such as training or implementing engineering controls.

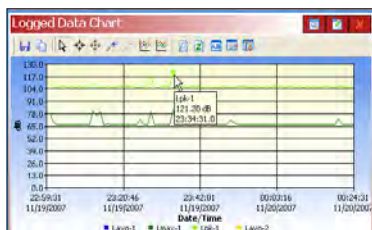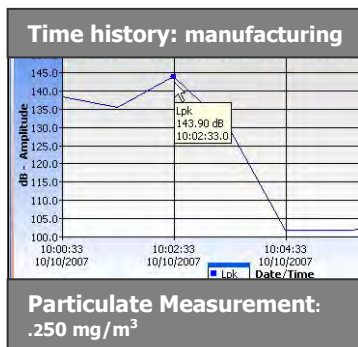

- ☑ **Industrial setting - Used** to monitor and ensure health and safety in settings where toxic fumes are released (such as testing levels at a paper mill or a foundry). This information can be used to identify the source and particle concentrations.
- ☑ **Sick Building syndrome** – Used to evaluate air toxins and ensure building standards maintain a comfortable work setting.
- ☑ **Work site** assessments
- ☑ **Military** applications
- ☑ **Outdoor monitoring** applications include construction sites/dust outside of mines
- ☑ **Regulatory compliance** (i.e., OSHA, MSHA, IEC, ACGIH)
- ☑ **As a mapping device**- Layout a grid of high contaminant areas, and quickly collect sample data at multiple locations to help identify paths and sources, by relative readings.
- ☑ **As a survey monitor**
  - **Specific area in a plant/facility** – used to maintain a quality work environment and conduct area monitoring samples throughout an entire facility.
  - **Specific areas in a plant/facility**- used to identify key areas that may be toxic or unsafe and implement acceptable practices such as changes in the ventilation.

## Models explained

The EVM Series simultaneously measures and data logs specific sensors/parameters that were ordered with your instrument. The models, sensors, and accessories are explained in detail below. Please refer to the part's listing for further details (such as calibration accessories).

Models and sensors	Optional sensor accessories
<b><u>EVM-7 includes:</u></b> <ul style="list-style-type: none"> <li>✓ Particulates</li> <li>✓ Carbon monoxide (CO) or (1) selectable toxic gas <ul style="list-style-type: none"> <li>• Selectable toxic gas sensors include: <ol style="list-style-type: none"> <li>1. Carbon Monoxide (CO)</li> <li>2. Chlorine (CL2)</li> <li>3. Ethylene Oxide (ETO)</li> <li>4. Hydrogen Cyanide (HCN)</li> <li>5. Hydrogen Sulfide (H<sub>2</sub>S)</li> <li>6. Nitric Oxide (NO)</li> <li>7. Nitrogen Dioxide (NO<sub>2</sub>)</li> <li>8. Oxygen (O<sub>2</sub>)</li> <li>9. Sulphur Dioxide (SO<sub>2</sub>)</li> </ol> </li> </ul> </li> <li>✓ Volatile Organic Compounds with PID ppm or PID ppb sensor <ul style="list-style-type: none"> <li>• ppm – parts per million (0 – 2,000 ppm)</li> <li>• ppb – parts per billion (0 – 50,000 ppb)</li> </ul> </li> <li>✓ Relative Humidity</li> <li>✓ Temperature</li> <li>✓ Carbon Dioxide (CO<sub>2</sub>)</li> </ul>	<ul style="list-style-type: none"> <li>✓ AirProbe-10</li> </ul>
<b><u>EVM-4 includes:</u></b> <ul style="list-style-type: none"> <li>✓ Carbon monoxide (CO) or selectable toxic gas</li> <li>✓ Relative Humidity</li> <li>✓ Temperature</li> <li>✓ Carbon Dioxide (CO<sub>2</sub>)</li> </ul>	<ul style="list-style-type: none"> <li>✓ AirProbe-10</li> <li>✓ Toxic sensor/CO sensor</li> <li>✓ CO<sub>2</sub> sensor</li> <li>✓ PID sensor</li> <li>✓ Particulates</li> </ul>
<b><u>EVM-3 includes:</u></b> <ul style="list-style-type: none"> <li>✓ Particulates</li> <li>✓ Relative Humidity</li> <li>✓ Temperature</li> </ul>	<ul style="list-style-type: none"> <li>✓ AirProbe-10</li> <li>✓ Toxic sensor/CO sensor</li> <li>✓ CO<sub>2</sub> sensor</li> <li>✓ PID sensor</li> </ul>

**This page left blank intentionally**

# Getting started

This chapter is designed to guide you through basic information you will need to begin measuring with your environment monitor.

## Checking the equipment

If your instrument was sent to you in a storage case, you will want to remove all the packaging and acquaint yourself with the following equipment.

- **NOTE:** Depending on the accessories you selected, the EVM may have the components displayed in Figure 2-1. For additional sensors or other accessories, please refer to "Replacement parts" on page 136

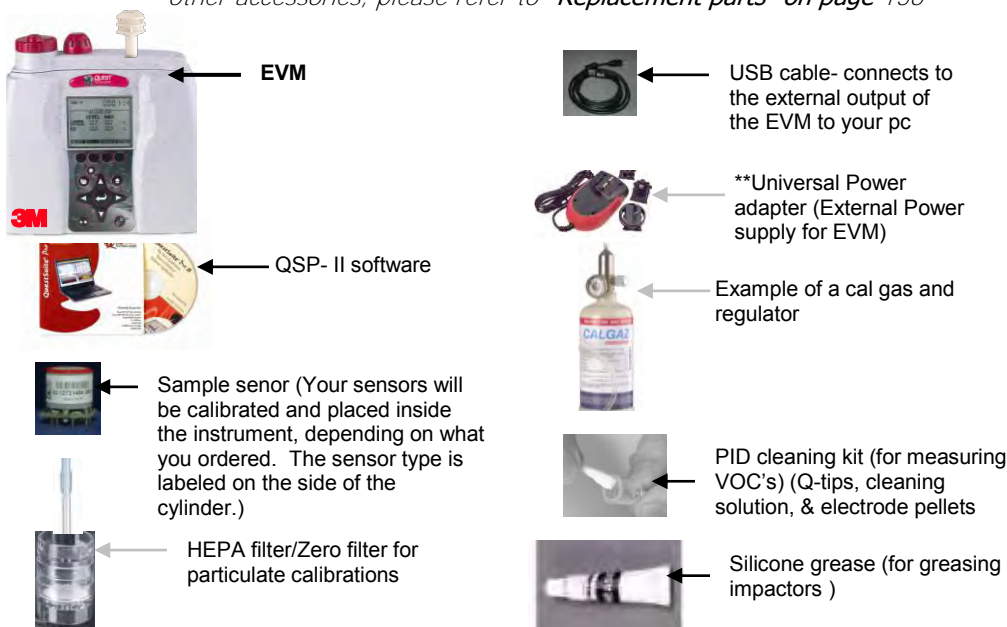


Figure 2-1: Identifying your equipment

## Display and keypad

The keypad is used to run and stop your studies, view your measurement values, select appropriate set-up parameters, and power on and off.

### Diagram

The following diagram explains the features on the display and keypad.




Figure 2-2: EVM keypad and display explained

## Keypad description

Keypad	Explanation
1. Display	Used to view data, menus, and various indicators.
2. Backlight	Used to illuminate the background of the display screen. (i.e., nighttime study.)
3. Particulate pump	Used for particulate measuring. Toggles the internal pump on and off (used for particulate measurements)
4. Left arrow	Used to toggle through the views and to move left through menu selections.
5. Run/Stop	Used to Run or Stop log session.
6. Indicators	Status information is provided by the instrument at the top of the display.
7. Softkeys	The softkeys are only applicable when a second menu appears above the keys. For example, in the Dust measurement screen, a lookup softkey, a trend menu, and a detail menu appear directly above the softkeys on the display.
8. Up arrow	Used to select menu options (in the setup screens) and select measurement values (or data).
9. Alt/key	The Alt/key (or Alternate Functions) is used to switch between softkey menu and selected menu. This is an option in various screens (ie, calibration screens).
10. Enter key	Used to open a selected menu. Toggles through selected measurement parameters when viewing measurement screens.
11. Right arrow	Used to toggle through the views and to move right through menu selections.
12. Down arrow	Used to select menus options (in the setup screens) and select measurement values (or data).
13. On/Off/Escape	Used to turn on the EVM, turn off, and to Escape (or move back one screen).




**Table 2-1: Keypad/user interface explained**

## Turning on

1. To turn on the EVM, press the **On/Off /Esc** .
- ☒ A Quest Technologies splash screen will appear including the firmware version name.
- ☒ Proceeding the splash screen, you will be viewing the **Start** screen.

## Start screen explanation

The main screen you encounter and is referenced throughout the manual is the Start screen. From the start screen, you can access the measurement screens, the setup screen, calibration screens, file system screen (used to view past sessions and clear data), and unit information screen (includes serial number information). (The measurement screens are explained in more detail in Chapter 5.)

1. To select a menu option, press  **Arrows** and then press **Enter** . (This will open the selected menu screen.)
2. To view the measurement screens, press the **Right or Left**  **Arrow** and this will toggle you through the measurement views.

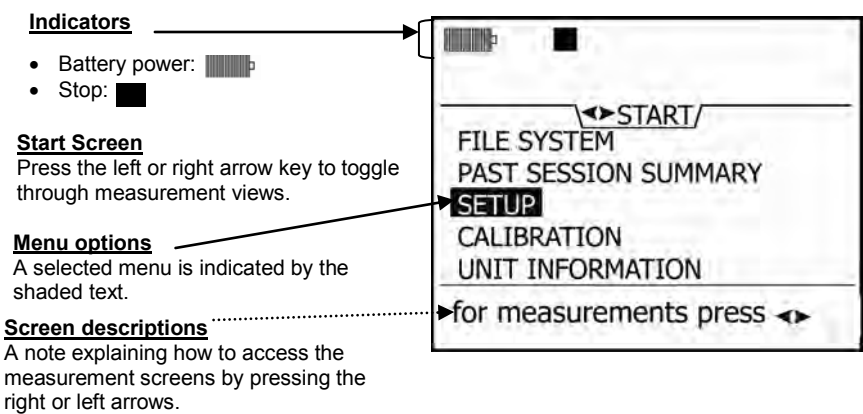


Figure 2-3: Start screen defined

## Navigating

Once the EVM is powered-on, press the **Up/Down Arrow Key** to select a menu or to edit a field.

Press the **Left/Right Arrow Key** to scroll through measurement screen, start screen, or to move right or left in a menu (i.e., setup menu).

Press **Enter Key** to open a selected screen (i.e. Setup screen). It is also used to save Setup parameters.

The **On/Off/Esc Key** also functions as a navigational tool and is used to move back one screen (or escape). It can be used if you are viewing a Setup screen, File System screen Calibration screen or Unit Information screen. At any time, you can cancel a set-up change, file system change (etc...) by pressing the on/off/esc key.



## Indicators/Icons on the display


The EVM is equipped to notify you of operational/status updates. These indicators (or alert notices) are located at the top of the screen. Table 2-2 explains the function of each indicator.

Indicator Icon	Explanation
	<b>Stop</b> – indicates the instrument is currently in the stop status (opposed to run).
	<b>Run</b> - indicates the instrument is currently logging a session/study.
	<b>Battery charge status</b> - This icon shows the remaining capacity of the batteries. A full battery indicates the instrument is fully charged.
	<b>Pause</b> – The pause indicator is shown during the 5 second countdown to prime the airflow prior to entering the run mode when a log session is started.
<b>OL</b>	<b>Overload</b> –will appear whenever the level measurement exceeds the range of the instrument.
	<b>Alt/key (Alternate Function key)</b> - this icon appears below the Battery Charge Indicator when alternate functions are being displayed. (For example this is used in the Trend screen to view the time history on the chart.
<b>UR</b>	<b>UnderRange</b> – will appear whenever a level measurement is below the range of the instrument.
<b>00:00:00</b>	<b>Run Time</b> – displays the current elapsed log session run time. When elapsed time is less than 100 hours, time is displayed as HR:MIN:SEC. When the elapsed time has exceeded 100 hours, time is displayed as HR:MIN where HR uses 4 digits and MIN uses 2 digits.

**Table 2-2:** Indicators (i.e., run, stop, battery, Alt/ )

## Turning off

When turning off the EVM, ensure you are in stop mode. A stop indicator will appear on the top left next to the battery charge status icon. If it is in run mode, stop the **session** and then proceed below.



1. From any measurement view or the start screen, press the **On/Off** .
2. "3, 2, and 1" countdown will appear as the EVM is powered off. Continue to press and hold until the instrument is powered off.
  - ☑ **NOTE:** to cancel the shutdown process, release the On/Off/Esc key and it will return you to the screen you were previously viewing (i.e., PM measurement screen).
  - ☑ **Auto-Run Note:** if an auto-run session has been set, the auto-run summary screen is displayed prior to turning off. See section, Auto-Run in Chapter 3.

## Instrument Information

The general information screen also called the "unit info" screen is used occasionally to check the type of instrument you purchased and displays the serial number and firmware versions.

### Unit information screen

#### ➤ Opening the unit info screen

1. Turn on the EVM by pressing the **On/Off/Esc** .
2. In the start screen, press the down arrow repeatedly until **Unit Info** is selected and press **Enter** .
  - The unit info screen will appear.





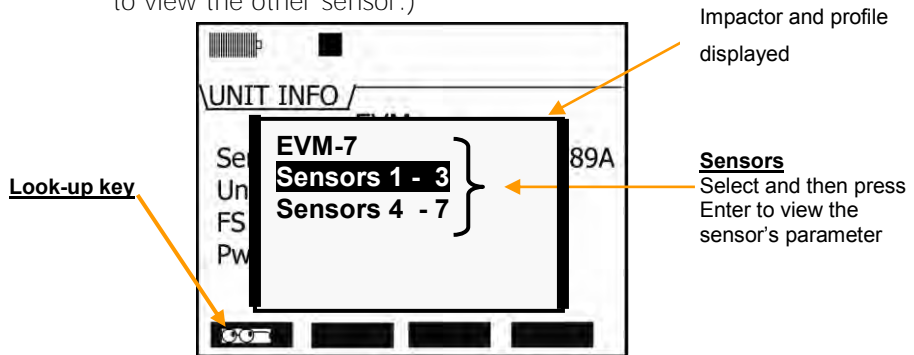



Figure 2-4: Unit Information screen

3. To view the installed sensors, repeatedly press **Enter**  and it will display the Unit Info screen with the installed sensors. (See Figure 2-6).
4. Or press the **Look-up** key. Then press the  **Arrow** to select and press **Enter**  to open the screen. (Repeat this step to view the other sensor.)

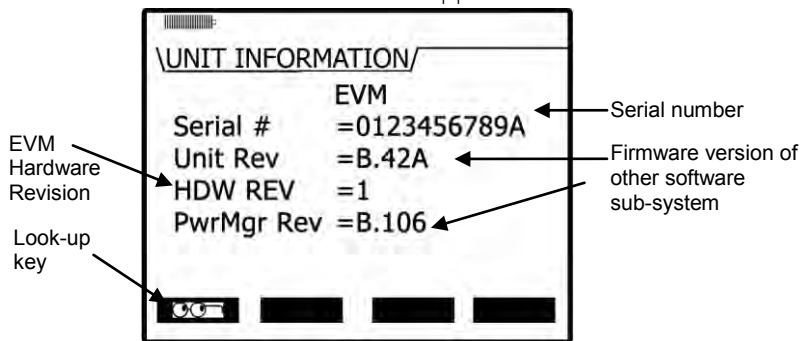

**Figure 2-5: Selecting Unit Info. Sensors**

5. Unit Info screens are displayed below.
  - Screen "A" displays the particulates (PM), temperature (temp), and humidity as "Installed" or "Enabled" sensors.
  - Screen "B" displays CO<sub>2</sub>, CO (or installed toxic sensor), and PID with the associated serial numbers. Air Velocity is listed as "Not Found" which indicates that the sensor was not installed.

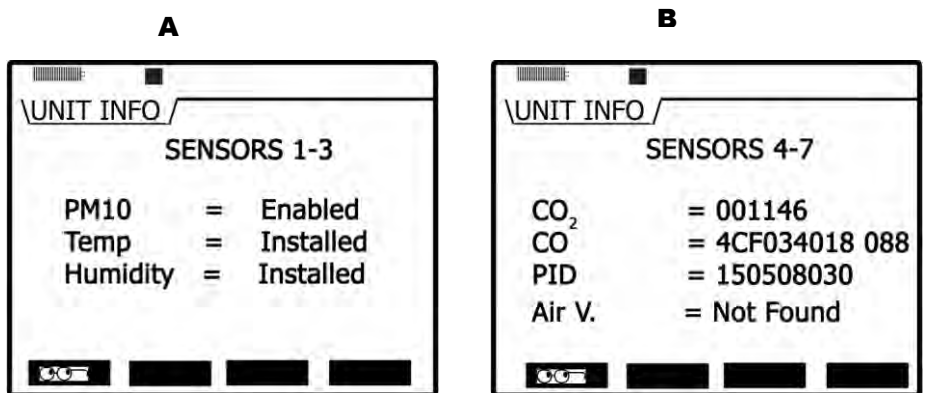

**Figure 2-6: Viewing installed sensors**

## 3M™ Detection Management Software DMS

DMS is a software application designed by 3M Quest Technologies that runs under the Windows operating system. You can use DMS for a variety of functions such as: customizing your set-up parameters, displaying data, manipulating data, and creating reports.

### Communicating

A USB cable (included in the kit) is used for communicating between the EVM and the software. (First remove the black rubber casing over the ports and then insert the USB cord in the bottom connector.)  
(See Chapter 6 for more details on software and the EVM.)



**Figure 2-7: Communicating with QSP-II via USB cable**

## Powering and outputs on the EVM

### Battery

The battery is an internal Lithium-ion Rechargeable battery pack. The minimum hours of operating time is 8 hours of continuous operation including setup time, run time, and viewing your result time. This battery is not user accessible or replaceable.

The universal power adapter cord is a 10 to 16 volt power inlet (nominal 12VDC) with 1.5amps and is used as an external power source. (For more details on battery power, see "Checking battery power" in Chapter 3).

### Charging

The rechargeable battery pack is charged by plugging in the universal power adapter cord into the charging-port and into an electrical outlet. When using the EVM and the power adapter, it will charge as you use the instrument. The estimated time to recharge a fully discharged battery pack is approximately five hours. It is important to understand that the USB connection/cable will not charge the internal battery. USB is used for communication purposes only.

☑ **NOTE:** When the batteries are depleted and if you are charging the instrument, the temperature sensor will read at a higher level. Thus, it is recommended to measure the **temperature** when you are **not charging** the instrument.

### About the Environment

If the environment you are in is above 40° C (104° F) when charging the battery, then you will be unable to charge the battery. (Please see Appendix D for screen warnings.)

### Outputs

The digital output and/or analog output can be used to connect to external devices such as a chart recorder or a light notification device. The monitor's digital out and analog out channel are accessible through the Input/Output connector. The air velocity wand also uses this connector. (The following diagram depicts the backside of the instrument without the back cover and the black rubber casing removed.) For more information on connecting and using a stereo plug, see Appendix D page 160.

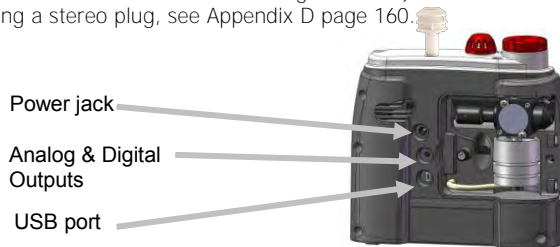


Figure 2-8: USB, power jack and digital output port

**This page left blank intentionally**

# Setting up the EVM

The focus of this chapter is to address all of the setup options available on the EVM. Once your parameters are selected, you will want to refer to the Calibration chapter (see Chapter 4).

☑ **NOTE:** *if you are using QSP-II, you may want to program all of your setting via the software. Please refer to Chapter 6, for QSP-II details.*

## Setting up parameters via the keypad

The following user-adjustable setup screens are explained will appear for all instrument models:


- Time and date screen
- Battery power check screen
- Logging screen includes selecting the logging interval, averaging time, and logged measurements
- Display settings include selecting key clicks, language, and display contrast
- Setting up Input/Output (I/O) options including digital-out, air velocity, or analog-out

If you ordered the EVM-7 model, a Particulate setup menu and a PID setup menu will also appear.

## Time and date setting


The EVM uses a 24-hour clock (military time) and specifies date by day, month, and year. The date and time setting are important elements used as you are analyzing your log data results.

### ➤ Changing time and date settings




1. Turn on the EVM by pressing **On/Off/Esc** .
  - The **Start** screen will appear (see Figure 3-2 for details).


## 22 | Setting up parameters via the keypad

### Checking battery power


2. Ensure **Setup** is highlighted and press **Enter** . (The **Setup** menu will appear.)
3. In the **Time/Date** screen, press the **Arrows** to select **Time** field or **Date** field. (Note the Day field will update automatically based on the selected day from the date field.)

**✓ NOTE:** *it will be highlighted when selected.*

4. Press **Enter**  to move to the update fields (2<sup>nd</sup> column).
5. To change the field values, press **Arrows**. To move to the next field, press the **right/ left** arrow key. Repeat this step as necessary.
  - To return to the first column field (Time, Date, or Day), repeatedly press **Enter**  or press **On/Off/Esc**  to cancel session.
6. Continue to repeat steps 3-5 until all changes have been made.

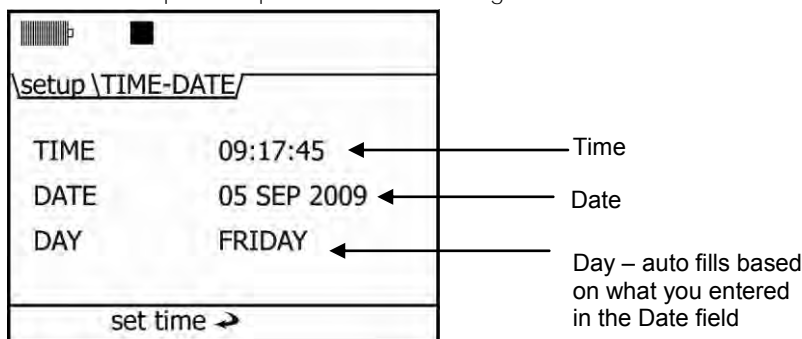

**Figure 3-1: Time-Date screen parameters**

7. Press the **On/Off/Esc**  twice to return to the start screen.
- \*** *Remember, once you return to the start screen, you can press the right or left arrows to toggle through the measurement screens.*

## Checking battery power

The battery power is supplied by an internal lithium-ion rechargeable battery pack with a minimum of 8 hours of continuous operation.

**✓ NOTE:** *the battery pack is not-user replaceable and would need to be changed at QUEST or your authorized dealer.*


The battery screen is used to determine the battery capacity status. When operating from the battery, you can check the remaining capacity of the battery pack at any time by accessing the Battery screen. Additionally, a battery indicator will be present on all screens to notify you of the remaining battery capacity. If the battery indicator is at 100%, it will look similar to the Figure 3-3 below.

If you are charging the battery, the battery screen will display “battery is charging” with an updating indicator bar. The battery power percentage will update accordingly.

➤ **Check battery power**

1. From the start screen, highlight **Setup** (by pressing **Arrows**) and press **Enter**.

☑ **NOTE:** If viewing a measurement screen, press the right/left arrow until the start screen appears.

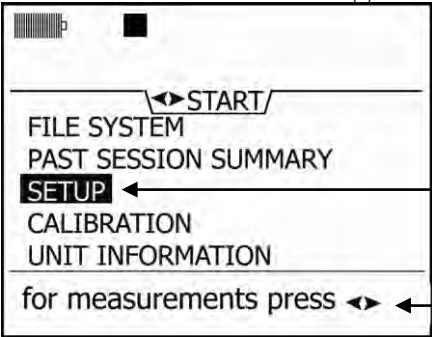


**Start screen**  
Highlighting indicates “Setup” menu is selected

**Measurement screens**  
Press right or left arrow to view

Figure 3-2: Start screen

2. Repeatedly press **Arrows** until **Battery** is selected.
3. In the **Battery setup** screen, it will display the remaining capacity on the battery pack.
4. To return to the Start screen, press **On/Off/Esc** twice.

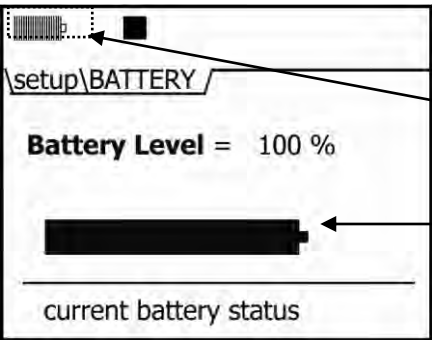

Battery indicator has all bars representing fully charged battery

Indicates remaining battery capacity

Figure 3-3: Battery screen






Display: language, contrast, & key click

In the display screen, there are three selectable settings including language, contrast, and key click.

Display settings	Explanation
Language	With the <b>language</b> setting, there are six options including: English, Spanish, German, French, Italian, and Portuguese.
Contrast	With the <b>contrast</b> setting, you may want to adjust the shading of the display (or screen contrast) by darkening or lightening the screen to fit the environment you will be operating the instrument in. The contrast setting ranges from 1-12 in which 12 represents the darkest and 1 represents the lightest.
Key Click	With the <b>key click</b> setting, you can turn the sound to "on" and each time you press a key on the keypad you will hear a soft click sound. This can be disabled by choosing the "off" setting.

Table 3-1: Display settings explained

➤ Changing language, contrast, and key click settings

- From the start menu, press **▲▼ Arrows** to select **Setup** and press **Enter** .
- Repeatedly press the **▼ Arrow** to select the **Display** menu and press **Enter** .
- To select a field in the display screen, press **▲▼ Arrows** to select one of the fields. Press **Enter**  to move to the 2<sup>nd</sup> column (changeable field).
- Please follow the fields that apply:
  - To change the **Language**, press **▲▼ Arrows** to select a specific language. Press **Enter**  to move back to left column or escape to cancel selection.
  - To change the **Contrast**, press **▲ Arrow** repeatedly or press **▼ Arrow** repeatedly to decrease the contrast setting. Press **Enter**  to move back to left column or escape to cancel selection.

- To change the **Key click sound setting**, press  **Arrows** until On/Off is displayed. Press **Enter**  to move back to the left column or escape to cancel selection.

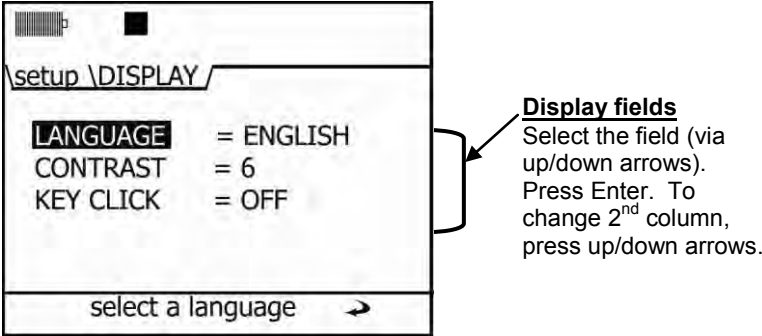


Figure 3-4: Screen display settings

5. To return to the **Start screen**, repeatedly press **On/Off/Esc** .

Setting logging and viewing run time

With the logging screen, you select the logging interval (i.e., 1 min. data logging), the averaging parameter (i.e., a type of data filter) and which parameters will be logged and stored into memory. An optional field, Run Time, allows you to view the amount of remaining log time when logging parameters are selected.

For logging, there are two selectable fields- the logging interval rate and the measurement averaging.


Log intervals	Explanation
Log interval	This sets the log interval between specific data points. For example, if logging is set to 5 second intervals, then all parameter values are logged every 5 seconds. The logging parameters options are as follows: 1 second,5 seconds, 15 seconds, 30 seconds, 1 minute, 5 minutes, 10 minutes, 15 minutes, and 30 minutes, and 60 minutes.
Averaging	The <b>Averaging</b> parameter is used to average all measurements displayed on the screen. If averaging is set to 15 then the last 15 measurements are averaged. (New measurements are updated every second.) This averaged value is displayed on the monitor. <b>It's basically a data filter.</b> The averaged data will change less rapidly than the 1 second data since it is averaged. The user options are 1 – 30 with increments by 1 interval. <b>NOTE:</b> 15 second averaging is recommended for the average setting. All the sensors have settling times of 10 seconds or longer.

Logged data attributes	Explanation
<b>Measurements</b>	<p>Selectable logged measurements: Level, Lmin, Lmax, Lavg, and STEL.</p> <p>If the measurement is set to <b>"On"</b>, this indicates the instrument will log data at the logged interval (i.e., while in run mode). <b>"Off"</b> indicates the measurement will not log when in run mode.</p> <p>The measurements include the following: Level (instantaneous or averaged measurement), STEL (short term exposure level calculated over last 15 minutes), Lmax (maximum measurement during log interval), Lmin (minimum measurement during log interval), Lavg (average measurement during log interval), and TWA (time weighted average measurement during interval).</p> <p><b>NOTE: See "Table 5-3" for more information.</b></p>
<b>Run Time</b>	<p>Depending on the logged parameters that are turned <b>"On"</b> for data log and the log interval, the <b>Estimated Run Time</b> screen will display the total remaining run time. For example, if you wish to log all parameters the overall run time will decrease significantly. If you would like to extend the run time to a longer duration, logging one or two parameters would be advisable.</p>

**Table 3-2: Logged intervals and selecting logged measurements**


➤ **Set logging intervals, logging attributes, & view run time**

- From the start menu, press **▲▼ Arrows** to select **Setup** and press **Enter**. Select **Logging** and press **Enter**.
- To change **Logging Interval** or **Averaging** follow below:
  - Press **▲▼ Arrows** to select Logging interval or Averaging.
  - Press **Enter** to move to the changeable field, and then press **▲▼ Arrows**.
  - Press **Enter** to return to the 1<sup>st</sup> column and save your settings.
- To **enable/disable logging**, follow below:
  - Select a measurement by pressing **▲▼ Arrows**.
  - Once selected, press **Enter** (this will move your cursor to the "On/Off" field.)
  - Press **▲▼ Arrows** to toggle and select **On** or **Off**.
  - Press **Enter** again to return to the measurement.
  - Repeat step 3 until all logging parameters are enabled/disabled.

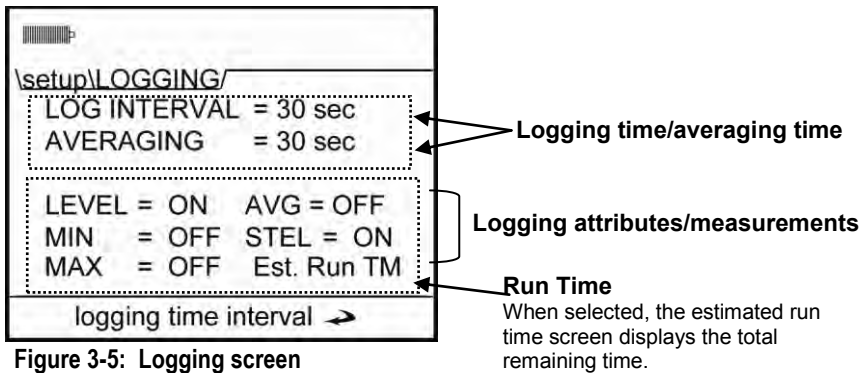

4. **Optional:** To view the **Estimated Run Time**, select this field (by pressing **▲▼ Arrows**) and press **Enter**. The estimated run time screen will appear.

☑ **NOTE:** to extend the logging time, turn a *logged measurement(s)* to "Off" and/or change the log interval. Then, re-check the estimated run time.

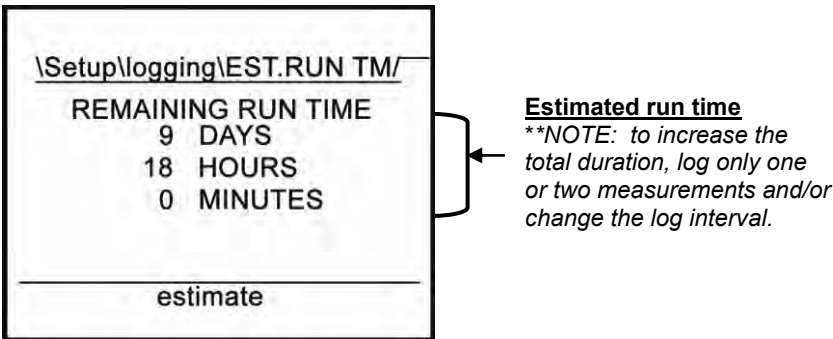

5. Press **On/Off/Esc** repeatedly to return to the **Start** screen.


## PID correction – adding/editing

For best PID testing results, it is recommended to add a correction factor to the relevant VOC you intend to measure. Please refer to the PID correction factors table in Appendix C for more details.

### ➤ Adding/Editing PID correction factor

1. From the start menu, press **▲▼ Arrows** to select **Setup** and press **Enter**.

- 2. Select **PID** by pressing **Arrows** and press **Enter**. The PID correction factor screen will appear.
- 3. Press **Enter** to move to the value field. Press **Arrows** to change the value. Press **Enter** save your changes.
- 4. Press **On/Off/Esc** repeatedly to return to the start screen.

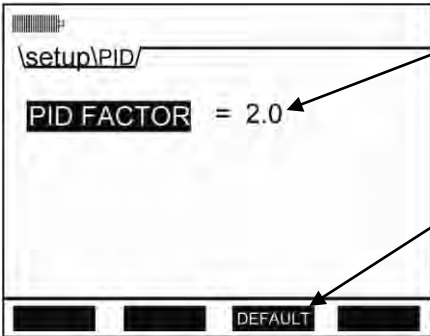


**PID Factor number**  
Press up/down arrows on keypad to change value. Press Enter to save.


**Default softkey**  
Press to restore PID factor to default ("1").

Figure 3-7: PID correction factor

☑ **NOTE:** When changing PID factor to a value *excluding* "1", the PID correction factor will appear as a subscript on the measurement screens. Two samples are displayed below:

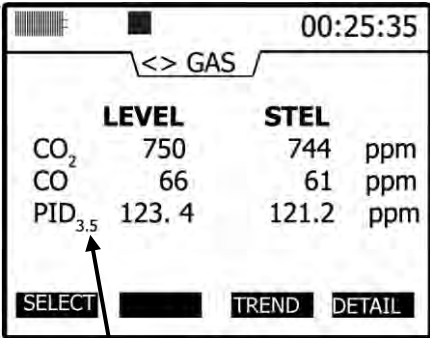

**PID and correction factor**  
The applied correction factor "3.5" is displayed in the Gas measurement screen.

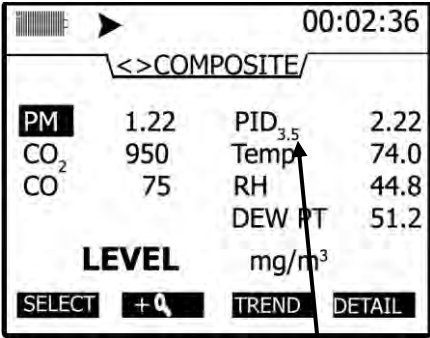

**PID and correction factor**  
Displayed in the Composite measurement screen.

Figure 3-8: PID correction factor displayed

on measurement screens







## Changing units (temperature, particulates, PID, and air velocity)

In the units screen, the temperature, particulates, and the air velocity values can be displayed in different measurement units.

- Temperature's setting is either Celsius (°C) or Fahrenheit (°F) with °C as the default.
- Particulates setting is either in mg/m<sup>3</sup> (milligrams per cubic meter) or µg/m<sup>3</sup> (micrograms per cubic meter).
- PID PPM/PPB sensor (VOCs) setting is either PPM or mg/m<sup>3</sup>. PPB or µg/m<sup>3</sup>.
- Air velocity setting is in meters per second or feet per minute.

**NOTE:** if you do not have an air velocity sensor connected, it will not be displayed in this screen.

### ➤ Changing temperature, particulates and/or air velocity units

1. From the **Start** screen (see Figure 3-2 for details), select **Setup** and press **Enter** .
2. In the Units screen, press  **Arrows** to select the **Temperature**, **PM** (Particulates), or **Air Velocity** field.
3. Once selected, press **Enter**  to select the units field.
4. Press  **Arrows** to select the appropriate unit.
5. Press **Enter**  to save and move back to the first column.
6. To return to the start screen, press **On/Off Esc**  twice to return to the screen.

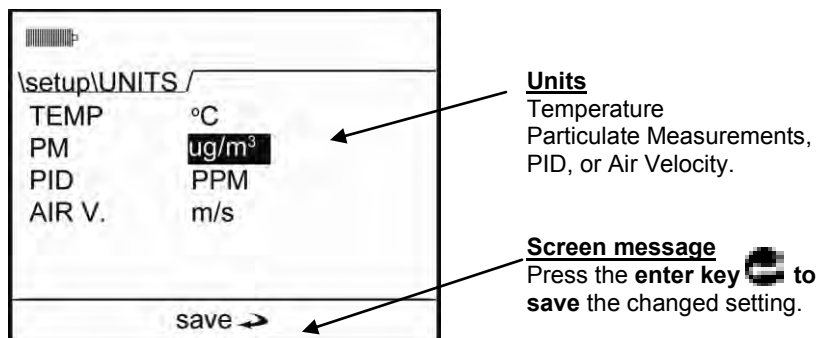


Figure 3-9: Units screen

## Setting up particulate settings

There are four parameters in the particulate screen which include:

- **Particulate field**- enables and disables when measuring particulates. (If disabled, it will not enable the pump during run mode.)
- **Profile field** – used to select the active particulate profile. The active profile can be edited by pressing the edit quick key.
- **Gravimetric Mass and Gravimetric volume fields** – displays the accumulated theoretical particulate mass and air volume which has passed through the gravimetric filter (since the last gravimetric reset). These can be reset by pressing the reset quick key.

## Setting profiles (particulate correction factors)

The EVM supports 8 different particulate matter (PM) profiles with customized name settings and user correction factor settings. When the profile field is selected from the particulate menu, you are able to edit this field by pressing the Edit softkey. Once opened, you can change the profile name and correction factor setting. (**NOTE:** *each profile stores up to 4 calibration verifies.*)

1. **Profile Name:** You can change profile name and assign up to 8 characters.
2. **Factors:** A user will have different correction factors based on the type of dust you are measuring.

## How particulate factors are adjusted and calculated

All particulate profiles are factors are calibrated to Arizona Road Dust (ARD) with it's particle size and composition. Other dust compositions can be measured accurately by adjusting a profile's correction factor.

☑ **NOTE:** *For best measurement results, it is recommended to enter in the dust correction factor prior to your particulate study. (This may require a gravimetric sampling.)*

To calculate a **correction factor**, please follow the guidelines below:

1. Run the instrument in the applicable environment for a set period of time/volume (i.e., 6 -8 hours).
  - **Accumulators:**
    - ✓ *The **gravimetric mass accumulator** will display the amount of dust accumulated based on the active profile.*

## 31 | Setting up parameters via the keypad

*How particulate factors are adjusted and calculated*

- ✓ The **gravimetric volume accumulator** will display the amount of volume passed through the gravimetric filter.
- 2. After the run, check the gravimetric mass accumulator, compare to what was actually measured from the lab, and enter in a correction factor.
- ★ For example, before measuring ensure the gravimetric accumulators are reset and the gravimetric filter is replaced. Next, you measure for four hours and the gravimetric accumulator is displayed as 10mg. Then, you measure the dust in the gravimetric filter (or cassettes) and determine the actual weight. If the actual weight is 20mg, you would change the correction factor from 1 to 2.

### Dust correction factors (profiles)

When setting up the particulate parameters, it is good to keep in mind that the user defined profiles (or correction factors) are a submenu of the particulate menu. Because of this layout, the following section explains how to change the profiles/correction factors and apply a new profile.

#### ➤ Setting dust correction factors (profiles)

1. From the **Start** screen, select the **Setup** menu by pressing **Arrows** and press **Enter**.
2. Press **Arrows** repeatedly until **Particulate** is selected and press **Enter**. (The particulate setup screen will appear.)
3. Ensure **Particulate** is set to **Enabled**. (If not, press **Arrows** to enable and press **Enter** to return to the first column.)
4. Select the **Profile field** by pressing **Arrows** and press the **Edit** softkey.


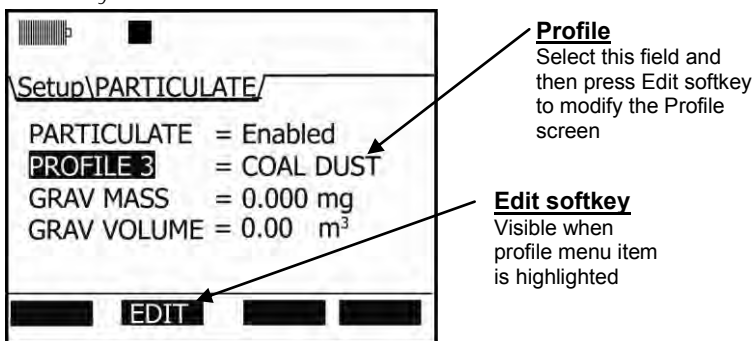


Figure 3-10: Edit profiles for dust calibration

## 32 | Setting up parameters via the keypad

*How particulate factors are adjusted and calculated*

5. Press the **Edit** softkey and the Edit Profile screen will open.

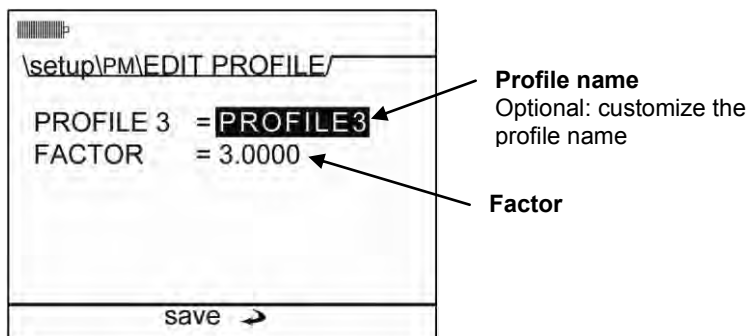









**Figure 3-11: Entering a profile for particulate calibration**

6. (Optional, see step seven if not changing profile name.) To change the name of the profile, ensure the profile field is selected and press the **Enter** . Press **▲▼ Arrows** to change the characters. To move to the next position, press **◀▶ Arrows** then press **Enter** .
7. Press **▼ Arrow** to select the **Factor** and press **Enter** to move to the 2<sup>nd</sup> column. Press **▲▼ Arrows** to change the numeric value. Press the left/right arrow key to move to the next position. Continue this process until the appropriate number is selected and press **Enter** to confirm or Esc key to cancel changes.
8. Press the **On/Off/Esc** to return to the particulate screen.
9. To apply a new profile, select the profile field and move to the second column (by pressing **Enter** ). Then continuously press **▲▼ Arrows** until the appropriate profile/correction factor is selected. Press **Enter** to return to the first column.
10. Press **On/Off/Esc** twice to return to the start screen.

## Particulate pump: enable or disable

You may wish to disable the particulate pump for situations in which the environment is too dirty for the particulate optical engine or if you want to keep the engine and pump clean and dry from oily mists, liquids, or fogs elements. Additionally, you may want to log other parameters, such as CO<sub>2</sub>, Toxic, and/or temperature and humidity parameters and exclude the particulate measurements from a log session. This is changeable in the particulate screen.





### ➤ Enable/Disable the pump

1. From the **Start** screen, select the **Setup** menu by pressing  **Arrows** and press **Enter** .
2. Press  **Arrows** repeatedly until **Particulate** is selected and press **Enter** . (The particulate setup screen will appear.)
3. To enable/disable the particulate setting/pump, ensure **Particulate** is selected and press **Enter** .
4. Press  **Arrows** to select either Enabled or Disabled and press **Enter** . (Refer to Figure 3-7 to view a sample screen.)
5. Press **On/Off/Esc**  twice to return to the start screen.

## Resetting the gravimetric filter

The Gravimetric accumulators display the calculated accumulated mass of particles and the accumulated volume through the gravimetric filter (since the last time these accumulators were reset). At the same time, the particles are actually collected in the gravimetric cassette in the back of the unit. Typically the gravimetric accumulators are reset when the gravimetric cassette is replaced by the user.

### ➤ Resetting gravimetric filter

1. From the **Start** screen (see Figure 3-2 for details), select **Setup** by using  **Arrows**. Press **Enter** .
2. Press  **Arrows** to select the **Particulate** screen and press **Enter** . (The particulate screen will appear.)

3. To reset the **Gravimetric filter**, select the Grav. Mass/Grav. Volume fields by pressing **▲▼ Arrows**. Once selected, the **Reset** softkey will appear. Press this softkey to reset.

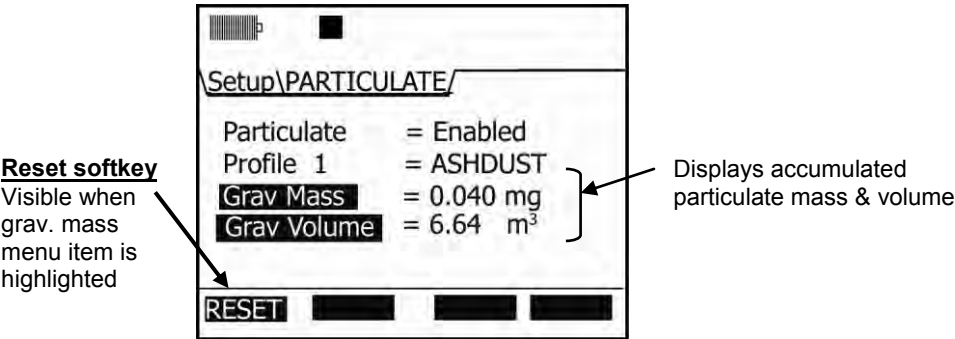



Figure 3-12: Particulate setup screen

4. To return to the main menu, press **On/Off/Esc**  twice.

Auxiliary input/output

Digital output

With the digital output function, the user can connect an external device to the monitor. This can be used to signal a specific level to turn on a notification device, an LED, or a fan motor at a specific threshold (or set point). Once enabled, the following three are selectable parameters: a sensor, logic setting, and threshold setting.

Sensors

When setting the Digital Output (“Digital-Out”) parameters, one of the seven selectable sensors is used to trigger the output of the external device which includes:

- RH (relative humidity), CO<sub>2</sub> (Carbon Dioxide), Temp (Temperature), PM (particulate matter), PID (for measuring VOCs), Toxic gas (i.e., CO), and Dew Point.

☑ **NOTE:** *Air Velocity can not be selected as a sensor.*

Logic and Threshold

There are four selectable “Logic” types which is used in combination with the Threshold field to trigger on and off the external device. These are explained in the table below.









- ☑ **NOTE:** *The digital output is an open collector output and as such requires the user to install a pull-up resistor.*

Digital Out/Logic	Explanation
Active High Pulse	The output will assert an active high pulse for approximately 50msec when the threshold is exceeded.
Active Low Pulse	The output will assert an active low pulse for approximately 50msec when the threshold is exceeded.
Active High	The output will be at a logical high level when the threshold is exceeded.
Active Low	The output will be at a logical low level when the threshold is exceeded.
Threshold	Enter in a value to trigger the external device to turn on or off.

Table 3-3: Digital out/Logic settings

☑ **NOTE:** The system maintains a hysteresis window around the threshold to prevent output chattering.

➤ **Setting or changing digital output**

- From the Start screen, select **Setup** menu and press **Enter** .
- Press **▼ Arrow** repeatedly until **Aux I/O** and press **Enter** .
- Select **Digital Out** and press **Enter** .
- In the **Digital-Out** screen do one of the following:
  - Dig-Out field:** select via **▲▼ Arrows** and press **Enter** . Press **Arrows** **▲▼** to **Enable/Disable**.
  - Sensor field:** select via **▲▼ Arrows** and press **Enter** . Press **Arrows** **▲▼** to **select one of the sensors**.
  - Logic field:** select via **▲▼ Arrows** and press **Enter** . Press **Arrows** **▲▼** to **select one of the triggering modes**.
  - Threshold field:** select via **▲▼ Arrows** and press **Enter** . Press **Arrows** **▲▼** to select a value.
- To return to the Start screen, press the **On/Off/Esc**  twice.

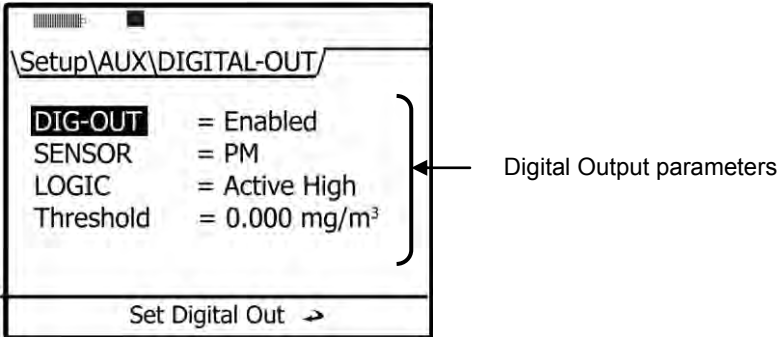






Figure 3-13: Configuring digital output

## Air Velocity

Setting the air velocity parameter is fairly simplistic; however, ensure no other outputs are enabled prior to setup. (The EVM will display a pop-up message if more than one output is enabled. You will have to disable all other auxiliary outputs before proceeding with air velocity setting.) When **air velocity** is "enabled", you can measure/log with the Quest AirProbe10 (optional accessory).

### ➤ Setting air velocity

1. From the setup screen, select **Aux I/O** and press **Enter** .
2. Press  **Arrows** to select **Air Velocity** and press **Enter** . To change the setting from either enabled or disabled, press **Enter** .

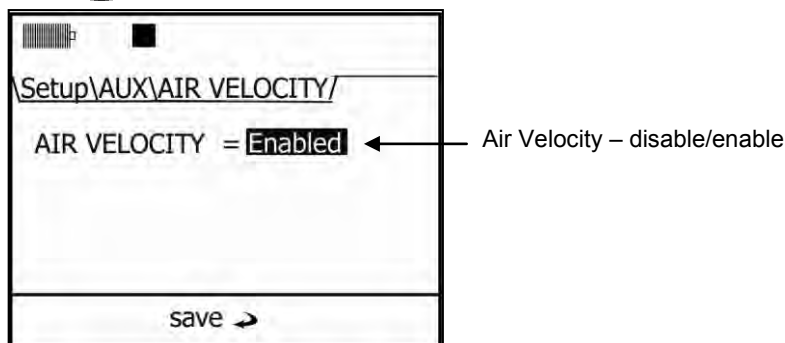




Figure 3-14: Air Velocity setting

3. Press  **Arrows** to change the setting.
- ☑ **NOTE:** if you have either the digital-out or analog-out setting enabled, a pop-up message will appear explaining to change the other settings before enabling air velocity.
4. Press **On/Off/Esc**  twice to return to the start screen.

### Analog-out

The analog-out channel provides a voltage reading that is proportional to the sensors output. The analog-out channel can be configured to track any installed sensor.

The example displayed in Figure 3-12 shows the results of measuring with the thermometer from 0 to 60°C reading from 0 to 5 volts.

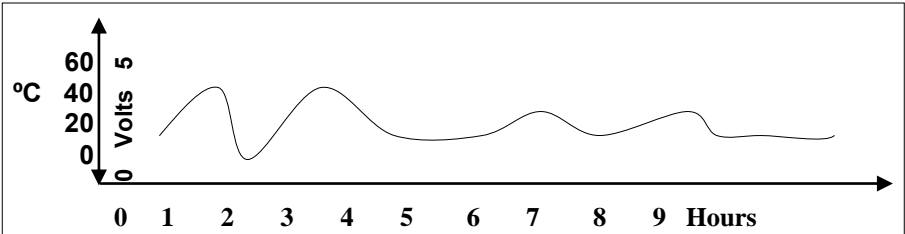


Figure 3-15: Analog out results with temperature as output

- 
- Setting Analog-Out
1.

From the setup screen, select **Aux I/O** and press **Enter**.
2.

Press **▲▼ Arrows** to select **Analog-Out** and press **Enter**.
3.

To enable or disable, press **Enter** when **Analog-out** is selected and press **▲▼ Arrows** to change the setting. Press **Enter** to move back to the 1<sup>st</sup> column.
4.

To select a sensor, ensure **Sensor** is selected and press **Enter**. Then, press **▲▼ Arrows** to page through the selection list. Once the appropriate sensor is selected, press **Enter**.
5.

To return to the start screen, press **On/Off/Esc** twice.

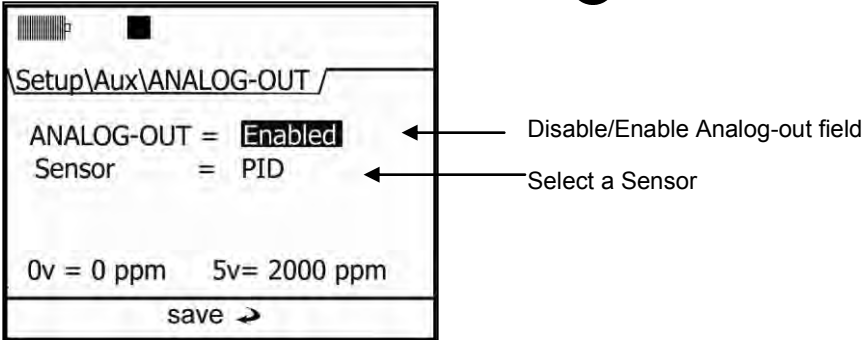


Figure 3-16: Analog-Out screen

## Restoring default factory settings

The EVM is equipped to restore all factory settings and factory calibration settings via the Defaults screen. *NOTE: Dew Point and Air Velocity are not user calibrated and therefore, not listed in the restore factory calibration screen.*

1. In the Setup menu, press **▲▼ Arrows** until **Defaults** is selected (or highlighted).
2. Press **Enter** (to open the screen).




### Restoring Default settings

Select either (or both) to restore all factory calcs/settings.

Figure 3-17: Defaults screen (restoring factory settings)

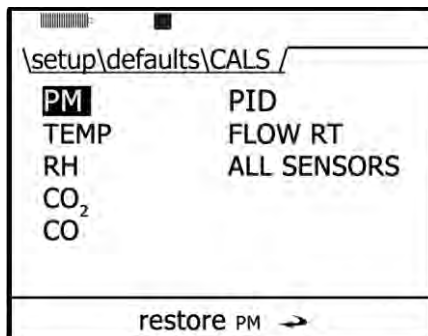

3. To restore the **Factory Calibration**, ensure this is selected and press **Enter**.
  - To restore defaults for a **selected sensor(s)**, select a sensor using **▲▼ Arrows** and press **Enter**. In the pop-up screen, select **"Yes"** via the **Left Arrow** (or **No** to cancel) and press **Enter**.  
✓ Repeat as necessary to restore each selected sensor.
  - To restore all sensors, select **All Sensors** (via up/down arrows) and select **Yes** in the pop-up screen (or **No** to cancel). Press **Enter**.



### Restoring Default Cals

Select a sensor, Choose Yes or No with the screen prompt and press Enter key.

Figure 3-18: Restoring default calibrations

4. To restore the **Factory Settings**, press **▲▼ Arrows** to select and press **Enter** .
  - A Restore **Factory Settings** pop-up screen will appear. Press either **Yes** or **No** (with **◀▶ Arrows** and **Enter**  to confirm).

## Backlight setting

A key on the keypad is dedicated to turning on or off the backlight feature. When turned on, the backlight will illuminate the screen from a dark gray to a light gray color. This feature has two levels of brightness.

When turning on, click the backlight key once for a lighter backlight. Press a second time for a darker contrast.


To turn off, repeatedly press the backlight key until it is turned off.



Figure 3-19: Backlight key

## Resetting the EVM

At times, you may need to reset the instrument if it is unresponsive.

1. To manually reset, press and hold **On/Off/Esc**  for about 8-10 seconds and the instrument will power off.

## Lock/secure run and/or setup

The lock or security feature is designed to lock the EVM during a run to ensure the session will not be stopped unless the lock feature is disabled. Likewise, this feature includes a locked (or secure) setup mode which will stop a user from editing a set-up. Once one or both of these options are programmed with a code, it is set by pressing the **Lock** softkey in the **Setup** menu.

☑ **NOTE:** *when securing or locking the instrument, it will be in lock mode even when powered off/on.*

### ➤ Setting lock setup or run

1. From the Start screen, select and open the **Setup** screen.
2. Press the **Lock** softkey.

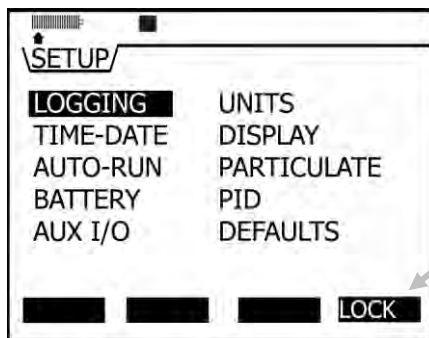





Figure 3-20: Lock Softkey

3. In the Lock/Security Modes screen, **Run** and **Setup** are “disabled” as the default setting.

## 41 | Setting up parameters via the keypad

### Unlock run and/or setup


4. To enable either one, first select **Run** or **Setup** fields (by using **Up/Down Arrows**).
5. Press **Enter**  and the first field will be shaded/selected. Press **Arrows**  to change the numeric value.

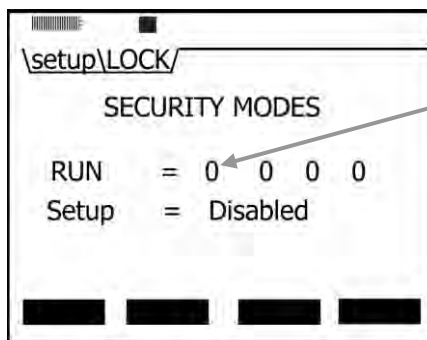

#### **Adding a numeric password**

- Press **Up/Down** arrows to enter a number.
- Press **Left/Right** arrow keys to move to the next field.
- Repeat as necessary

**Figure 3-21: Setting lock/secure**

6. Repeat step 5 until the password is entered. When you press **Enter**  for the fourth digit, a secure run mode or secure setup pop-up will appear as confirmation. Once set, the field will display **"Enabled"**.
7. Once enabled, follow one of the scenarios below:
  - For Secure run mode to occur, navigate to one of the **measurement screens** and **press the Run key**. a **"Secure Run Mode"** screen will appear.
  - For Secure setup mode to occur, navigate to the setup screen and the **"Secure setup mode"** screen will appear.

## Unlock run and/or setup

When in secure run mode or secure setup mode, a quick press of the lock/unlock softkey and entering in the password will unlock the instrument. (See steps five and six above to for more information on entering in the password.)

- ☑ **NOTE:** *incase the entered password to unlock the instrument was forgotten, a default Quest password can be used in lieu of the entered password, "9157".*

## Auto-run


The EVM has four programmable auto-run settings including a timed-run, a date, a day of week (DOW), and a disabled mode.


The EVM is shipped with the auto-run set to the disabled mode. Each mode has more than one setting and is denoted by the "+" (plus) or "-" (minus) softkey symbols. When an alarm is activated (or programmed), a "+" (plus) sign appears. The default alarm mode is set to an off mode and is denoted via a minus symbol ( i.e., "-").

### Auto-run and timed-run mode

With timed-run, you manually start the run (via the run key), and it will automatically stop based on the programmed duration.

#### ➤ Setting auto-run with timed-run mode

1. From the Start screen, select and open the **Setup** screen.
2. Select **Auto-Run** by pressing **▲▼ Arrows** and press **Enter** .
3. In the **Auto-Run** screen, press enter to select **Timed-Run**. If it is not displayed, press **▲▼ Arrows** repeatedly until selected.
4. Next, press the **-ONE** softkey or select **View/Set Parameters**.

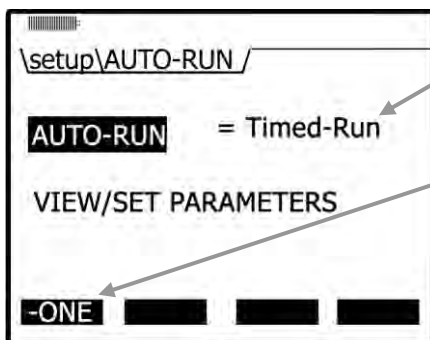

#### Auto-Run and Timed Run setting

- Select **Timed-run** by pressing Enter and then press Up/Down arrows to move through the menu.

#### Timed Run softkey

- Select first softkey to access the Timed run screen


Figure 3-22: Selecting auto-run with timed-run mode

5. In the timed-run screen, press **Enter**  to select the duration field which is displayed in hours, minutes, and seconds.

## 43 | Setting up parameters via the keypad

### Auto-run

- To change the duration, press **▲▼ Arrows**. To move between the fields, press **◀▶ Arrows**. (Repeat as necessary).

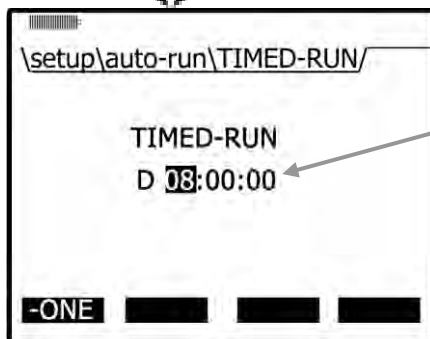

#### **Duration**

- Select the hours/minutes/seconds with up/down arrows and press Enter to move to the next field.

**Figure 3-23: Setting timed-run and duration**



- Press **Enter**  to save your settings.

**✓ NOTE:** To begin the Timed-run, press the run/stop key and the instrument will automatically stop at the programmed duration.

### Auto-run with date mode

With the date mode, it will wake up the instrument from a powered down or on condition, runs the study, saves it, then powers down again. Up to four date settings are programmable with a specified date, time (in hours, minutes, seconds), and duration via the softkeys.


#### ➤ **Setting auto-run with date mode**

- From the **Start** screen, select and open the **Setup** screen.
- Select **Auto-Run** by pressing **▲▼ Arrows** and press **Enter** .
- Press **Enter**  to select the 2nd column (value field) and press **▲▼ Arrows** repeatedly until **Date** appears.

## 44 | Setting up parameters via the keypad

### Auto-run

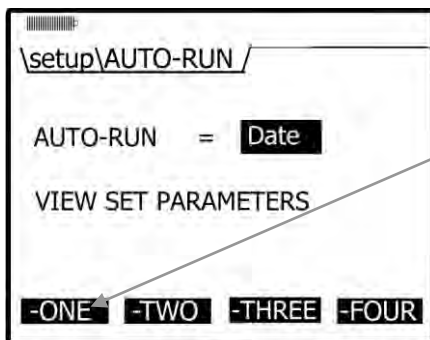


- Next, press one of the softkeys. (This will open a Date/Auto-Run screen.)



#### Softkeys


- Select a softkey to setup the Date Auto-Run parameters
- Once set, "-one" will appear as "+one" which is turned on.

Figure 3-24: Selecting auto-run with date mode

- If **off** appears under Auto-Run, press **Enter**  (or skip and see step 6).
- To change the fields press  **Arrows**. To move to the next field(s) press  **Arrows**. Repeat as necessary.

#### Start time

- Select time of day (24 hour clock) by pressing up/down arrows

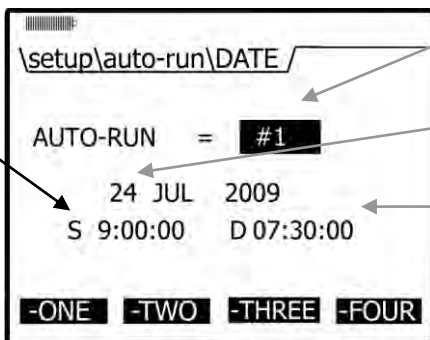

#### Corresponds to softkey



#### Auto-Run with Date

- Select day, month, year

#### Duration

- Press up/down arrows to select hours, minutes, seconds

Figure 3-25: Setting auto-run date mode

- To save, press **Enter**  key. Press  key until you return to the start screen.



☑ **NOTE:** To initiate the programmed run, either power down the instrument or leave on.


### Auto-run with day of week (DOW) mode

The days of the week (DOW) setting is a pre-programmed weekly auto-run with a specified day, start time, and duration with two auto on settings. The programmable settings include a day of the week, start time, and duration.



- **Setting auto-run with day of week mode**
1.



From the Start screen, select and open the **Setup** screen.
2.

Select Auto-Run by pressing  **Arrows** and press **Enter** .
3.

In the Auto-Run screen, press **Enter** and press  **Arrows** repeatedly until **DOW** appears.
4.

Press one of the softkeys (one or two).
5.

In the **DOW Auto-Run** screen, press  **Arrows** to move through the Days, Time and Duration fields. Press  **Arrows** to change the value.
6.

When programmed, press  **Enter**. Press  key repeatedly to return to the main screen.

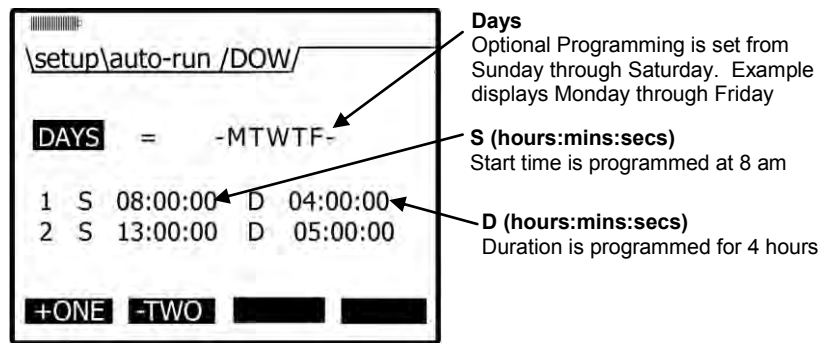


Figure 3-26: Setting auto-run DOW mode

☑

**NOTE:** To initiate the programmed run, either power down the instrument or leave on.

**This page left blank intentionally**

# Calibrate sensors

## Placement and calibration of sensors

Before you begin your measurement sampling, it is recommended to calibrate the sensors you will be using. This chapter focuses on inserting and removing sensors, calibrating each sensor, viewing past calibrations, and how to verify your calibration set points. (Please reference the following sections which apply to your installed sensor components.)

### ***Calibrating sensors include:***

- Particulate sensor (starting on page 49 )
- Pump flow rate calibration (starting on page 58)
- CO<sub>2</sub> and O<sub>2</sub> sensor (starting on page 67)
- Toxic sensors (starting on page 63)
- Photo-Ionization Detector (PID) sensor (for VOCs) (starting on page 71)
- Temperature (temp) and Relative humidity (RH) sensors (starting on page 74)


## Inserting and removing sensors

The sensors you purchased with your EVM will be inserted, factory calibrated, and ready for usage. To understand how to insert or replace a sensor this is discussed in the procedures below.

### **➤ Inserting sensors**

1. Ensure the instrument is turned off and the external power cord is disconnected. Next, remove the sensor bar by unscrewing two screws from the top compartment with a screw driver.
2. Lift the cover off and set aside. (The location of the sensors is indicated in Figure 4-2.)


3. Remove the black manifold casing.

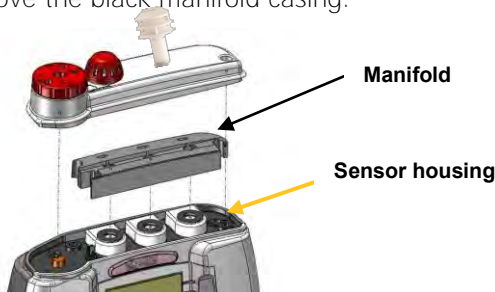

**Figure 4-1: Sensor housing and manifold**

4. To insert a sensor, gently push the sensor's pins into the socket pin of the circuit board so it aligns accordingly. It will fit securely.
5. To remove a sensor, pull the sensor up horizontally and remove it from the sensor chamber.
6. When completed, replace the black manifold over the sensors and then place the cover over the sensor housing. Tighten the screws back into place.

**Sensor bar-** Remove screw 1 & screw 2 and lift off cover.

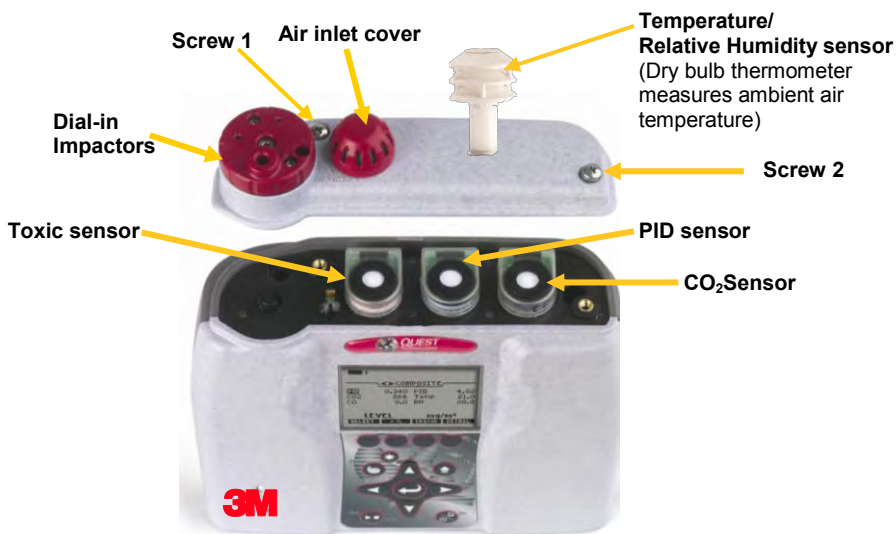

**Figure 4-2: Sensors' locations**

- ☑ **NOTE:** The Temperature/ Relative Humidity sensor is not user removable.
- ☑ **NOTE:** the user will receive a message on the display when a new sensor is detected or an existing sensor is no longer detected.

## Calibrating particulates

The EVM is factory calibrated to the “Arizona Road Dust” (also called “ISO Road dust” ISO 12103-1 A2 Fine) standard.



Before you measure particulates, it is recommended to calibrate to the environment you are in. If you are in an ARD environment, you would adjust the impactor to correlate with a specific particulate setting, run a calibration based on the particulates in that environment, and compare the results against the ARD calibration. If you are in any other environment, you would calibrate based on the environment you are in by determining a correction factor (also called “K-factor”) to the correct variation from the ARD calibration standard.

The EVM supports eight different user profiles. Each profile stores a customizable profile name field, and a correction factor. (Setting-up profiles/correction factors is discussed in the Set-up chapter, “Setting profiles for particulates” on page 31).

The following sections will walk you through how the impactor operates, how to adjust the impactor, how to run a zero calibration, and lastly running a gravimetric calibration.

## Impactor and use

The impactor is a device used to remove larger sized particulates from the air-stream you are measuring.

**How does it operate?** Air travels through the impactor and the heavy particulates will stick to the greased plates within the impactor (1). The Pump will circulate the air as it passes through the tubing in the back of the instrument (2). The smaller, lighter particulates will pass through the optical engine (3) and collect in the gravimetric filter/cassettes (4).

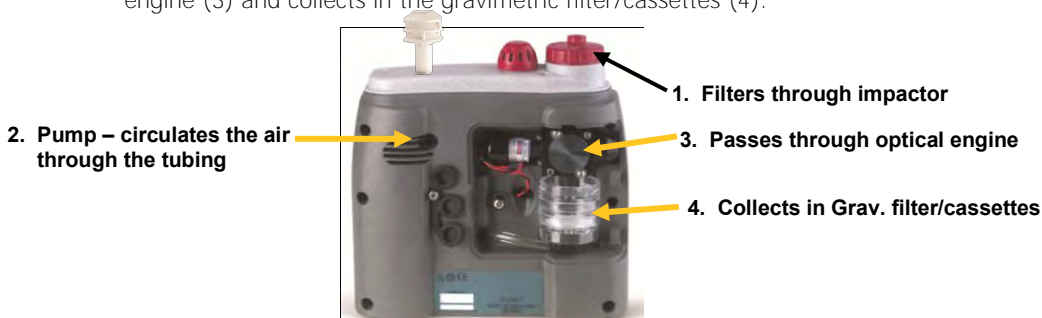


Figure 4-3: How the impactor functions

**☑ NOTE:** Depending on the environment (i.e., a dense, dusty manufacturing plant), you will want to ensure the impactor is well greased and cleaned before using. Additionally, it is recommended to monitor this process while measuring. You may need to stop your measurements, clean and grease the impactors, and then resume measuring. To clean and grease the impactors, please see Chapter 7 "Cleaning and maintenance".

## Adjusting the impactor/turret setting

When measuring, the industrial processes (such as sanding, cutting, crushing, grinding, and transportation) cause air pollutants. The size of the particles will enter the human body in different areas, affecting the nasal, throat, and/or lung area.

The impactor setting is used to trap and filter out the larger size particles based on your cut-point (or impactor setting). The range is programmed between 1  $\mu\text{m}$  to over 100  $\mu\text{m}$ . For example, if you are measuring coal dust (aimed at the lung area), you would adjust your impactor setting to PM10. The following are the user-selectable cut-points:

- PM2.5, PM4, PM10, or PM (all dust ranging from 0  $\mu\text{m}$ -100  $\mu\text{m}$ )

**☑ NOTE:** the particulate size is written on top of the turret. For PM there is no marking but is noted by the (raised) air chamber.

### ➤ Adjust impactor/turret for particulate logging

1. Using the keypad navigate to the particulate or composite measurement screen.
  - **How to?** From the Start screen, press the **Right** arrow key.

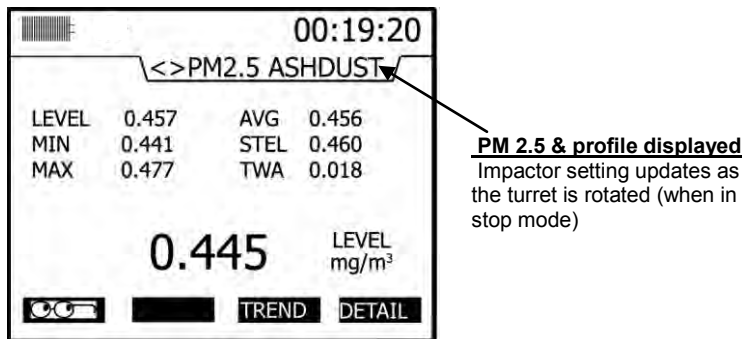


Figure 4-4: PM2.5 impactor setting example

## 51 | Placement and calibration of sensors

### Adjusting the impactor/turret setting

2. Twist the turret (red casing around the impactor) to the left or right until you see the appropriate setting on the display. It will align to the impactor text and arrow on top of the housing.

☑ **NOTE:** *The actual diameter of the air inlet hole is directly to the left of the impactor text positioning.*

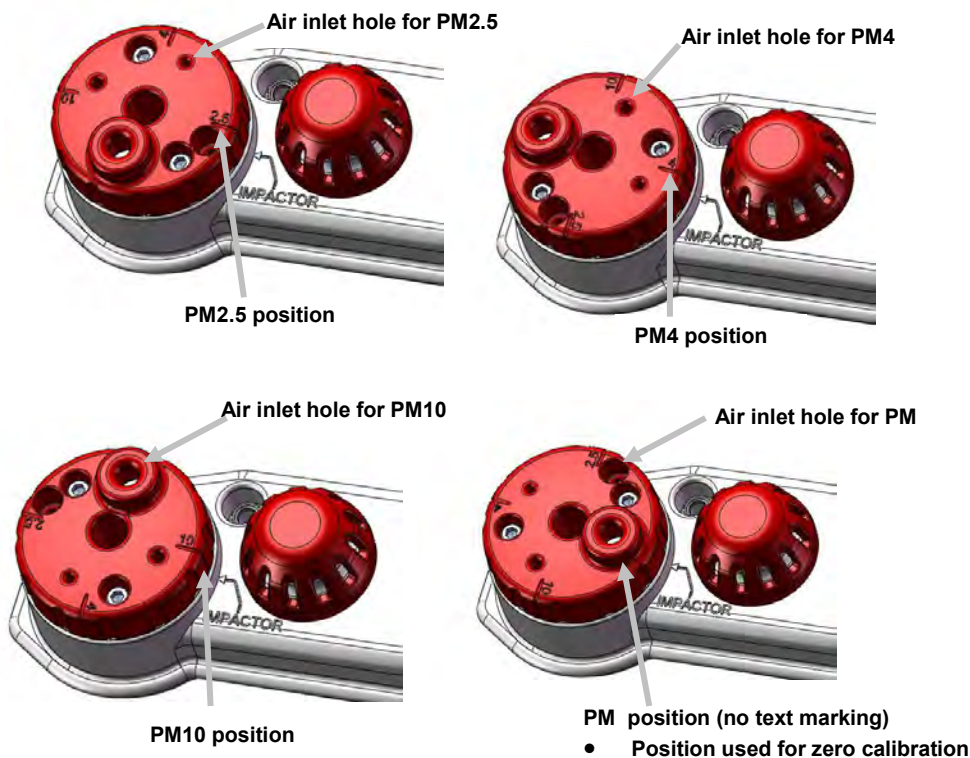


Figure 4-5: Adjusting impactor/turret setting

3. If you see "<>PM ERR", this indicates the impactor is not in the correct position and that it is between two positions. Adjust the turret, until the correct reading is displayed on the screen.

## Particulates calibration (zero cal)

A zero calibration is recommended the first time you measure particulates in the run mode. For particulate calibration, place a zero filter (also called a HEPA filter) with attached coupler into the vent of the turret. The impactor setting must be set at PM in order to conduct a zero cal.

☑ **NOTE:** *for the span on the particulate calibration, please refer to the "Gravimetric Filtering" instructions to determine the gain factor from the correction factor.*



### ► Particulates zero cal

1. Insert the attached coupler and zero filter into the turret. Ensure the **impactor is well-greased** before calibrating which requires a thin film of grease. (See "Impactor care" for details).


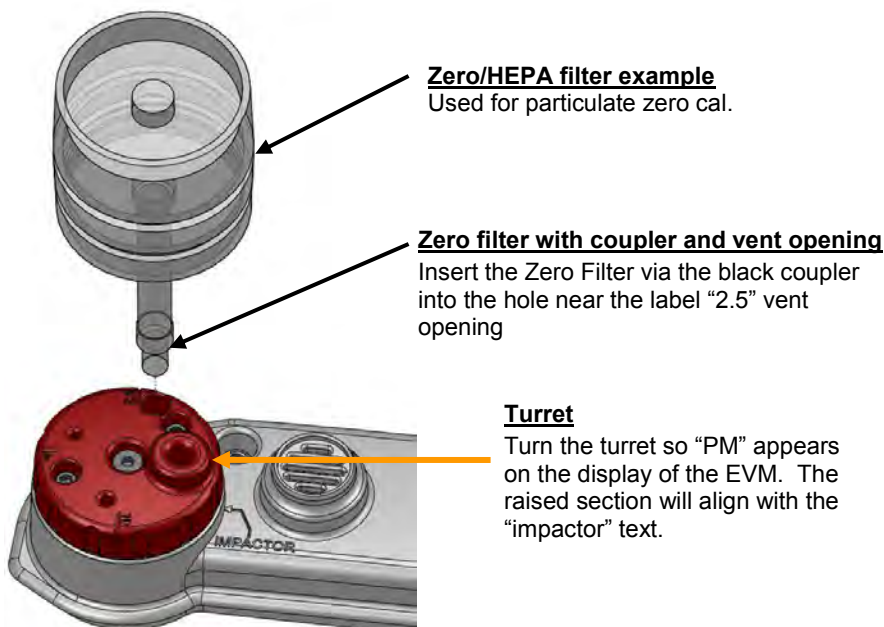


Figure 4-6: Particulate zero cal with HEPA filter

2. Adjust the turret/impactor to **PM** (refer to "Turret" in Figure 4-6).

- From the **Start** screen, press **Arrows** until **Calibration** is selected and press **Enter**.

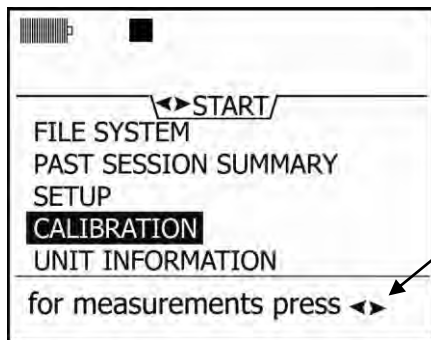


**Calibration** – select to open to the Calibration set screen

**Figure 4-7: Selecting calibration screen**

- In the Calibration screen, press **Arrows** and select **PM** (for particulate matter). (NOTE: if you have the wrong impactor setting, the instrument will flash a warning sign indicating that you need to turn the impactor to “PM” before proceeding.)
- Press the **Cal** softkey. (The pump will turn on.)

**NOTE:** The **HISTR** and **VERIFY** softkeys will not be present if a user calibration and a calibration verify have not been performed.

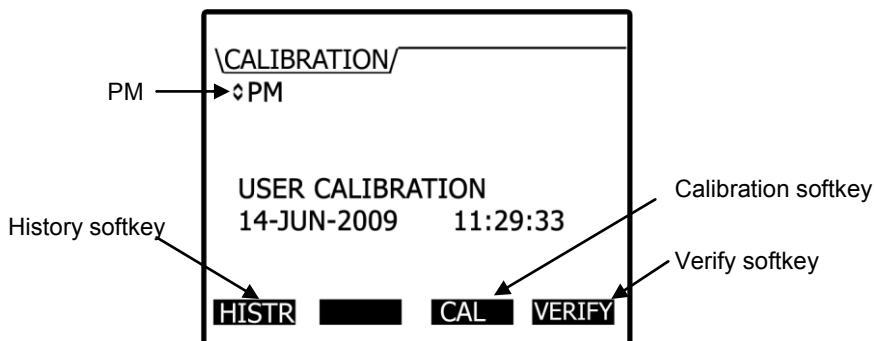

**Figure 4-8: Particulate cal screen**

6. The ready screen with the PM, Profile will appear. Press the **Start** softkey.

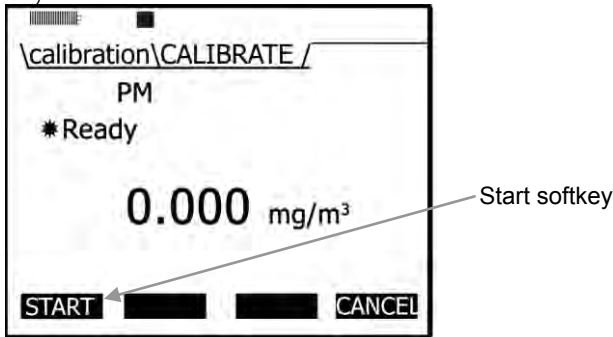


Figure 4-9: Particulate calibration and ready screen

7. Allow the level to stabilize (approximately 1-3 minutes). It will state **Waiting** (A) and **Set** softkey will appear when it has stabilized (B).

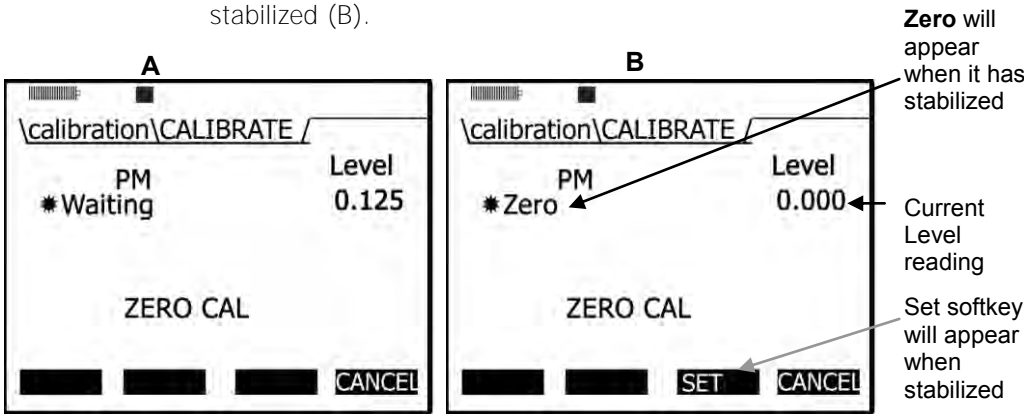


Figure 4-10: Particulate calibration and waiting screen

8. Press the **Set** softkey to set the **Zero cal** point.

9. The instrument will show a **Pause** state with the intended and actual values.

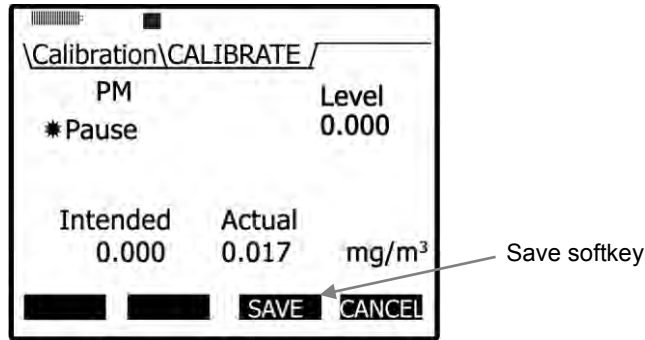


Figure 4-11: Particulate calibration pause screen

10. Press the **Save** softkey to save your calibration (or press Cancel and Retry to repeat this process.) A screen pop-up will state "**Zero cal set point**" when completed (or "**User canceled calibration**"). A pass (cancel) screen will be displayed.

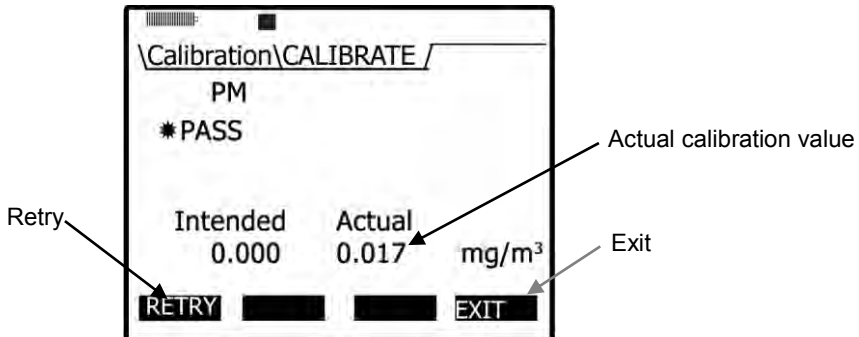



Figure 4-12: Zero Cal set for Particulates

- Press **Retry** softkey to repeat the zero cal procedures.
11. Press **Exit** softkey to close this screen. To return to the start screen, press **On/Off/Esc**  or press the **Cal** softkey to continue calibrating the sensors.
- ☑ **NOTE:** a zero cal is performed for the instrument and will be used for all profiles.

## Particulate Advanced Calibration (Gravimetric)

With the EVM, you can store up to 8 different profiles (also called correction factors) to reflect the environment or building zone you plan to measure.

The instrument is factory calibrated to Arizona Road dust. In some situations, you may want to perform a gravimetric calibration in order to determine the correction factor for an alternative environment. This is an optional procedure.

☑ **NOTE:** *if you do not plan on performing an advanced particulate calibration with gravimetric sampling, please see on page 30.*

With a gravimetric calibration, you determine the mass of the particulate you want to measure. The particulate mass is then used to calculate a correction factor to the environment you will be measuring. The steps below outline a gravimetric calibration.

(For additional specifications on a gravimetric calibration, please refer to the NIOSH 0600 standard.)




### Gravimetric Calibration Overview

1. Reset the gravimetric and volume accumulators.
2. Insert a new (sealed) gravimetric cassette.
3. Measure in the specific location for approximately four to eight hours.
4. Proceeding the measurement, the gravimetric accumulator on the EVM will display the amount of dust that has accumulated based on the active profile. (This value is used in conjunction with the weight of the measured dust in the cassette.)
5. To determine the weight of particulates in the gravimetric filter, remove the gravimetric cassette and weigh the contents. (Typically, sent to a lab for results.) Do not include the weight of the cassette.
6. To determine the correction factor, calculate the ratio between the particulate mass value and the weight from the gravimetric filter lab analysis.

☑ **For example,** let's say that you measured for 8 hours in a wood shop and the PM mass accumulator displays 10 mg. Next, you measured the dust in the gravimetric filter/cassette and determined the weight as 20 mg. To calculate the correction factor, you divided 20 mg by 10 mg and determined the value as 2. Lastly, the correction factor of "2" is multiplied by the existing active profile correction factor, and is entered as the new correction factor (Setup\PM\EDIT PROFILE).

## Performing a gravimetric calibration

Ensure the gravimetric cassette is new before beginning.

1. Place the instrument in the appropriate environment.
2. Turn on by pressing **On/Off/Esc** .
3. In the **Start** screen, select the **Setup** menu and press **Enter** . Next, select **Particulates** by pressing the **Down arrow** repeatedly and once selected, press **Enter** .
4. In the particulate screen, the reset gravimetric accumulator fields will display either a value of the collected dust or it will display zero (if already reset). When beginning a gravimetric calibration, ensure this is set to zero.

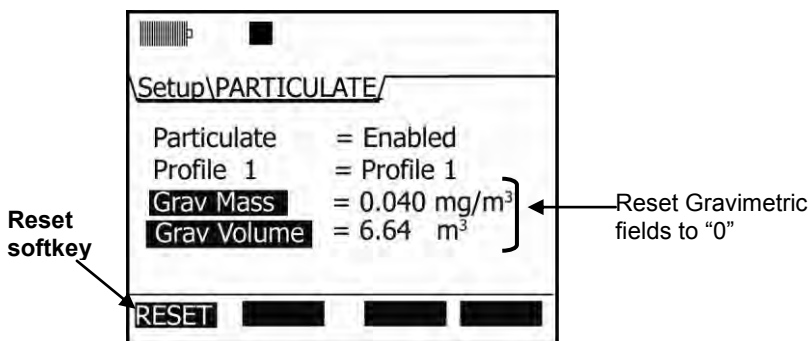



Figure 4-13: Reset gravimetric setting

- To reset, press the down arrow repeatedly to select the gravimetric fields and press the **Reset** softkey. (If it is not displayed, press the **AltF** key.)
5. Turn the pump on by pressing the **Pump**  key.
  6. Optional step:
    - a. It is optional to press the **Run/Stop** key to log the gravimetric filter sampling. (*NOTE: if in "run mode", a clock appears and displays the overall run time.*)
    - b. To view the particulate level, press the right arrow once from the start screen and the particulate measurement screen will appear (noted as "PM").
  7. After the gravimetric collection, turn the pump off and reference the **Gravimetric Mass** field to view the calculated particulates.

8. Lastly, calculate the ratio between the value in the **Gravimetric Mass** field and the weight of the collected sample.
9. Enter in the correction factor via the **Particulate Setup** screen.  
 (Please see "**Setting Profiles**" section for more details.)

## Pump flow rate calibration

An accurate flow meter, such as a primary standard flowmeter calibrator, and inert tubing is required to perform this calibration. The inert tubing is inserted on the dust air flow outlet (located on the back of the housing).

**✓ NOTE:** *you may want to send the instrument in for a yearly calibration, if you do not own a flowmeter calibrator for this calibration procedure.*

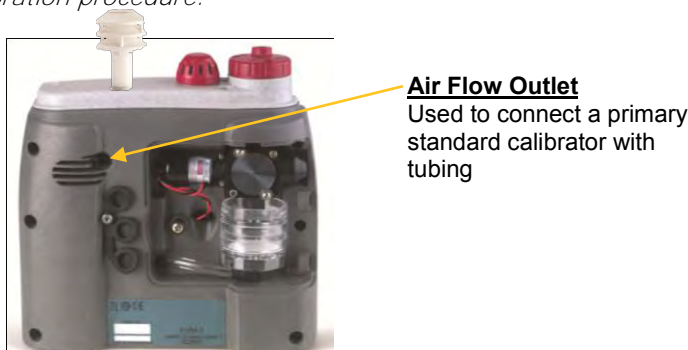




Figure 4-14: Pump flow rate calibration

### ► Flow rate calibration

1. Connect the flow meter (i.e., primary standard) and inert tubing to the EVM.
2. Turn the EVM on by pressing **On/Off/Esc** .
3. Select the **Calibration** menu by pressing the **Down Arrow** until it is selected and press **Enter** .
4. Select **Flow Rt** (flow rate) by repeatedly pressing **▲▼ Arrows** key until it appears.
5. Press the **CAL** softkey and then press the **Start** softkey.

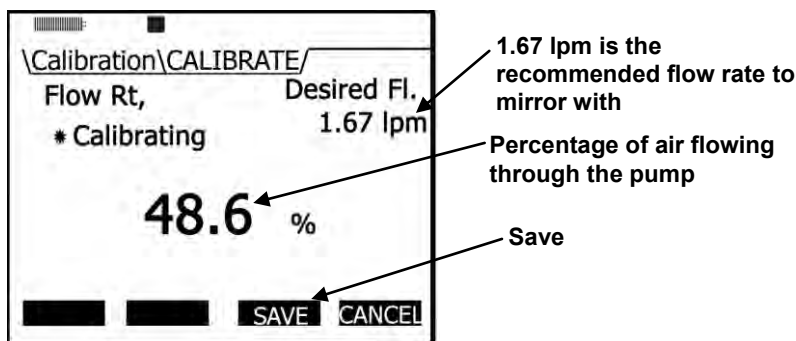


Figure 4-15: Flow Rate Calibration

6. Manually adjust the flow rate (as needed) by repeatedly pressing the **Up/Down** key to select the desired level.
7. Press the **Save** softkey to store this as your flow rate calibration. The flow rate summary will appear.
- ☑ **NOTE:** *you may wish to repeat these steps if the desired level was not achieved. Press the **Cancel** softkey to stop the calibration. Next, press the **Retry** softkey and repeat the calibration steps to re-cal the flow rate.*
8. Press the **Exit** softkey to exit this screen. (The pump will turn off.)
9. Press the **On/Off/Esc** key to return to the start screen.

## Toxic gas sensors

The gas sensor chamber will allow you to measure any one of the single toxic gases listed below. Please refer to Appendix A for detailed specifications.

1. Carbon monoxide (CO) with a range of 0-1000 ppm
2. Chlorine (Cl<sub>2</sub>) with a range of 0-20 ppm
3. Ethylene oxide (EtO) with a range of 0-20 ppm
4. Hydrogen cyanide (HCN) with a range of 0-50 ppm
5. Hydrogen sulfide (HS<sub>2</sub>) with a range of 0-500 ppm
6. Nitrogen dioxide (NO<sub>2</sub>) with a range of 0-50 ppm
7. Nitric oxide (NO) with a range of 0-100 ppm
8. Oxygen (O<sub>2</sub>) with a range of 0-30%
9. Sulphur dioxide (SO<sub>2</sub>) with a range of 0-50 ppm
10. Ozone (O<sub>3</sub>) with a range of 0 – 1.0 ppm

The sensors are based on well established electrochemical sensor technology. They are designed to be maintenance free and stable for long periods of use.

## Cross sensitivity

The following table illustrates the cross-sensitivity to a range of commonly encountered gases, expressed as a reading of the sensor when exposed to 100 ppm of the interfering gas at 20°C.

Gas	Interfering Gas											
	CO	H <sub>2</sub> S	SO <sub>2</sub>	NO	NO <sub>2</sub>	H <sub>2</sub>	CL <sub>2</sub>	HCN	C <sub>2</sub> H <sub>4</sub>	HCI	CL	O <sub>2</sub>
CO	100	~ 7	<10	<9	<20	<40	N/D	N/D	N/D	N/D	N/D	N/D
H <sub>2</sub> S	<2	100	~10	~1	~20	~1	N/D	N/D	N/D	N/D	N/D	N/D
NO <sub>2</sub>	-5	<5	<-1.5	0	100	N/D	N/D	N/D	N/D	N/D	N/D	N/D
NO	0	N/D	~ 5	100	<30	N/D	N/D	N/D	N/D	N/D	N/D	N/D
HCN	N/D	N/D	N/D	N/D	N/D	N/D	N/D	N/D	N/D	N/D	N/D	N/D
NH <sub>3</sub>	0	0	~ 60	~20	<10	0	~50	~5	N/D	<10	N/D	N/D
*O <sub>3</sub>	-8	N/D	N/D	N/D	~60	0	~120	N/D	N/D	~150	~150	~150

\*Continuous exposures at ppm level over more than 30 minute might blind the sensor.

**Table 4-1: Cross-sensitivity table of interfering gas**

### How sensors operate

Power is automatically applied to the gas sensors when they are connected and the instrument is turned on. These are also referred to as "intelligent sensors". Additionally, the EVM will automatically identify the type of gas sensor that is installed.

☑ **NOTE:** it may take a few minutes for a newly inserted sensor to stabilize before using.

## Quality calibrations

The quality of the calibration process depends upon the accuracy of the calibration gas and allowing the sensors to stabilize before saving the zero and span calibrations.

About sensors and cal storage

Once a calibration is completed and a sensor is removed, the calibration records are stored in the sensor.

Calibration history and sensor serial numbers

After running, saving a calibration, and downloading the data to QuestSuite® Professional II, the calibration type, levels, the serial numbers, and the date/time of the calibration are viewable in the software. The serial number of the sensor is available in QSP-II in the calibration history chart.

Calibration History				
Date	Calibration Type	Sensor Id	Sensor Serial Number	Sensor Level
1/2/2007 6:00:52 AM	Single Point Calibration	2		241
1/2/2007 6:00:09 AM	Dust Calibration	1		28569
1/2/2007 6:01:06 AM	Single Point Cal. Verify	2		241
1/2/2007 6:00:09 AM	Dust Cal. Verify	1		28569

Figure 4-16: Calibration history for EVM

## Applying a gas sensor

You will want to gather your calibration gas source, the regulator (if not already connected), inert tubing, the cal adapter and the EVM with the appropriate sensors installed. After your calibration setup is completed, please follow the proceeding applicable calibration sensor sections.

### ➤ Applying a gas sensor

1. Connect the gas source, regulator and inert tubing.
2. Slide the inert tubing over the black nozzle of the cal cup.
3. Remove the **air inlet** cover on the EVM. (See Figure 4-2 for an example).
4. Place the Cal cup over the air inlet.
5. When you are ready to access the **Cal** screen, turn on the regulator.

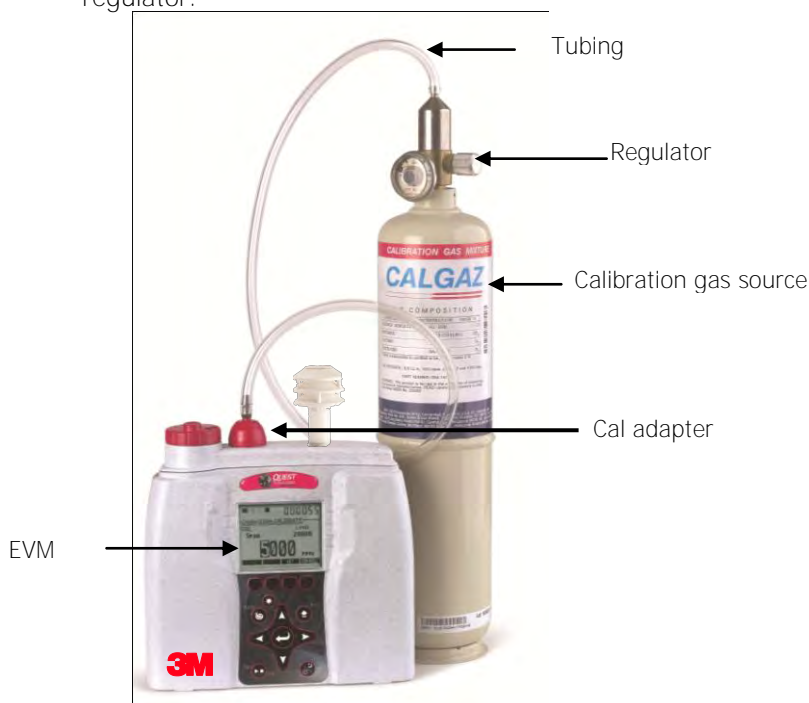


Figure 4-17: Applying a gas sensor

## Calibrating toxic gas sensors

It is recommended to conduct a zero cal and a span cal with toxic gas sensors. Essentially, a calibration is conducted by checking the sensors response to a known concentration of a certified calibration gas. It is important to note that with a zero cal and a span cal, you should be in a non-contaminated environment when performing the calibration.

It is recommended to calibrate on a regular basis for best results. You will want to perform a **zero cal** and a **span cal** (or adjustment) to properly calibrate a toxic sensor.



**IMPORTANT:** *The zero and span adjustment procedures for oxygen are different than other gas sensors.*



**CAUTION:** *Due to the presence of toxic gas during the calibration process, appropriate safety procedures should be followed.*



*Additionally, you will want to ensure that your calibration is performed in an area known not to contain hazardous or interfering gases if ambient air will be used as the zero gas for operation. If this is not possible, pure bottled air (Nitrogen is recommended) should be substituted. Instructions for both procedures are provided below. You only need to perform one or the other.*

### Toxic gas zero calibration

When conducting a zero cal for toxic gas, you will want to use a cylinder of Nitrogen or pure air with the cal cup placed over the air inlet cover. (Please see "Applying a gas sensor" for details).




☑ **NOTE:** *if you are in clean air environment, you can use room air (for all toxics except for ozone).*


### Ozone calibration for zero and span

For an Ozone calibration, a zero calibration is performed with Nitrogen and a span calibration is performed using an ozone generator.

☑ **NOTE:** *it is recommended to factory calibrate the ozone sensor on a yearly basis.*


#### ➤ Performing a Zero cal for toxic gas

1. While the instrument is powered off, **connect** the pure air cylinder, regulator, inert tubing, and cal cup to the EVM.
2. Power on the EVM by pressing the **On/Off/Esc** .
3. In the start screen, press the **Down**  arrow to select **Calibration** and press the **Enter** .
4. Press **▲▼ Arrows** to select the toxic you wish to calibrate.
5. Press the **Cal** softkey and a specific toxic gas (**i.e., CO**) **Calibrate Set Point** screen will appear.

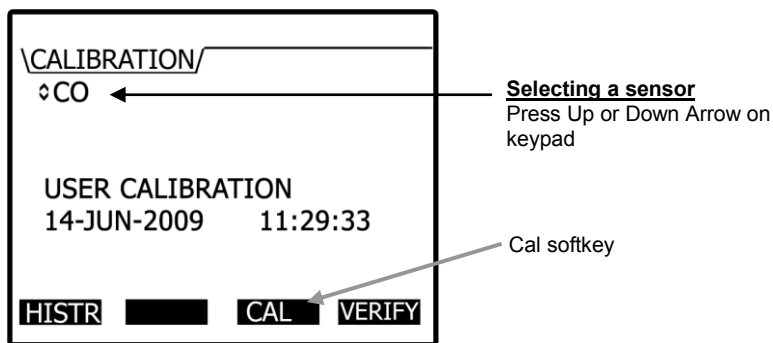

**Figure 4-18: Selecting sensor for calibration process**

6. Turn regulator **On**. Wait for the current level to stabilize (allow at least 90 seconds to stabilize.) (The screen will show +Ready.)
7. When the level has stabilized, press **Zero** softkey.

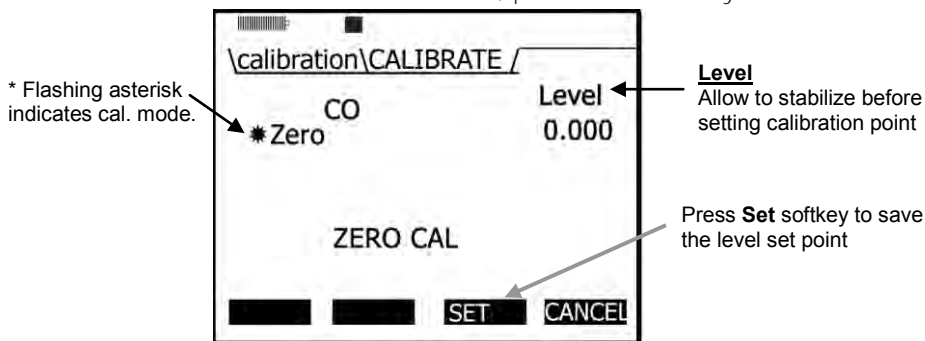

**Figure 4-19: Calibration zero screen**

8.
- Press the **Set** softkey. A screen displaying the zero cal intended and actual set point values will appear. Press the **Save** softkey.

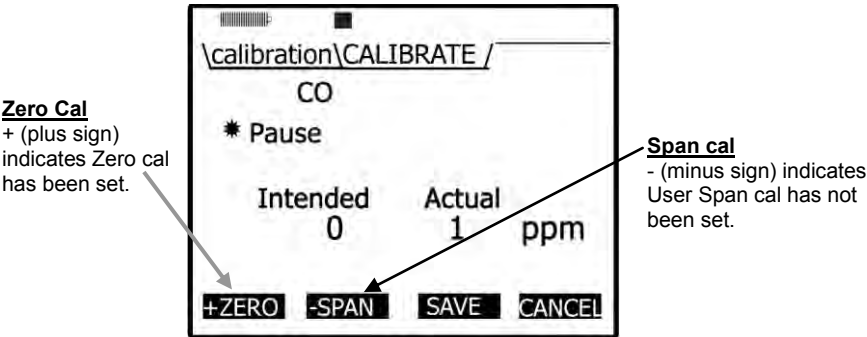


Figure 4-20: Calibration zero pause screen

9.
- To set the span cal, proceed to “Toxic gas – span calibration”.
- ☒ **NOTE:** if you want to re-do the zero calibration, press the **+Zero** softkey and repeat steps 7 and 8.

Softkeys	Explanation
Cal	When pressed, this will allow a calibration to be performed.
Zero	When pressed, this will enable you to a zero calibration.
Span	When pressed, this will enable you to perform a span calibration.
Exit	Enables you to exit at any time.

Table 4-2: Gas calibration softkeys explained


Toxic gas span calibration

When conducting a span calibration, the calibrated gas used should match the sensor you will be calibrating. (*NOTE: for Ozone span calibration, an ozone generator should be used.*) If you are continuing from the Toxic Zero cal section, the screen you will be viewing is the Calibrate/Pause screen. (If you are performing a Span cal only, ensure you are at the Start screen and select the calibrate menu. Then select the specific sensor by pressing up/down arrows. Press the Cal softkey and then press the Span softkey. Proceed to Step 2.)

➤ **Performing a span cal for Toxic gas**

1.
- Continuing from the zero cal procedures, you should be viewing the **Cal/Pause** screen (as displayed in Figure 4-17). Press the **Span** softkey.


2. **Apply** the **gas** at full flow rate while observing the “Level” field on the display. Wait for the current level to stabilize (allow a couple of minutes).

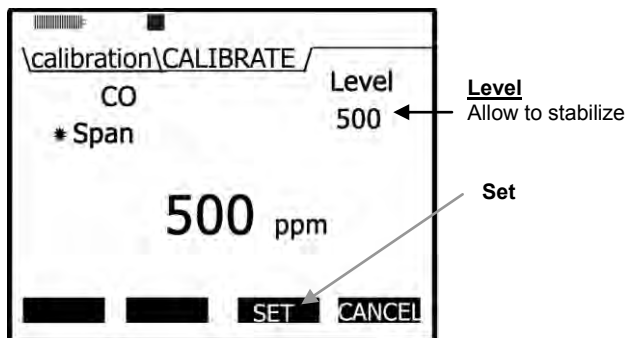

**Figure 4-21: Span Calibration**

3. Adjust the span value by pressing **▲▼ Arrows** on the keypad.
4. Press the **Set** softkey to store the span cal. point. (A screen will appear displaying that you set the span cal. point.)
5. Once your calibration is set, intended and actual cal values will appear on the display screen. Press **Save** to store these as your calibration set points.

**NOTE:** if you want to redo the span calibration, press the *Span* softkey and repeat steps 2-5.

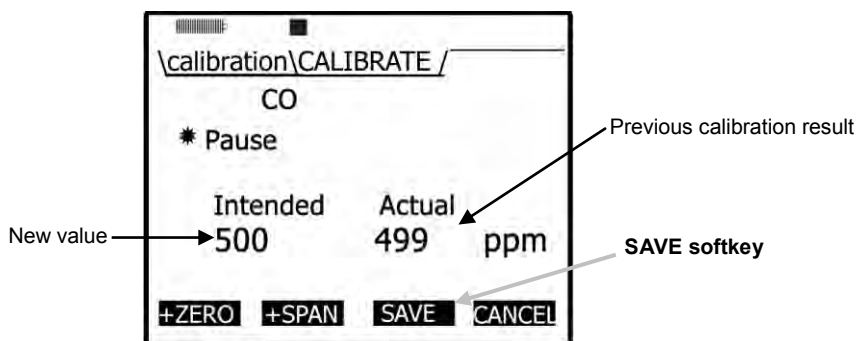

**Figure 4-22: Saved Calibration screen**

6. Turn the regulator off and disconnect the tubing from the instrument.

7. Repeatedly press **On/Off/Esc**  until you return to the start screen.
8. Press  **Arrows** to view measurement screens.

## Calibrating CO<sub>2</sub> AND O<sub>2</sub>

With the Carbon Dioxide (CO<sub>2</sub>) or Oxygen (O<sub>2</sub>) calibration, you can perform a zero calibration and a span calibration (when the cal gas is connected) in the field. Each of these screens will be discussed below.

The CO<sub>2</sub> sensor and O<sub>2</sub> sensor requires a calibration gas, a regulator with at least 1 Liter/minute flow rate and inert tubing.

A **zero calibration** using a Nitrogen (N<sub>2</sub>) gas is recommended. For a **span calibration**, the range (or span) should be a sizeable fraction of the selected full scale range of the gas.

### CO<sub>2</sub> Accuracy

The range for the CO<sub>2</sub> sensor is 0 to 20,000 ppm with a settling time of <90 seconds at a flow rate of 1 LPM. For a span calibration, it is recommended to perform a span calibration to the value you will be measuring (i.e., 10,000 ppm). The EVM will derive CO<sub>2</sub> values to achieve greater accuracy over either the 0 – 5,000 ppm range or the 0 – 20,000 ppm range.

The method used is based on the span gas that is used for calibrations. If a span gas less than 5,000 ppm is used, then CO<sub>2</sub> values will be derived to achieve greater accuracy in the 0 – 5,000 ppm range.


*NOTE: This may lead to reduced accuracy between 5,000 ppm and 20,000 ppm.* If a span gas equal to or greater than 5,000 ppm is used, then the CO<sub>2</sub> values will be derived to provide better accuracy over the 0 – 20,000 ppm range which may lead to reduced accuracy over the narrower 0 – 5,000 ppm range.


### O<sub>2</sub> Accuracy

The range for O<sub>2</sub> sensor is 0 - 30% with a typical span cal of 20.9%

#### ➤ Calibrating a zero cal and span cal for CO<sub>2</sub> or for O<sub>2</sub> sensor

1. **Connect** one of the following gases with the regulator and inert tubing:

- N<sub>2</sub> gas (used for zero cal.)
  - CO<sub>2</sub> calibration gas
  - Room air for O<sub>2</sub> calibration gas (i.e., 20.9%)
2. Attach the regulator and tubing to the gas cylinder.
  3. Place the **Cal. cup** over the **Air inlet cover** and slide the **tubing** over the black air inlet casing.
  4. From the start screen, press ▼ **Arrow** to select **Calibration** and press **Enter** .
  5. In the Calibration screen, press ▲▼ **Arrows** to select CO<sub>2</sub> or O<sub>2</sub>.

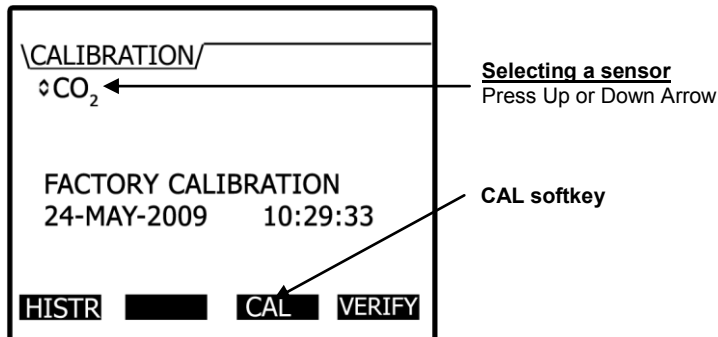

**Figure 4-23: Selecting a calibration sensor**

6. Press the **CAL** softkey to open the CO<sub>2</sub> "Calibration/Calibrate" screen. (Allow at least 2.5 minutes for CO<sub>2</sub> to stabilize.)

- For the Set Points, **-zero** and **-span** softkeys will appear. Press either **Zero Cal** or **Span Cal** softkey. (See Table 4-2 for more information.)

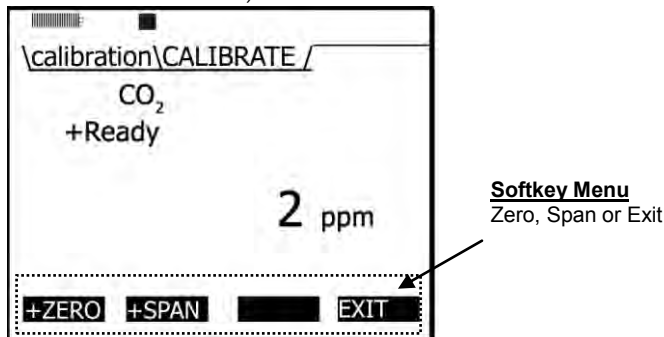


Figure 4-24: Calibration CO<sub>2</sub> ready screen

- ☑ **NOTE:** If "-" (a minus sign) appears in front of Zero or Span, this has not been calibrated. Alternatively, the "+" (plus sign) signifies the cal point has been calibrated.
- Turn the regulator on. The regulator should have a flow rate of 1.0 L/min.
  - Allow the level to stabilize. For CO<sub>2</sub>, wait at least two minutes to stabilize.
    - For Zero Cal, the screen will display Zero with a Set softkey.
    - For span cal, press **▲▼ Arrows** on the keypad to adjust the appropriate level.
  - Press the **Set** softkey. Turn off regulator and unhook the N<sub>2</sub> bottle (for zero cal) or CO<sub>2</sub> bottle (for span cal). (To perform a Zero or Span cal, please repeat steps 1-8.)
- ☑ **NOTE:** If you want to redo a zero or span calibration, press the zero or span softkey and repeat steps above to program new set points.

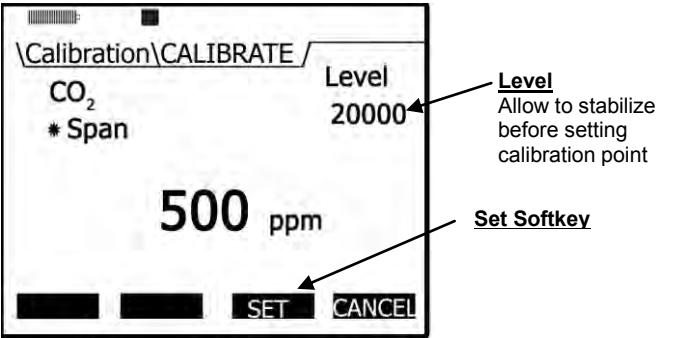


Figure 4-25: Setting CO<sub>2</sub> Span Cal screen

10. Once the zero and span cal values are set, the calibration save screen will appear. Press **Save** to save your calibration.

☑ **NOTE:** If you want to repeat the cal, press the Cancel softkey and you will return to the calibration screen. Repeat the steps above to program new set points.

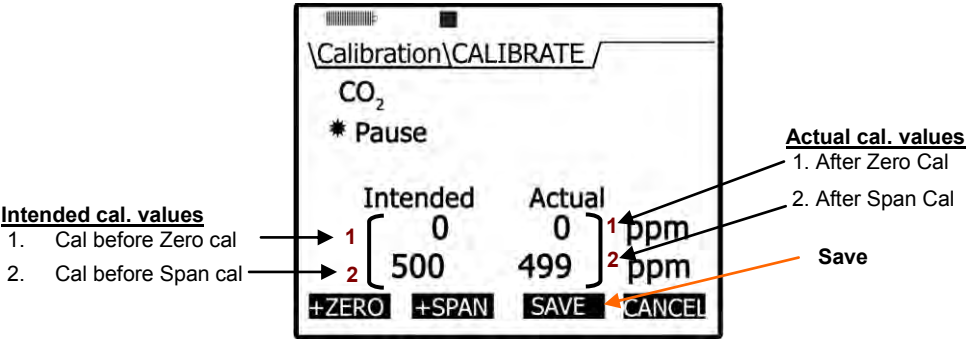


Figure 4-26: Saved Calibration

11. Once saved, the display will indicate if it passed. You have another option to **Retry** the calibration procedure by pressing the **Retry** softkey.

12. To exit CO<sub>2</sub> calibration, press the **Exit** softkey.

13. Then, press **On/Off/Esc**  twice to return to the Start screen.

## Calibrating Photo-Ionization Detector (PID) Sensor

Since a PID PPM sensor can detect a wide variety of gases, the best method to calibrate a PID sensor is to apply the gas of interest. It is recommended to set the flow rate at 1 LPM for best response time.

The following two sections, PID Zero cal and PID Span cal, explain the different methods.


### PID parts per million (ppm) zero calibration

It is recommended to flush the PID ppm sensor with Zero Grade Air or N<sub>2</sub> for a zero calibration. In clean environments (with no presence of toxic chemicals, such as in a school setting with no toxic cleaners present) applying room air can be used to set your zero calibration point.

### PID parts per billion (ppb) zero calibration

With a PID ppb sensor, a zero calibration is not performed in the field. (It is calibrated at the factory only.) A span calibration is the only option available for the PID ppb sensor. (For PID Span calibration, see page 72.)

#### ➤ PID ppm zero cal

1. **Connect** the N<sub>2</sub> /Pure air/Zero Grade Air w/ THC, regulator, inert tubing, and cal cup to the EVM. (Please skip this step if you are not applying a gas.)
2. From the **start screen**, press the **Down ▼** arrow to select **Calibration** and press **Enter** .

- Press the **Arrows** to select the **PID** sensor.

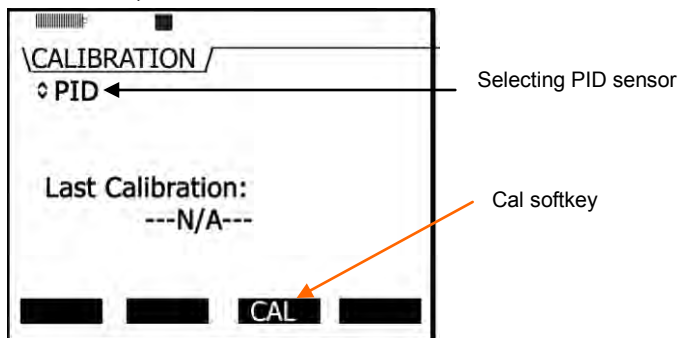


Figure 4-27: Selecting PID sensor for calibration process

- Press the **Cal** softkey and the **Calibrate PID/Ready** screen will appear. Press **Zero** softkey. **\*NOTE:** allow at least 60 seconds to stabilize.
- When the level has stabilized, press the **Set** softkey. (Or press **Cancel** softkey and then **Retry** softkey to repeat this process.)

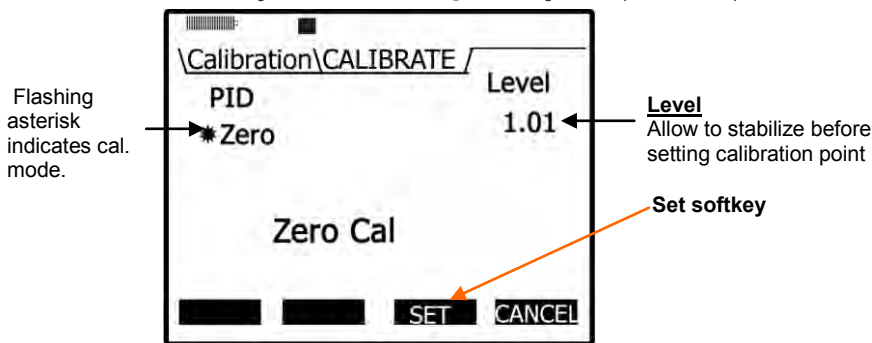


Figure 4-28: Calibration mode screen

- The **PID/Pause** screen will appear displaying the intended and actual calibration values. Press the **Save** softkey. (Or press the **Cancel** softkey to repeat this process.)
  - To set the span cal, proceed to "PID – span calibration".

### PID span calibration

Typically for **PID 100 ppm, isobutylene** is used for a span calibration when the VOCs are unknown. If your intent is to measure a specific VOC with PID PPM sensor, then you will want to use the

relevant VOC for your calibrated gas source. However, for **PID PPB** span calibration, it is recommended to use **10 ppm** (or 10,000 ppb) **isobutylene** whether the gas of interest is known/unknown.

**☑ NOTE:** A correction factor is a number that relates to the PID sensor of a specific VOC and correlates to the PID response to the calibration gas (sometimes referred to as a response factor). Please reference Appendix C for specific correction factors provided by Ion Science.

### Performing a PID Span Calibration

Allow up to 15 minutes of warm-up time for PPB PID sensor and 5 minutes for PPM PID sensor.

If you are proceeding from the Zero cal section, the screen you will be viewing is the Calibrate/Pause screen. (If you closed the screens, refer to the Note in step 1.)

#### ➤ PID Span Cal

1. From the **PID/Calibrate Pause** screen, press the **Span** softkey on the keypad.

**☑ NOTE:** To navigate to the PID Span cal screen, select the Calibration screen. Select PID using the up/down arrows. Then, press the Cal softkey. Zero and Span softkeys will appear. It will look similar to the screen below but it will not have the intended/actual zero cal set point results displayed. Please see step 2 to proceed.

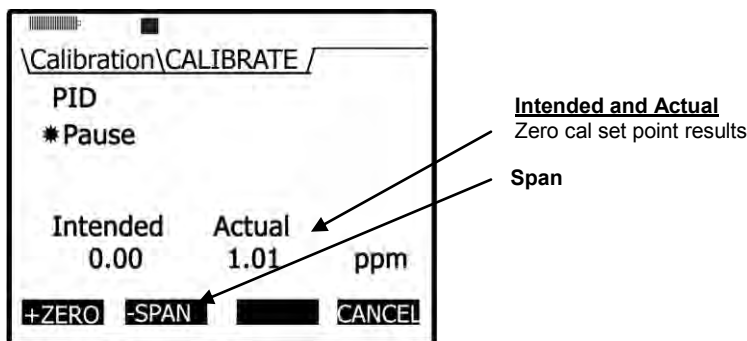


Figure 4-29: PID Calibration Span softkey

2. Adjust the span value by pressing **▲▼ Arrows** once the sensor has warmed-up.

3. **Apply** the **gas** at full flow rate while observing the “Level” field on the display. Wait for the current level to stabilize (allow a couple of minutes).
4. Press the **Set** softkey (and it will state Cal set point stored).
5. Once your calibration is completed, a **Save** screen will appear with the details of your parameters.

**✓ NOTE:** if you want to repeat the span cal, press cancel and a message will appear stating it is canceling. Press the **Retry** softkey to repeat the span cal steps.

6. Press **Save softkey** to store this into the memory.

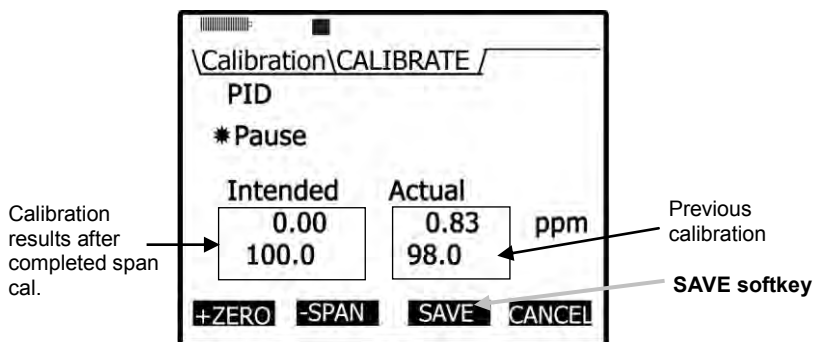


Figure 4-30: Saved Calibration screen

7. Turn the regulator off and disconnect the tubing from the instrument.
8. Repeatedly press **On/Off/Esc**  until you return to the start screen. (Press right or left to view measurement screens.)


## Calibrating relative humidity and temperature

The relative humidity and temperature sensors are factory calibrated. To perform a calibration, you would place the instrument into the location you will be testing with the appropriate temperature sensing instrument (such as a thermometer for a temperature calibration). Then, access the calibration screen and allow the Relative Humidity and Temperature readings to stabilize. Preceding the calibration level, you then store these values.

**✓ NOTE:** When performing a user calibration on Relative Humidity and Temperature, you should not externally power/charge the instrument. If you are currently charging or using an external power adapter, please disconnect before proceeding.

➤ **Relative Humidity or Temperature calibration**

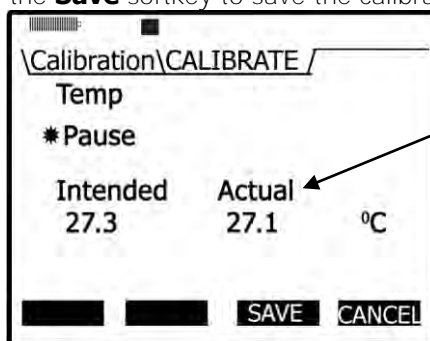


1. Open the **Calibration** screen.
2. Press **▲▼ Arrows** and select either **RH** or **Temperature** calibration.
3. Select the **Cal** softkey and then press the **Start** softkey.
4. Adjust the level to match the current value of a calibrated temperature sensing instrument.
  - To adjust the level, press **▲▼ Arrows** until the appropriate value is selected.
5. Press the **Set** softkey and a **Save** screen will appear.
6. Press the **Save** softkey to save the calibration.



**Temperature cal**

- Intended & actual readings

**Figure 4-31: Temperature calibration**

7. To calibrate the other sensor (RH or Temp), repeat these steps.
  - Or press the **Exit** softkey and then press **On/Off/Esc** .
  - To open the calibration screen: from the start screen, press the **Down ▼** arrow to select **Calibration** and press **Enter** . The Calibration screen will appear.
8. To exit and return to the main screen either press the **On/Off/Esc**  twice.

## Calibration history

In the calibration history screen, it will show your previous calibration of a specific sensor. When the sensor is selected, you will see when the last calibration was performed. To view the calibrated values, an optional History menu is selectable via a History softkey. The figure below is an example of a CO<sub>2</sub> cal. history.

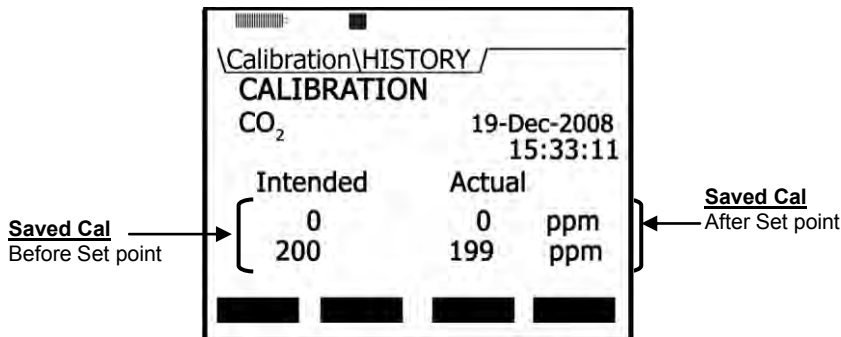



Figure 4-32: Calibration History screen

### ➤ Accessing the Calibration history screen

1. Select the **Calibrate** menu from the start screen and then choose a sensor.

☒ **NOTE:** *press up/down arrow in the calibrate menu to select a sensor.*

2. If the sensor selected was recently field calibrated, the **History** softkey menu will appear along with the date and time of the last calibration.
3. Press the **HISTR** softkey to view the saved calibration results.
4. To exit and return to the start screen press **On/Off/Esc**  twice.

## Verify calibration and drifting analysis

The verify screen is typically used to analyze drifting. This process verifies if the zero calibration remained stable or unchanged during the run-time/logging time. If it did not remain stable, you can set a new calibration offset and save this as your new set point.

### ➤ Verify calibration

1. Select the Calibration menu from the start screen and select a sensor you wish to verify.

☑ **NOTE:** *press up/down arrow menu to select a sensor in the calibration menu.*

2. Press the **Verify** softkey. (The Calibrate offset will display on the screen.)

☑ **NOTE:** *For this example, PID sensor was selected in step 1. If you selected a different sensor, the screens will look very similar to the figures below.*


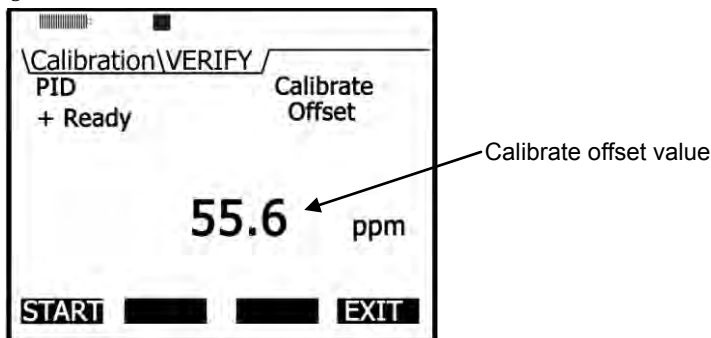



Figure 4-33: Calibrate offset verify screen for PID sensor

3. Press the **Start** softkey and allow the level to stabilize. (Apply any gas if applicable as described in the Calibration sections above.)

4. Press the **Set** softkey to set a new calibration value.

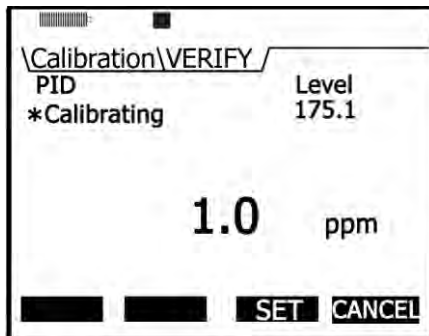

**Figure 4-34: Calibrating PID**

5. The Intended and Actual values will appear. Press the **Save** softkey to save these new values.
  - Or press the **Cancel** softkey and press **Retry** to repeat this process.
6. To return to the start screen, press **On/Off/Esc**  twice.
  - To retry the offset cal, press the **Retry** softkey and repeat the steps above.

**This page left blank intentionally**

# Measuring and Viewing



Once you have setup your logging parameters and calibrated the instrument, you are ready to begin measuring. The focus of this chapter is to give you a brief overview of what is measured, how to navigate, what measurements screens will appear, and how to run and stop your measurements. The chapter concludes with an explanation of the file system management functionality which is comprised of the following: reviewing past measurements, deleting files, viewing file storage and memory, and viewing the estimated run-time.

**NOTE:** *The subsequent sections show examples of views which you may have disabled on your instrument. (Please refer to **Chapter 3**, "Setting-up the EVM" for more details.)*

## Overview of running a session

The list below is a brief overview of the steps for running a study.

### **Quick Help List: typical gas/particulate/air quality overview**

1. Turn the EVM on and check your battery power. (Chapter 2).
2. Reset/Clear memory. (if necessary).
  - This will clear out all of the data history before your study begins to ensure you have sufficient memory space.
3. Set-up your study parameters (See Chapter 3).
4. Calibrate each sensor/parameter (See Chapter 4).
5. Place the EVM in a specific location for area monitoring.
6. Press the Run/Stop  key to start the study. (Chapter 5)
7. When you are ready to end your study, press the Run/Stop  key to stop the study.
8. Review your results either on the instrument or download to QSP-II for further analysis (graphs/charts, saving and printing).

**Figure 5-1: Quick help list for running a study**

## Measuring

Once you have placed the EVM in a specific location, you are ready to take measurements.

With a couple pushes on the keypad buttons, you will be running and viewing your sessions. Following your sessions, you can load the data/files into QSP-II to manipulate, analyze, save, and create reports (See Chapter 6 for viewing your logged data in QSP-II).

### Understanding what data is stored

When you are performing air quality monitoring, there are two types of data stored in the instrument which includes summary data and time history data (or logged data).

#### Summary data

Summary data represents values that occurred over the entire run of the study. An average measurement is the average of all arithmetic data points for a sensor (i.e., dust, humidity, CO, etc.), Max and Min values are the highest and lowest measurements that occurred throughout the run time.

General Data Panel		
Description	Meter/Sensor	Value
Humidity Avg	1	16.4 %
Dust Average	1	0.06 mg/m
Humidity Min	1	15.4 %
Dust TWA	1	0 mg/m
CO2 Average	1	9024 PPM
CO2 Maximum	1	20000 PPM
CO Average	1	0 PPM
CO TWA	1	0 PPM
PID Maximum	1	34 PPM
Bar. Pres. Minimum	1	101.3 kPa
Temperature Average	1	77.2 °F
Log Rate	1	60 s
Dust Active Profile	1	PROFILE1
Dust Impactor Setting	1	None
Dust Profile Factor	1	1
Dust Override Factor	1	1

Figure 5-2: Sample summary data from QSP-II reporting

### Logged data/ Time history

Logged data, also referred to as “time history”, plots measurements with a specified logging interval ranging from 1 second intervals to 60

minute intervals (as set up in the EVM monitors via the logging screen).

Time History data represents measurements that occurred over the most recent time period, which is the logging interval. For example, if the log interval is 1 minute, then the maximum value is the highest value for that 1 minute, and the Lavg value is the average value for that 1 minute.

**NOTE:** QSP-II has two default logged data charts that appear: temperature and humidity on the first logged chart, and Dust and CO<sub>2</sub> data on the second logged data chart. (If you do not have those sensors installed, they will not appear.) In QSP-II, to view different sensor measurement parameters on the logged data chart, click on the edit icon and click in the *specific sensors' checkboxes*.

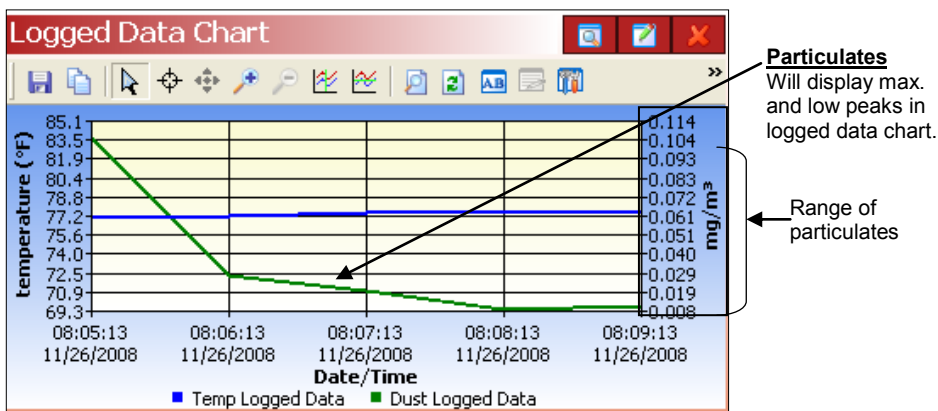




Figure 5-3: Sample time history data (or logged data) chart

## Running and stopping

When running a session, the pump will automatically turn on during your logging/run if particulate is enabled. (This is explained in the Particulate setup section, page 23.) At any time, you can turn the pump off (disable) if you are not measuring particulates or the environment is extremely dirty and you wish to keep the pump clean. Simply press the particulate key (as indicated in Figure 2-2) to turn this feature off. To page through the measurement screens, press **Arrows**.

**NOTE:** for particulates ensure the impactor is well-greased before measuring (see "Impactor care" for details).

## ► Running and Stopping measurements

1. From the start screen or any of the measurement screens, press the **Run/Stop**  key to begin measuring.
  - A 5 second countdown will appear with a run message (in pause mode) when the particulate setting is enabled.
2. Press and hold the **Run/Stop**  key to stop measuring.

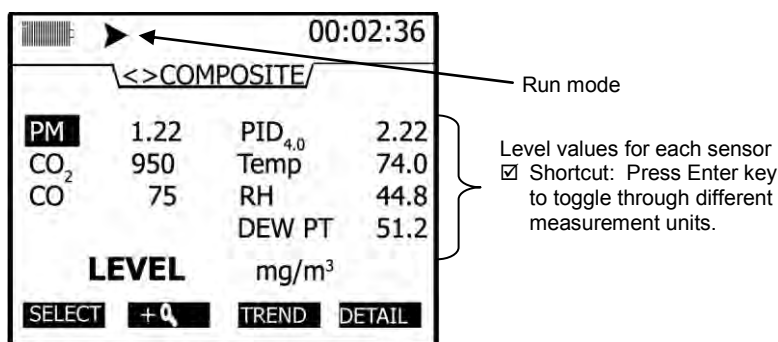




Figure 5-4: Composite measurement screen in run mode

## Measurement screens and navigation

To navigate through the measurement screens repeatedly press  **Arrows** key from the **Start screen**. (The start screen is the second screen you encounter after the initial splash screen.

Looking at the measurement screens clockwise (or pressing  **Arrow** key), you will see the **particulate measurement screen**. The subsequent screens that appear include the **relative humidity** and **temperature screen**, the **gas screen**, the **composite screen**, and the **air velocity screen**. Depending upon the sensors you purchased, the installed sensors, and the measurement setup you may see some variations in the upcoming measurement screens in comparison to your instrument. These will be noted (or explained in full detail).

## Unit defined

While viewing your measurement data, you will want to have a good understanding of the abbreviated units used on the instrument. These are listed in Table 5-1.

Abbreviations on the EVM	Explanation
<b>OL</b>	<b>Over Load</b> – This indicates a measurement (on the current screen) is above the maximum value (for that sensor) which the instrument can measure.
<b>UR</b>	<b>Under Range</b> – A measurement (on the current screen) is below the minimum value (for that sensor) which the instrument can measure.
<b>°F</b>	<b>Degrees Fahrenheit</b> – This is displayed with readings for Temperature and Dew Point.
<b>°C</b>	<b>Degrees Celsius</b> – This is displayed with readings for Temperature and Dew Point.
<b>%</b>	<b>Percent</b> – This is displayed for the percentage measurement for the pump flow rate, the relative humidity sensor, and the Oxygen sensor.
<b>ppm</b>	<b>Parts per Million</b> – This is displayed with measurement readings of CO <sub>2</sub> , toxic gas, and PID sensor (for VOCs).
<b>ppb</b>	<b>Parts per Billion</b> – This is displayed with reading of PID sensor (for VOCs).
<b>mg/m<sup>3</sup></b>	<b>Milligrams per cubic meter</b> – This is a unit of measurement (of mass per unit volume) and is used for particulate measurements and PID PPM (PID sensor for VOCs).
<b>µg/m<sup>3</sup></b>	<b>Micrograms per cubic meter</b> – This is a unit of measurement (of mass per unit volume) and is used for particulate measurements and PID PPB (PID sensor for VOCs).
<b>m<sup>3</sup></b>	<b>Volume</b> – Gravimetric volume for the particulate measurements.
<b>mg</b>	<b>Mass in Milligrams</b> – Gravimetric accumulator mass for the collected particulates.
<b>m/s</b>	<b>Meters per second</b> – This is the unit of measurement for metric air velocity.
<b>ft/m</b>	<b>Feet per minute</b> – This is the unit of measurement for air velocity.

**Table 5-1: Unit abbreviations**

About the measurement softkeys

Each measurement screen has softkeys (extended menus) which are used to view different measurements. (**NOTE:** *press the Enter key to toggle through the various measurements.*)

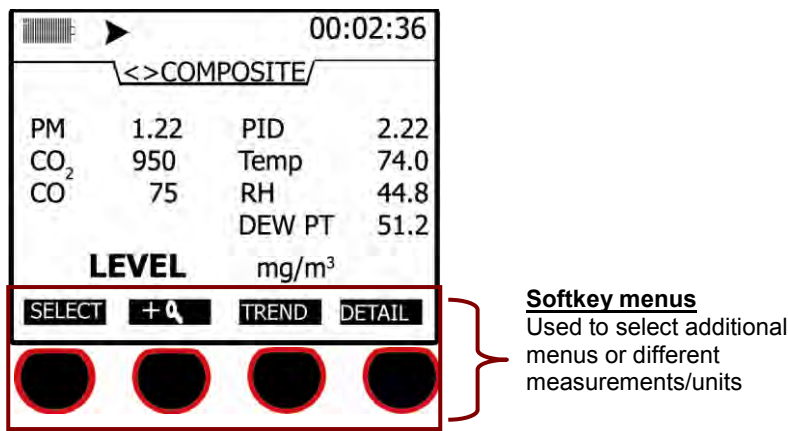


Figure 5-5: Example of measurement softkey menus

Measurement Softkeys	Explanation
Lookup softkey (eyeglasses)	<b>Lookup icon (eyeglasses) softkey</b> – used to select and view different measurement values (on the particulate and air velocity screens). <ul style="list-style-type: none"><li>Level, Maximum, Minimum, Average, Short Term Exposure Level (STEL) and Time Weighted Average (TWA).</li></ul>
Select softkey	<b>Select softkey</b> - if more than one sensor/parameter is selectable on a measurement screen, this is used to select a sensor such as: temperature, toxic gas sensor, PID sensor etc.. If you are on the composite screen and the screen is magnified, you can select each sensor and the measurement units will be displayed on the bottom of the screen.
+/-	<b>Magnifying glass symbol</b> –Used to Zoom in (+) or out(-). (The plus denotes zoomed in and the minus sign denotes zoomed out.)


Table 5-2: Measurement softkeys explained

Measurement Softkeys	Explanation
<b>Detail softkey</b>	<b>Detail softkey</b> – used to view a sensor’s measurement values in a summary screen. For example, if you are on the composite measurement screen and you want to view the summary data for CO2, you would first select the CO2 field and then select the Detail softkey. You may need to press the up/down arrow to scroll through the data.
<b>Trend softkey</b>	<b>Trend softkey</b> – is graphical chart and is used to give you a quick synopsis of trends over time such as a high volume of particulates at a specific time. The following settings are always logged and are viewable by pressing the AltF key when you are viewing the trend screen: 90 sec, 180 sec, 900 sec, 90 min, 3 hrs, 8 hrs, 12 hrs, 24 hrs. The timescale (x-axis) can be expanded by pressing the right or left arrow keys. The measurement level (y-axis) can be expanded and contracted (some sensors) by pressing the up or down arrow keys.

**Table 5-2: Measurement softkeys explained (continued)**

## Particulate measurement screen

The particulate measurement screen displays the user-adjustable impactor setting (i.e., PM 2.5), the applied profile (or correction factor) and various measurements (level, max, min, etc.)

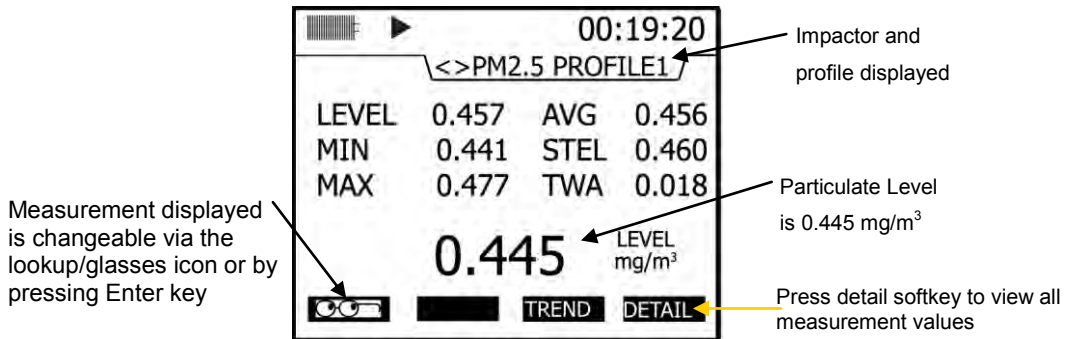

**Figure 5-6: Particulate Measurement screen**

## Impactors and particulate measuring

As discussed in the calibration chapter, there are four selectable particulate settings. To move the impactor, ensure you are in stop mode. Then, twist to the right or left until you feel a tactile detent. The impactor setting will align to the gray marking on the housing (see Figure 4-4 for an example).

☑ **NOTE:** *The particulate screen will display "ERR" if it is not clicked into one of the appropriate settings. The selections include: PM2.5, PM4, PM10, and PM.*

☑ **NOTE:** *The impactors may require cleaning during or after your measurement study. Please see Chapter 4, "Impactor and Use" for more information.*

## Extending run-time for PM measurements

If you will be measuring in a dusty environment (such as an environment that is oily) or for a long period of time (10+hours), you may need to clean the impactors frequently in order to remove the debris build-up on the impactor. (See chapter 7 for Maintenance and cleaning for more detailed instructions.)




To extend the run-time for PM measurements, attach a cyclone to the turret. The cyclone is used to prevent the larger dust particles from building-up on the impactor which eventually clogs the impactor. It forces the larger particulates, using centrifugal force, down and around the filter and collects in the bottom holding cap. (See Figure 4-6 for more details.)

☑ **NOTE:** *you use a cyclone that is designed to work at 1.67 lpm pump flowrate.*


## Changing particulate measurements

To change the displayed measurements, there are three options in the particulate screen. You can press the **Enter** key to page through each measurement, select a specific measurement from the **lookup/glasses** softkey, and/or press the **Detail** softkey. (The measurements are defined in Table 5-3). **NOTE:** If "---" characters appear on the screen, this denotes that the measurement is invalid.

### ➤ To change your measurement view

1. Click on the "Look-up" icon  .
2. In the pop-up measurement menu press the **Up/Down** arrow to select a different type.
3. Press **Enter**  to select. On the particulate screen, the selected measurement type will appear.
4. To view a graphical view of the data, press the **Trend** softkey. In the Trend screen, press the **Line** softkey. This switches the screen from a dotted line to a shaded bar chart view. To exit this screen, press **On/Off/Esc** .

☑ **NOTE:** Press the **AltF** key to toggle between the trend time scale and the softkeys.

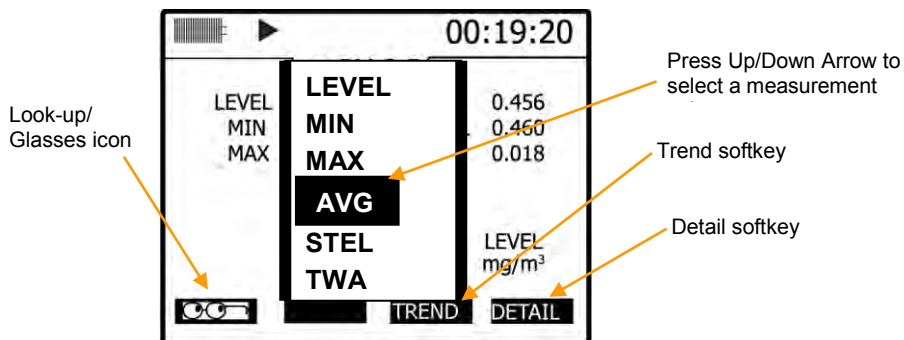


**Figure 5-7: Selecting a measurement calculation**

5. Or select the **Detail** softkey and a summary of all the measurements will appear. (Below is an explanation of measurements.)

Measurement values	Explanation
<b>LEVEL</b>	<b>Level</b> - Notation used to represent current live reading of the sensor. (This is updated once a second.)
<b>MIN</b>	<b>Minimum</b> - Minimum level value which occurred during a log session.
<b>MAX</b>	<b>Maximum</b> - Maximum level value which occurred during a log session.
<b>AVG</b>	<b>Average</b> - Arithmetic average of all level values which occurred during a log session.
<b>STEL</b>	<b>Short term exposure level</b> - is a calculation used to indicate an exposure level (to a toxin) over a short-term period. This value is calculated by averaging the last 15 one minute averages. This value is invalid for the first 15 minutes and is updated every minute there after. Essentially, it is used when the building occupant/worker is exposed to high concentrations of chemical gases. The measurement will average after 15 minutes of data logging and continue to compute after each minute of logging, using measurements from the most recent fifteen minutes. If less than 15 minutes has elapsed, the STEL will be invalid by displaying dashes.
<b>TWA</b>	<b>Time weighted average</b> - is an average based on an 8-hour interval. The summing all of the level values taken and dividing by the number of samples in 8 hours (at one sample per second the total would be 28,800). The important thing here is that the average is calculated the same way regardless of whether you've run the instrument for 1 hour, 8 hours, 24 hours or any other amount of time (i.e. the number of samples used to divide by is the same). This value is updated once a second.

Table 5-3: Measurement values explained

## Relative humidity & temperature measurements

The relative humidity and temperature sensor will display on the left-hand side of the screen with two measurement values. The measurement displayed in the second column is user-selectable via **Enter** .

### Relative humidity and temperature screen

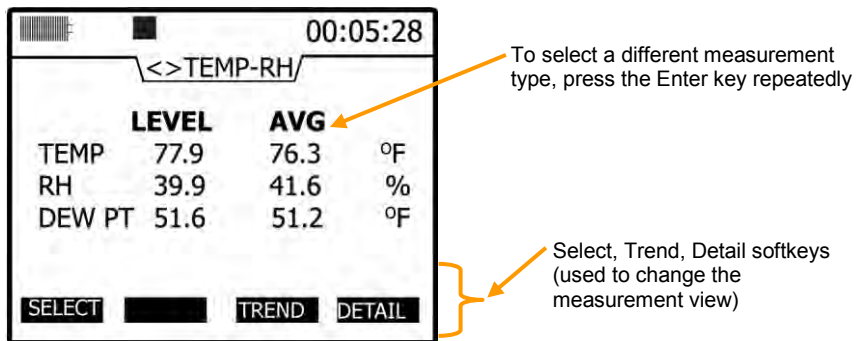



Figure 5-8: RH and temperature measurement screen

- To change the RH and Temperature measurement view
1. Press the **Select** softkey, **Trend** softkey, or the **Detail** softkey.  
(See Table 5-1 for details).
- ☑ **NOTE:** The  **Arrows** can be used instead of the Select softkey.

## Gas measurements

The gas measurement screen displays the measurements for CO<sub>2</sub>, toxic gas(es), and PID sensor. (NOTE: depending on what sensors you ordered and which sensors are installed, the appropriate gas sensors will display on this screen.)

### Gas screen

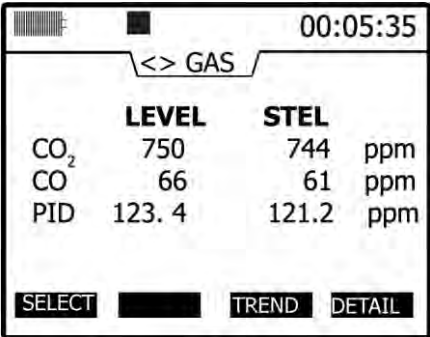







Figure 5-9: Gas measurement screen

- To change the gas measurements view
1. Press the **Select** softkey, **Trend** softkey, or the **Detail** softkey.  
(See "Viewing summary/details" or "Viewing trend details, on pages 59-60.)
- ☑ **NOTE:** The  **Arrows** can be used instead of the Select softkey.


## Composite measurement

When you first access the composite screen, all of the sensors appear on the screen. There are two main views which is dependant on if you pressed the zoomed-in or zoomed-out softkey. (The "zoomed-out" is the default composite view.)

## Composite screens

- + 🔍 • **Zoomed in:** The composite measurement screen (when zoomed-in) combines all sensors/parameters into one screen with two columns displaying two different measurement calculations. The second column is changeable by pressing **Enter** . (See "B" below.)
- 🔍 • **Zoomed out:** The composite measurement screen (when zoomed-out), appears with the measurements for all installed sensors. Press **Enter**  to change the measurement values (as explained in Table 5-3). Press **Arrows**  or **Enter**  to page through sensors. (See "A" below.)

### A- Zoomed -out (Magnify softkey)

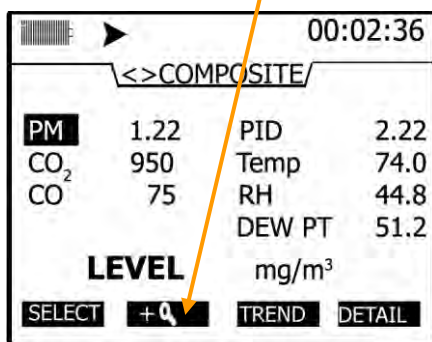

### B – Zoomed-in (Magnify softkey)

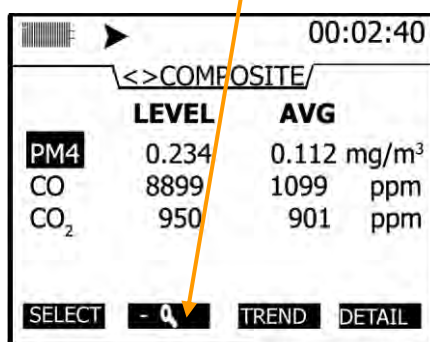



Figure 5-10: Composite measurement screen

### ► To change the composite measurements/view

1. Press the **Select** softkey, **Trend** softkey, or the **Detail** softkey. (See "Viewing summary/details" or "Viewing trend data" for more details.)
2. To zoom in on the results, press the **magnify** softkey. (see "B").

## Air velocity measurement screen

There are a couple quick steps to ensure air velocity is setup and that the AirProbe is attached before measuring.

1. The air velocity setting is enabled in **Setup /AUX/Air Velocity** screen. (See "Air Velocity" **Setup** in Chapter 3 for more details.)
2. Connect the AirProbe bracket attachment to the backside of the EVM. Attach the AirProbe to the bracket. Next, plug in AirProbe plug from the AirProbe to the digital output on the instrument. (See AirProbe output below.) (Note: it is optional to attach the AirProbe to the bracket on the instrument.)
3. Turn AirProbe switch to **On**.
4. Navigate to the Air Velocity measurement screen using the  **Arrows**.
5. To log air velocity data, press the **Run/Stop** key.



**Figure 5-11: Attaching AirProbe and measuring Air velocity**

## Summary Data


In each of the measurement screens, a **Detail** softkey will appear. Once selected, you can view a quick summary of all measurement calculations in one screen. This is explained below.

### Viewing details in the measurement screen

- **Viewing the composite measurements in individual summary screens**
  1. To view details of a sensor, select a measurement screen and then select/highlight a specific sensor (if more than one is displayed).
    - For example, to select PM from the Composite screen, press **Arrows** ▲▼ or the **Select** softkey.
  2. Press the **Detail** softkey and a summary screen of the selected measurement screen (i.e., PM 2.5 – particulates screen) will appear.



Figure 5-12: Details of the composite measurement screen

3. Press **On/Off/Esc**  to return to the previous screen.
  - Repeat these steps to view other sensor measurements.

## Trend Data

The trend data screen is a graphical logged data chart and is viewable in all the measurement screens. Depending on the parameter you are viewing (i.e., PID sensor, Particulates, etc...), it will display the measurement level values in a graphical format.

## Viewing trend data in the measurement screen

The example in Figure 5-13 displays particulate trend data with one second level values.

### ► Trend data screen

1. To select a trend screen, first select a measurement screen you wish to view.

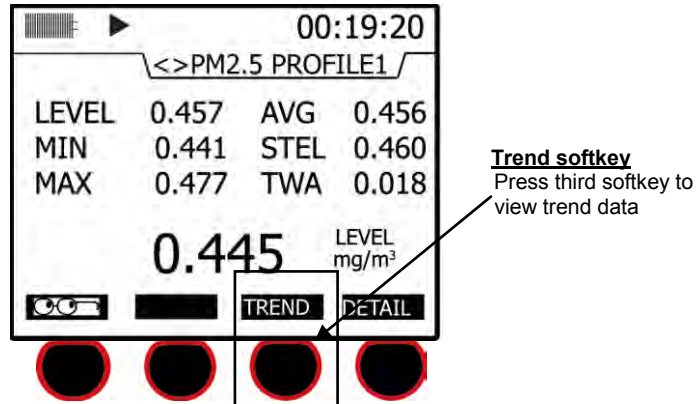


Figure 5-13: Selecting Trend softkey

2. In the measurement screen, press the **Trend softkey** and a graphical data chart will appear.
  - You can either view the data as a **"Line"** format or a **"Bar"** chart format by pressing these softkeys on the bottom of the display.
3. (Optional) Press the **Alt** key to toggle between the trend time scale units and the softkey menu.
4. (Optional) Press **▲▼ Arrows** to change the vertical range.
5. (Optional) Press **◀▶ Arrows** to change the horizontal range.

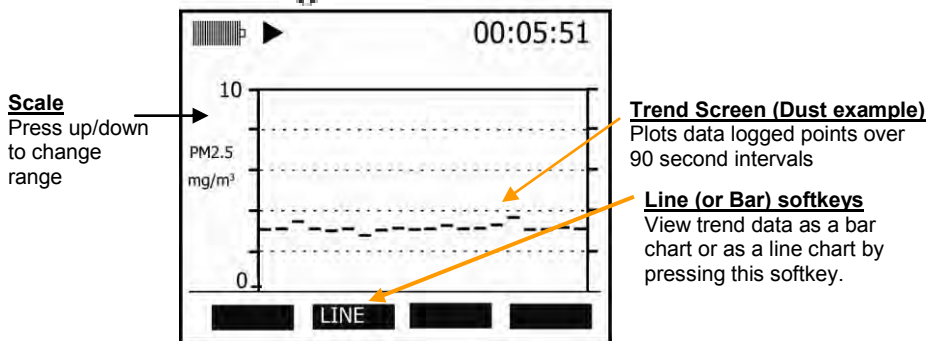



Figure 5-14: Trend Screen for PM (Dust)

6. Press **On/Off/Esc**  to return to previous screen.


## Past session


The past session summary screen allows you to view your session summary data. You can view sessions by name and file size, name and date, or name and run time via the lookup softkey. Once a session is selected, the measurement summary information is viewable and selectable via  **Arrows**.

✓ **NOTE:** *the session run time will appear at the top of display.*

## Summary data screen

### ► Selecting and viewing past session summary data

1. From the start screen, select **past session summary** menu and press **Enter** .
2. In the past session screen, to view the last session, ensure this field is selected then press **Detail** softkey.

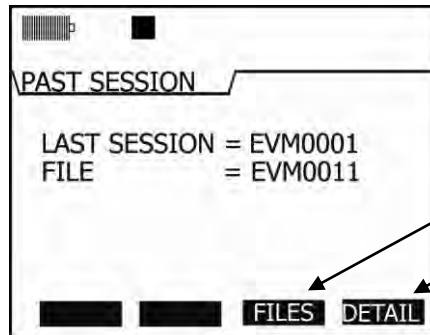

#### FILES

Allows user to choose any past session. (This appears when File field is selected.)

#### DETAIL

Used to view the summary data of the selected session.

Figure 5-15: Past session screen

3. To select a specific file, first select the **File** field and then press the **Files softkey** and the Load File screen will appear.
  - **Optional:** press the **Look-up** softkey to view the file by name and file size, name and date, or name and run time. To select, press up/down arrow and then press the **Load** softkey to select.

✓ **NOTE:** *pressing the enter key will sequence the files size, date, and run time.*

- To select a session, press  **Arrows** and press the **Load** Softkey.

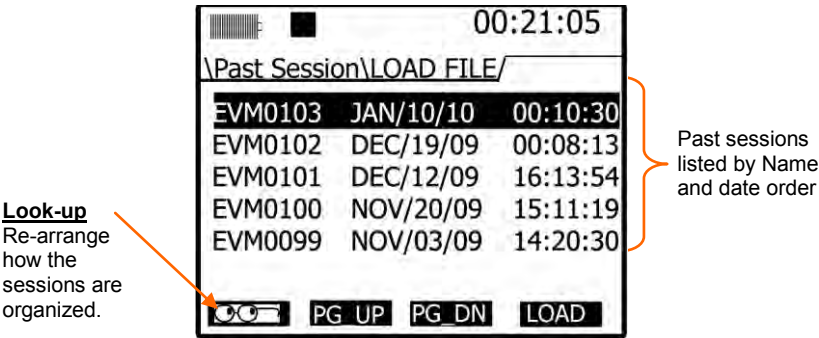


Figure 5-16: Past Session with Files selected

Files softkeys	Explanation
Look-up	Look-up softkey: used to organize the session files by the following: Name & file size, Name &date, or Name& run time
PG-UP	Displays the previous page of session files.
PG-DN	Displays the next page of session files.
LOAD	Once you select a session file to view, press the Load softkey in order to LOAD and then view the detailed summary data screens.

Table 5-4: Past session files softkeys explained

- Once a file is selected and loaded, press the **Detail** softkey to view the summary data.

**NOTE:** the particulates, toxic gas, CO<sub>2</sub> gas, and PID sensors will detail the following measurement parameters: Min, Max, Avg, Max STEL, TWA. For RH, Temp, and Air Velocity, the measurement parameters include: Max, Min, and Avg.

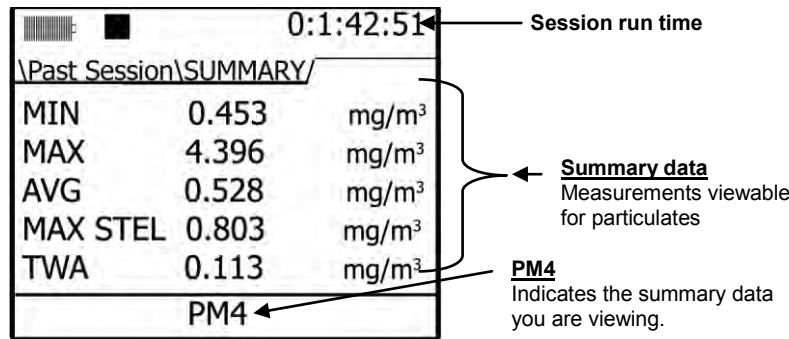


Figure 5-17: Summary screen of a past session

5. When viewing summary data, press **Arrows** to view summary data for each sensor. (This is similar to viewing measurements during run or stop mode.)
- In the summary data screen, the session run time will appear in the upper hand corner of the display.
- NOTE:** For particulates summary data, it will display the impactor setting applied during the measurement (i.e., PM4).
6. To return to the main screen, press **On/Off/Esc** twice to return to the **Start** screen.



## File System menu


With the File system menu, you can delete or clear sessions one-by-one or delete all sessions. You can also verify the used and free memory of the instrument via the Properties menu. The instructions below explain the Session Directory menu, Delete All Session menu, and the File System Proprieties menu.

### Deleting sessions individually

➤ **Deleting sessions individually**

1. Open the **File System** screen from the **Start** menu and select the **Session Directory** menu. Then, press **Enter** to open.

2. In the **File System/Sessions** screen, you have the same softkey selections as the Past Session Summary menu. (Please see Table 5-4 for softkey explanation).
3. To delete a selected session, first select a specific session to delete by pressing the  **Arrows**.
4. Press the **Delete** softkey. A Delete pop-up screen will appear. To confirm the delete, press the **Left** arrow and then press the **Enter** . (This will delete the selected session.)

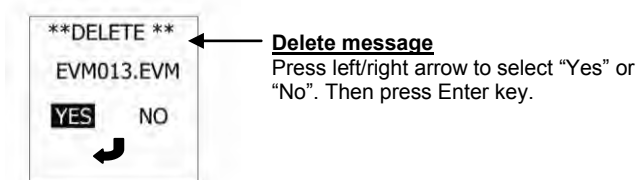



**Figure 5-18: Delete session message**


5. Repeat these steps until all of the appropriate sessions are deleted (or see the next section, "Delete All" to delete all of the sessions.)

## Delete all sessions


Once you have reviewed your data and possibly downloaded to QSP-II for future storage, you can delete all sessions.

### ► Deleting all sessions

1. Open the **File System** screen from the **Start** menu and select the **Delete All Sessions** menu. Then, press **Enter**  to open.
2. A delete message will appear. Press the **left arrow** to select **Yes** and press **Enter**  to delete all sessions.

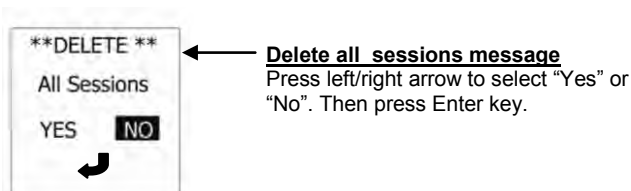


**Figure 5-19: Delete all sessions message**

3. A message stating "deleted all sessions will appear".
4. To return to the start screen, press **On/Off/Esc** .

## Memory remaining and file properties

The properties screen displays the number of stored files, the total amount of space used on the instrument, and the amount of free memory space.

### ► Viewing remaining memory and file properties

1. Open the **File System** screen from the **Start** menu and select the **Properties** menu by pressing the **Down** arrow key.
2. Then, press **Enter**  key to open the **Properties** screen.
  - **Num Files field** – indicates the number of files saved on the instrument.
  - **Used field** – indicates the amount of memory used in the instrument's file storage.
  - **Free field** – indicates the amount of memory available (or free) on the instrument.

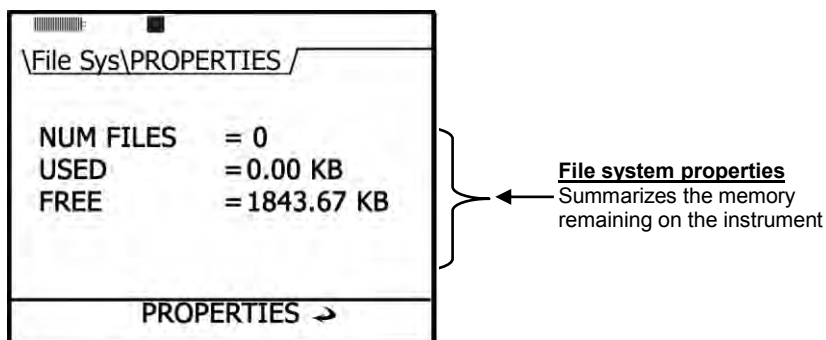


Figure 5-20: File Systems properties screen


## Estimated Run Time

The Estimated Run Time screen displays the amount of days, hours, and minutes' remaining on the instrument. You can extend the run time if you log less parameters (such as, only logging MAX or increasing the log interval.)

You may want to download and save your files in QSP-II and then clear the memory on the EVM. This will also extend the logged time. For more information on estimated run time charts, please see Appendix A, "Estimated logged run times", page 132.

☑ **NOTE:** *The estimated run time screen is also viewable via the logging setup screen (for more details, please see Chapter 3, "setting logging and viewing runtime", page 25).*

### ➤ View estimated run time

1. Open the **File System** screen from the **Start** menu and select the **Estimated Run Time** menu by repeatedly pressing the **Down** arrow key.
2. Then, press **Enter**  key and the Estimated Run Time screen will appear.

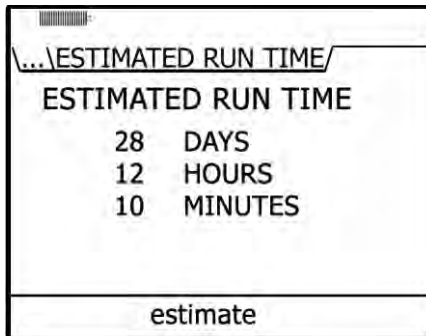


Figure 5-21: Viewing estimated run time

## DMS (Software)



### EVM Communication

Once communicating with the EVM and DMS, you have the option to download data, configure instrument parameters, and configure quick setup features, such as the time and date settings. The following explains the EVM communication download and/or setup steps.

1. Plug the USB cable into the powered on EVM and then connect it to the computer port.



**Figure 6: Communicating with the EVM and DMS**


2. From the start page of DMS, select either button (see 1) or button (see 2) and the Instrument Communications page will appear with setup and download panels.
3. Select **Air Quality** and then select **EVM** under **Instrument** (see 3 and 4). You are now ready to setup or download your instrument (see 5).



**Figure 6-1: DMS Start page and Setup/Download options**

## Downloading data with the EVM

The Instrument Download feature enables you to download your files from the EVM Series into the software for review and analysis of the data. Once the files are downloaded and if "Go to Session Finder after Download" is checked, DMS will open into the session finder page. To download, please follow steps below:

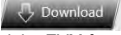1. To download the EVM data, ensure your instrument is communicating properly. (See communication setup for details.)
2. From the Start page, select the  button.
3. Select the **Air Quality family** and the EVM from the Instrument window (see 1).
4. Press the **Download** button (see 2).

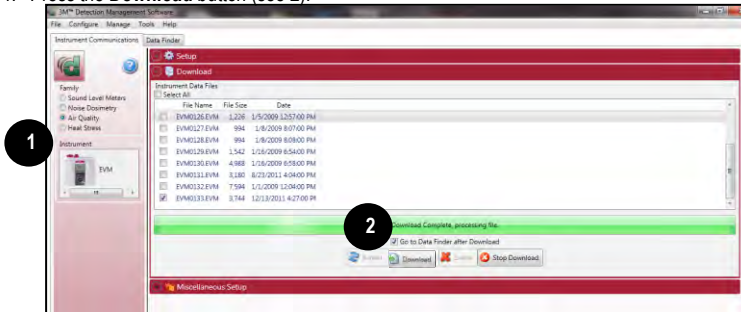



Figure 6-2: EVM and downloading

## EVM: Viewing Data

The data finder page, displayed below, is used to view, select, analyze, and create reports after the data is downloaded. . The data is presented in a bar chart style with measurements/parameters displayed on the top navigational bar by family.

### Selecting a session/study

To view downloaded data from the welcome page, click on the  button and the data finder screen will appear. (Or select the Data Finder tab if already opened.)

1. Select a session by either double-clicking on data or click on the session/study and select the  button.
  - **Family:** **Air Quality:** EVM data is stored in this family. (See 1).
  - **Session/Study:** The EVM data is organized by the table headings, such as the session/study name. (See 2).
  - **Start Time:** To quickly locate your study by most recent start time, click on the Start Time heading and it will sort ascending/descending (See 3).
  - **Analyze/Report:** Select a session and then click on one of the buttons. (See 4).

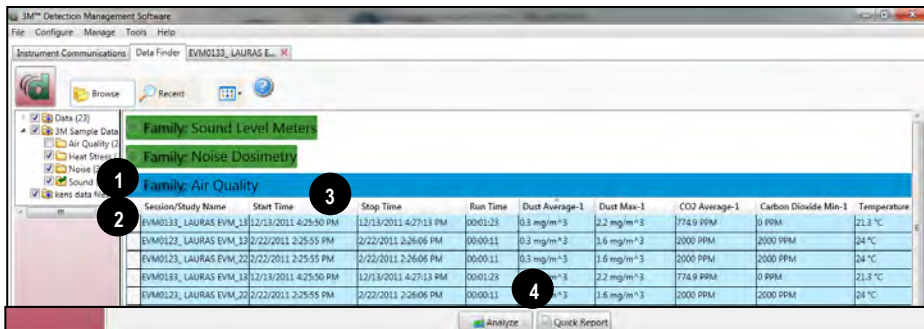



Figure 6-3: Data finder page

## EVM panel layout view (PLV) page

The measurements and parameters will be displayed in charts and graphs which may be customized for analysis and/or reporting purposes.

- **Note:** a  button provides a quick link to viewing the panel layout view data in a report format.
- 1. In the PLV page, it is divided into Work Items (see A), Add panel (see B), Arrange Panels (see C) and Data Panels (see D).
- **Work items (A)** – select either the session or study (in order to view appropriate measurement/parameter data).
- **Add panel (B)** – double-click on a chart/table type and it will appear as a panel on your screen.
- **Arrange panels (C)** – displays the order of the sessions/studies displayed in the panel section of your screen.
- **Data Panels (D)** – used to view your measurement and/or parameters from your study. Note: use the menu bar icons and/or configure icon to customize parameters.
- **Toolbar and Configure button (E)** –used to customize or select different measurement parameters.



 
 
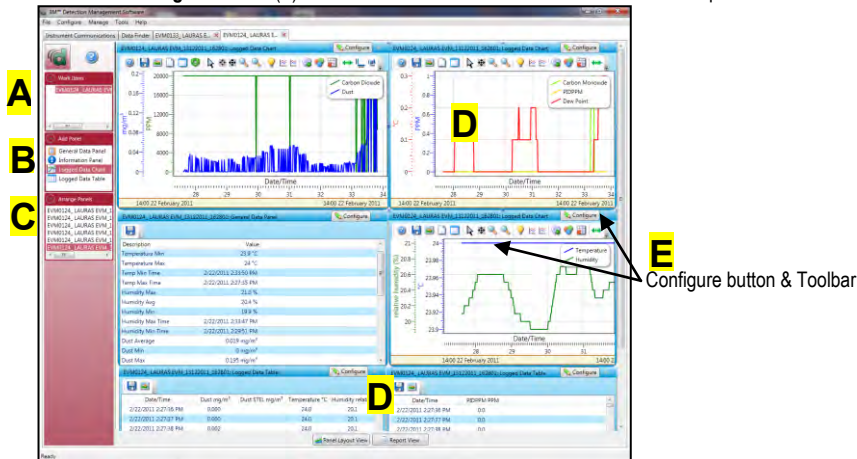




Figure 6-4: Charts and Graphs (panels)

2. To change the graph/table data parameters, click on the  button. Each graph/table may have different configurable parameters depending on the parameters applicable to the specific panel.
3. To view the data as a report, click the  button (see F). (Note: the panels will print in the order in which they are displayed in the panel layout page.)
4. The quick tips below explain how to customize the panels and/or graphs/tables:
  - **To stretch the graph/tables**, click on one the corner's edge of a chart or table and drag the mouse. The graph/table will expand or shrink when resizing.
  - **To move the graph**, click, drag and drop to the appropriate panel position.
  - **To change ranges**, when clicking on either the x-axis or y-axis, click and drag the mouse until the appropriate range is selected. (Note: it will span the numbers up or down depending on how you drag the mouse.)
  - **To save a layout**, Right-click outside the tables/graphs area as displayed below. Click Remember Setting. (See F).

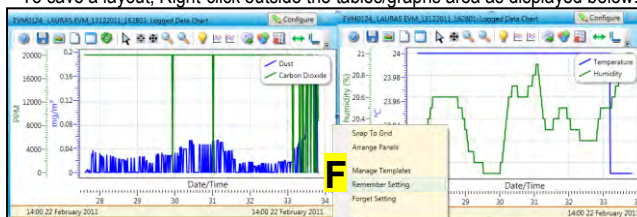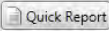

## EVM Reports and Printing

To quickly create reports, open your data (in the data finder page) and click the quick report  button. A standard template of charts and graphs (or panels) will appear in the report. Note: the charts/graphs will appear in the order displayed in the panel layout page.

- **Viewing reports:** if you are in the data layout page and you have rearranged the charts/tables, the report will print in the sequence in which they appear on the screen.
- **Printing reports:** while in the report view page you have two options outlined below:
  - Click on the  icon from the title bar.
  - Click on the  icon from the session report title bar.

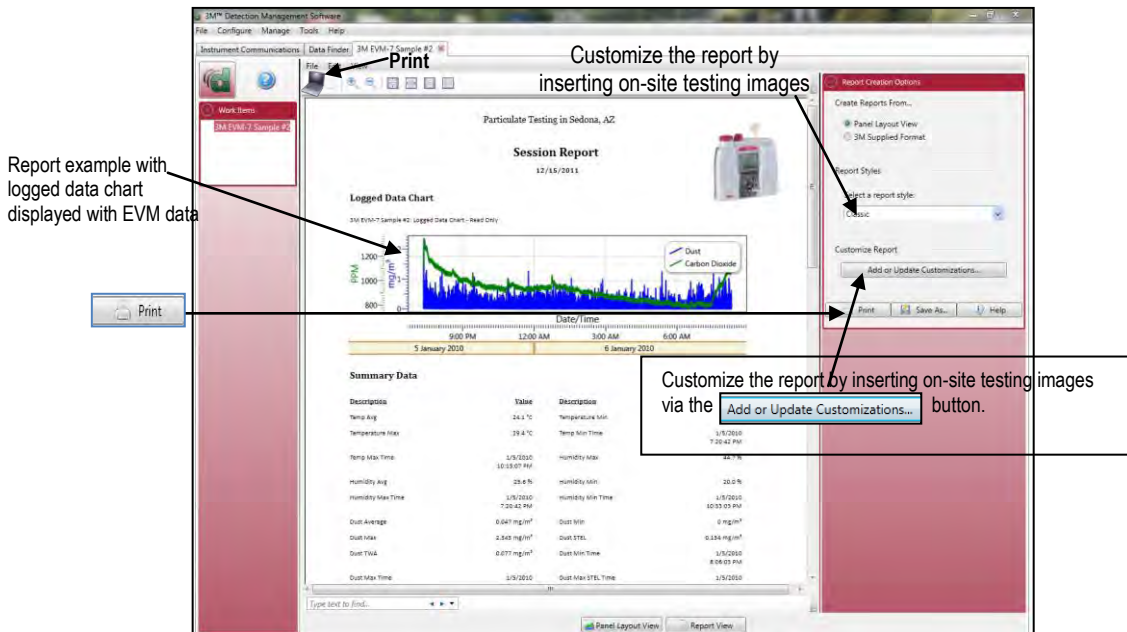
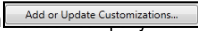
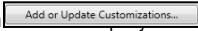


Figure 6-5: EVM data in a report format

## Customizing reports

To modify the reports with customized headers, footers, report titles, company logos (etc), the customize report feature may be used.

- From the report creation options box (see A), click on  button.
- There are four windows to modify (if applicable) which  ation, cover page, report, and headers/footers.
- The example below displays customizing the header and footer.

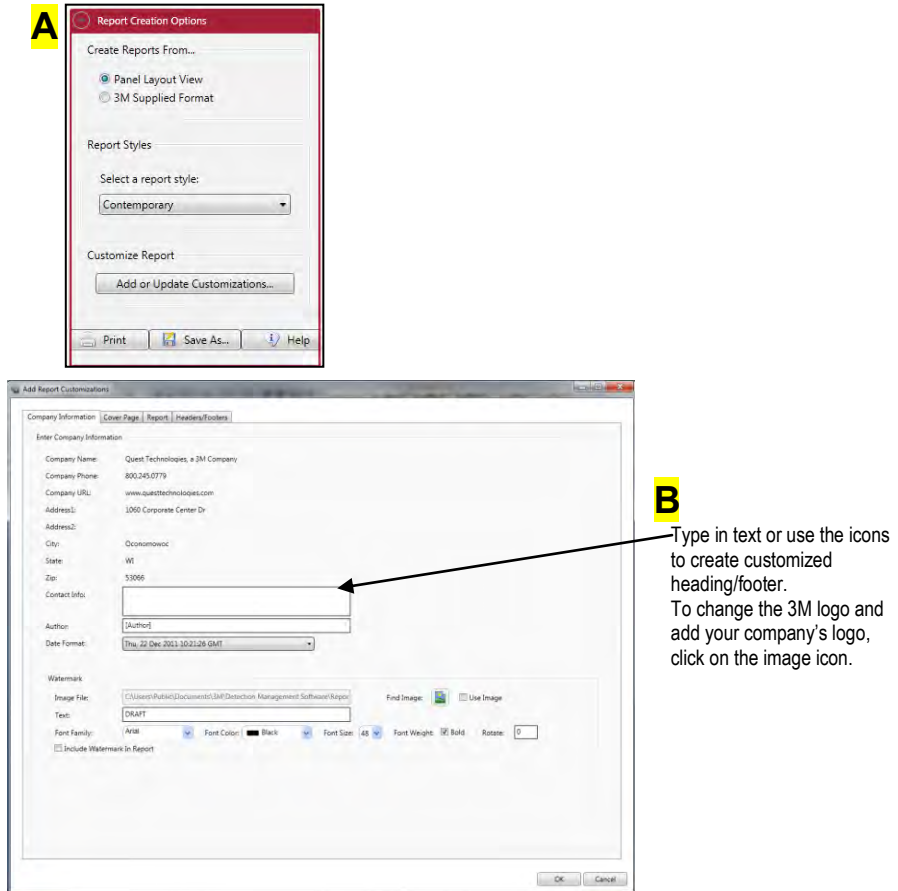


Figure 6-6: Customizing DMS reports









## EVM Setup

There are 7 configurable EVM setup screens (see 1 in Figure 1-54 below) in the setup page. With the EVM, you have the option to save the configurations either on the instrument and/or store the configurations in DMS. Note: if you save the profiles in the software, this can be used as a time management tool to organize and save all the setups for future use.

Please note that there are five different models with different features and functionalities. Some of the setup parameters may not be applicable to your model. Please refer to the user manual to understand the models in more detail.

### Saving and sending configurations

With the EVM, there are saved setup profiles used to quickly   . Below explains how to save configuration settings in DMS and how to send to the instrument. Note: if you wish to only send the setup, please skip to step 3. Please refer to this section as you setup your instrument.

- To save the EVM configuration in the software, click on a name in the **Configuration Profile Management** panel (See 1). (Note: The name will be shaded a light gray when selected.)
  - To create a new profile name, click  and type in a profile name. Click **Save**. (It will save under the configuration profile management panel).
- Click on the  button (see 2) and type in a **Name**. Click **Ok**.
  - Note:** This saves the configuration file to the NoisePro.
- To send to the instrument, click on the  (see 3).

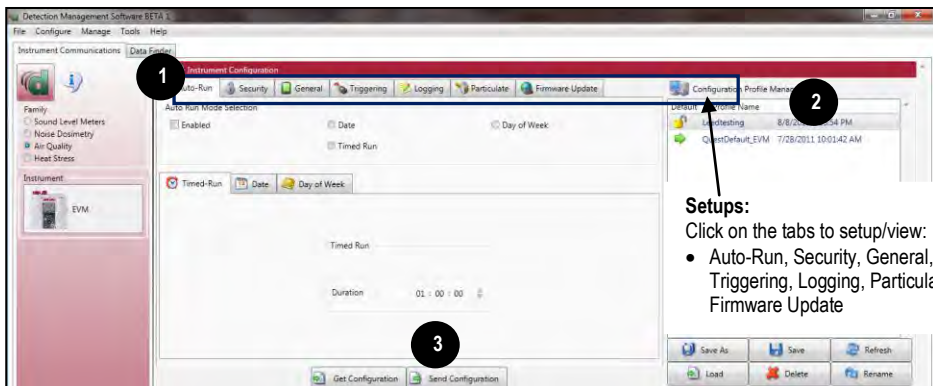





Figure 6-7: Saving and sending EVM setups

## General EVM setup

The EVM's general settings are used to setup the instrument with basic parameters. Please refer to the EVM parameters table below for details.

- Click on the **General** tab from the EVM's Instrument Communications panel (see 1). To change the general settings, follow one (or all) of the selection options below.
  - Click on the arrow  and select an option.
  - Click on the  arrows and select a numeric value or type in a value.

2. To set the general features, click on  or save (see 2) and Send Configuration (see 3) (for more details see "Saving and sending configurations").

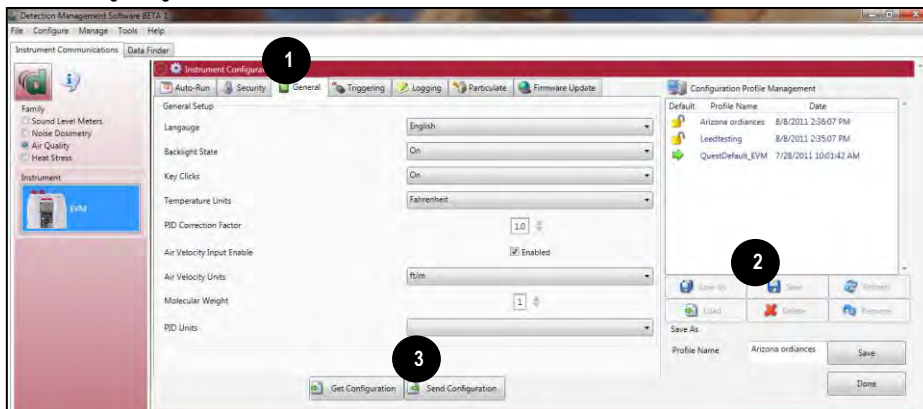


Figure 6-8: General EVM setups

## EVM general parameters table

General parameters and the EVM	Name Field *Note: refer to Glossary for more detailed information
Language	With the language setting, there are six options including: English, Spanish, German, French, Italian, and Portuguese.
Backlight State	The backlight is used to illuminate the screen from a dark gray to a light gray color.
Key Clicks	With the key click setting, you can turn the sound to "on" and each time you press a key on the keypad you will hear a soft click sound. This can be disabled by choosing the "off" setting.
Temperature Units	The temperature unit is selectable either in Celsius or Fahrenheit via a dropdown box.
PID Correction Factor	The PID correction factor is automatically set to 1.0. For best results, it is recommended to add a correction factor to the relevant VOC you intend to measure. Note: Appendix C of the EVM Series User Manual, provides a listing of PID correction factors.
Air Velocity Input Enable	Air Velocity measurements are conducted with an add-on air velocity probe and can be enabled/disabled in DMS. (Note: the instrument will automatically detect if the air velocity probe is connected.)
Air Velocity Units	Air velocity units (if enabled and an air probe is connected) is measured in either meters per second (m/s) or feet per minute (ft/m).
Molecular Weight	The default Molecular Weight is programmed to 56 with a correction factor of 1. To change this value either type in a new value or use the up/down arrows.
PID Units	The PID PPM or PPB sensor (for VOC measurements) setting is one of the four: PPM, mg/m <sup>3</sup> , PPB, or µg/m <sup>3</sup> .

## EVM and logging settings

The EVM logging screen is used to setup your data logging options. The EVM provides a choice of selectable logging parameters with a specific logging rate (also called logging intervals) and an averaging time. Please refer to the Logging table below for an explanation of features.




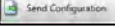
1. Click on the Logging tab (see 1) from the EVM's Instrument Communications panel. To change the logging settings, follow one (or all) of the selection options below.
  - Click in the  **Enabled checkbox** to log specific parameters which includes: Levels, STEL, Max, Min, and Avg. (See 2).
  - Click on the  arrows and select a numeric value or type in a value.
  - Select a Logging rate by clicking on the drop down arrow  and selecting an option from the logging rate list.

Figure 6-9: Logging EVM setups EVM and auto-run setting

2. To set the logging settings, click on  or save and send to the EVM (for more details see “**Saving and sending configurations**”).

### EVM logging parameters table

Logging parameters	Name Field
	*Note: refer to <b>Glossary</b> for more detailed information
Logging setup	<p>To enable logging, click in the specific checkbox to enable one or all of the following measurements:</p> <ul style="list-style-type: none"> <li>• <b>Level:</b> The instantaneous measurement at a specific point in time.</li> <li>• <b>STEL:</b> The maximum concentration above the time-weighted average that employees can be exposed to over a specific time period (usually 15 minutes) no more than four (4) times per day. (See PEL for more information.)</li> <li>• <b>Max:</b> The maximum measurement over the time interval (or logging interval).</li> <li>• <b>Min:</b> The minimum measurement over the time interval (or logging interval).</li> <li>• <b>Avg:</b> The measurement value over the time interval (or logging interval).</li> </ul>
Logging rate	Logging rate/interval (also called time history data) sets the frequency at which data will be logged during a session. The settings include: 1, 5, 15, 30 seconds and 1, 5, 10, 15, 30, and 60 minutes.
Averaging time	A type of data filtering which is applied to the Level measurement. The selectable parameters are 1-30 seconds.

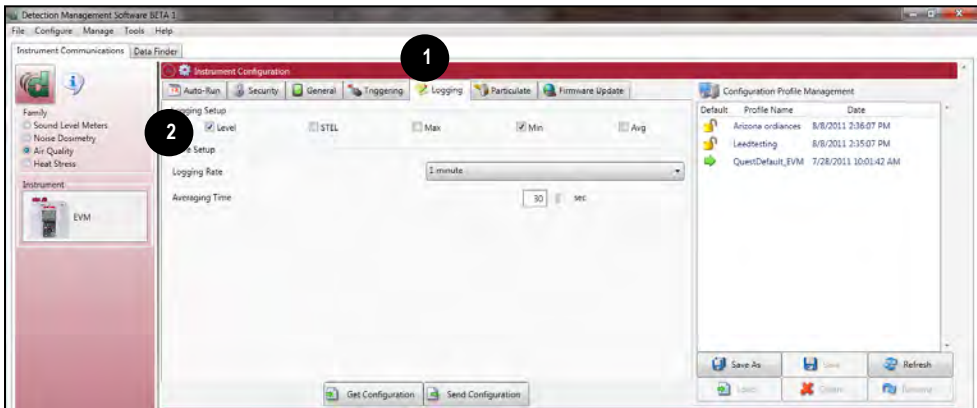


Figure 6-9: Logging EVM setups



## EVM and auto-run setting

The EVM has four programmable auto-run settings including a timed run, a date, a day of week (DOW), and a disabled mode.

The following Auto-Run settings are briefly explained below:

- **Timed-Run mode:** With Timed Run, the EVM is powered on and run is enabled. The EVM will automatically stop based on the programmed duration.
- **Date mode:** With the date mode, it will wake up the instrument from a powered down or on condition, runs the study, saves it, then powers down again. Up to four date settings are programmable with a specified date, time (in hours, minutes, seconds), and duration via the softkeys.
- **Days of week mode:** The days of the week (DOW) setting is a pre-programmed weekly auto-run with a specified day, start time, and duration with two auto on settings. The programmable settings include a day of the week, start time, and duration.

## Timed-Run and auto-run setting

To enable the Timed-Run mode, please follow below.

1. Click on the **Auto-Run** tab (see 1) from the EVM's Instrument Communications panel.
2. Click in the ☒ **Enabled checkbox** and click in the ☒ **Timed-Run** field.
3. Ensure **Timed-Run** tab is selected (see 2) below and select the **Duration** by either using the  arrows or type in a duration value.
4. To set the auto-run, click on or save and send to the EVM (for more details see "**Saving and sending configurations**").

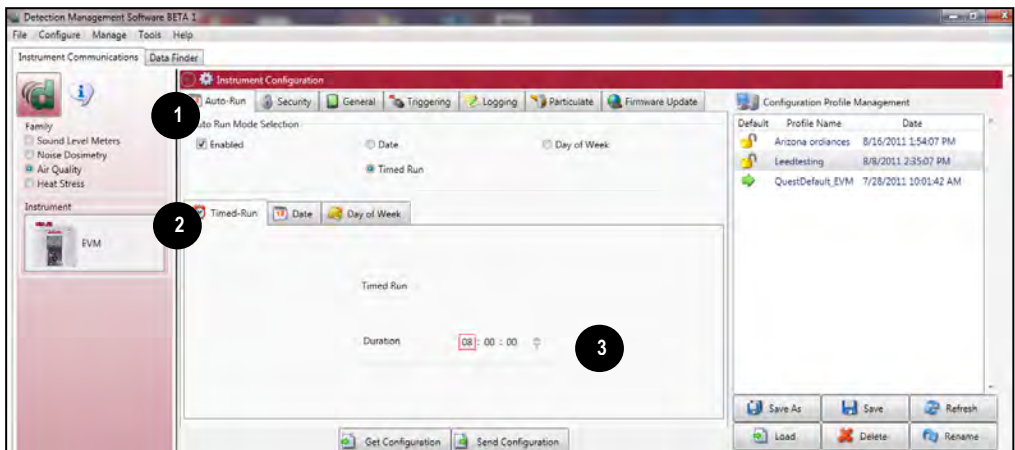



Figure 6-10: EVM Timed-Run Auto-Run setting

## Date and auto-run setting

To enable Date mode, please follow below.

1. Click on the **Auto-Run** tab (see 1) from the EVM's Instrument Communications panel.
2. Click in the ☒ **Enabled checkbox** and click in the ☒ **Date** field (See 2).
3. To enable (or activate) a Date setting, click on the Enabled ☒ for **Date 1** (See 3).
  - To set the start date, either use the  icon or type in a date value.
  - To set the start time and duration, either use the  arrows or type in a numeric values.

Figure 6-9: Logging EVM setups EVM and auto-run setting

- To enable additional date settings (Date 2 – Date 4), repeat step 3.
- To set the auto-run, click on  or save and send to the EVM (for more details see **“Saving and sending configurations”**).

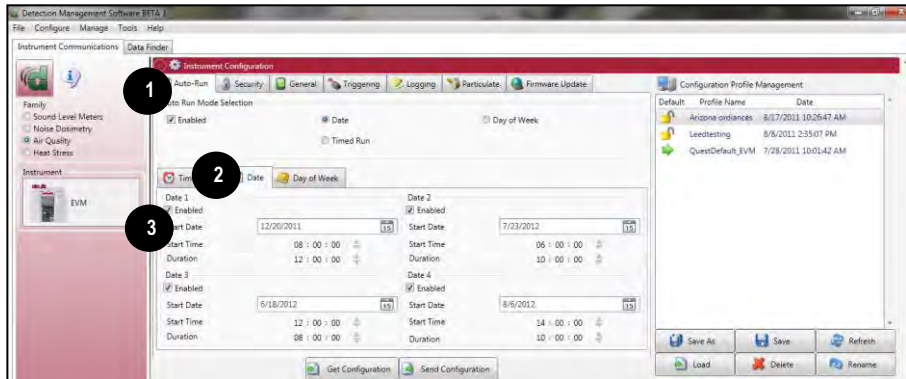
 




Figure 6-11: EVM Auto-Run with Date setting

## Day of week and auto-run setting

To enable Date mode, please follow below.

- Click on the **Auto-Run** tab (see 1) from the EVM's Instrument Communications panel.
- Click in the ☒ **Enabled** checkbox and click in the  **Day of Week** field (see 2).
- To select a day or days click in the appropriate day ☒ boxes.
- To set the **Start Time** and **Duration**, either click on the  or type in numeric value (see 3).
- To enable Day of Week 2, repeat steps 3 -4.
- To set the auto-run, click on  or save and send to the EVM (for more details see **“Saving and sending configurations”**).

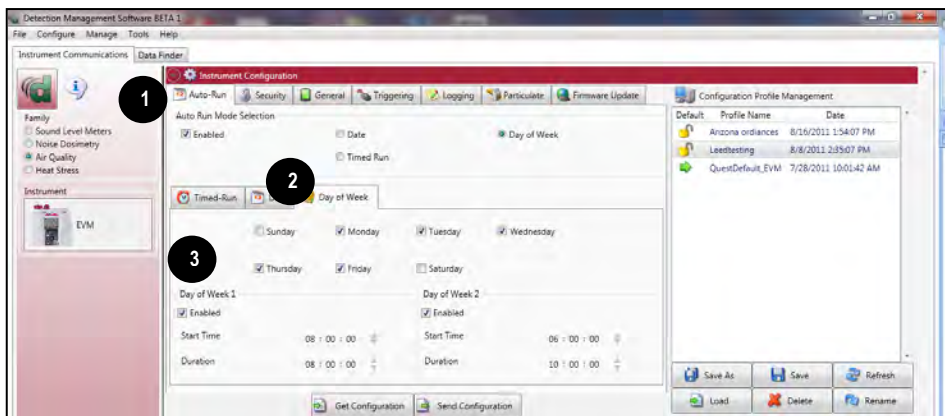



Figure 6-12: EVM Auto-Run with Day of Week setting



## EVM and security settings

The security or lock feature is used to prevent a user from interrupting a run and/or prevents someone from changing a setup or saved setups on the instrument.

**NOTE:** a default code, "9157", will disable secure run or secure setup if the numeric Passcode is forgotten.

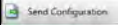1. Click on the **Security** tab (see 1) from the EVM's Instrument Communications panel.
2. To set the Secure Setup Mode or Secure Run Mode, please follow below:
  - Click in the Enabled ☒ box to turn on secure run setup mode and/or secure run mode.
3. Type in a passcode (4 numeric characters).
4. To set the auto-run, click on  or save and send to the EVM (for more details see "**Saving and sending configurations**").

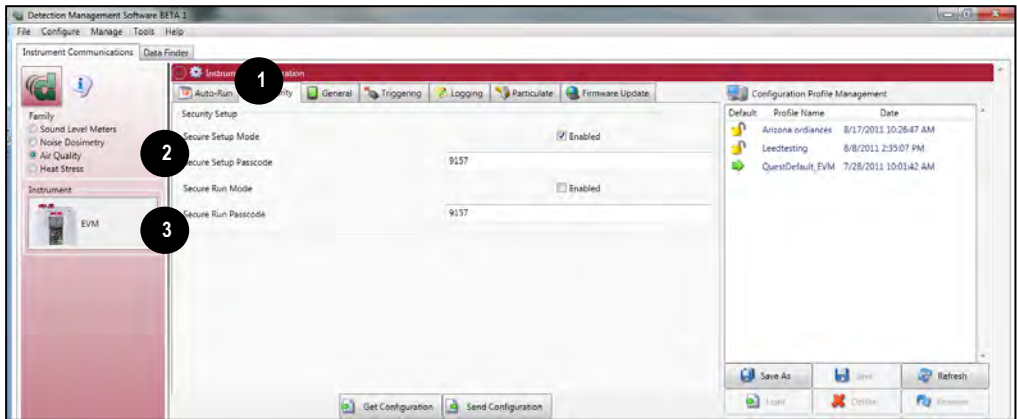





Figure 6-13: EVM Auto-Run with Day of Week setting



## EVM and triggering settings

There are two types of triggering outputs which may be programmed to with one of the seven sensors. Note: please refer to the EVM triggering table identifies the components of this setup screen.

- **Digital output** : the user can connect an external device to the monitor. This can be used to signal a specific level to turn on a notification device, an LED, or a fan motor at a specific threshold (or set point). Once enabled, the following three are selectable parameters: a sensor, logic setting, and threshold setting.
  - **Analog output**: Enables the analog output on the device when checked. The analog output will vary between 0-5 volts based upon the minimum and maximum levels for the particular sensor.
1. Click on the **Triggering** tab (see 1) from the EVM's Instrument Communications panel.
  2. To set the Triggering for Digital Output or Analog Output, please follow below:
    - Click in the Enabled ☒ box to turn on Trigger digital/analog output.
    - For the Logic level, click the  arrow to select a level (for digital output only).
    - For the parameter, select one of the sensors (note: for air velocity, verify the sensor is attached to the EVM and selected in the General panel of DMS.)
    - For the threshold, type in a value for the selected parameter or use the  to select.

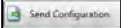4. To set the triggering setup, click on  or save and send to the EVM (for more details see “**Saving and sending configurations**”).







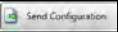
Figure 6-14: EVM Triggering setup

Triggering parameters	Explanation
Digital Output	Enables the digital output on the device when checked per the mode, parameter, and threshold settings. NOTE: only one of these parameters (Digital Output, Analog Output, or Air Velocity) can be enabled at one time.
Analog Output	Enables the analog output on the device when checked. The analog output will vary between 0-5 volts based upon the minimum and maximum levels for the particular sensor.
Logic level (Also called “Mode” on the EVM)	The type of signal that will be triggered when the parameter and threshold are satisfied. It may either be active high, active low, active high pulse, or active low pulse. (Reference Table 3-3 for detailed information.)
Parameters	The sensor that is to trigger the digital/analog output.
Threshold	The threshold at which the sensor will be triggered for the given parameter.
Air velocity input	Enables the Air Velocity Input when checked. NOTE: This is mutually exclusive with the digital out meaning that only one or the other can be enabled at any given time.
Units	Sets the units in which the wind speed will be measured, either meters per second or feet per minute.

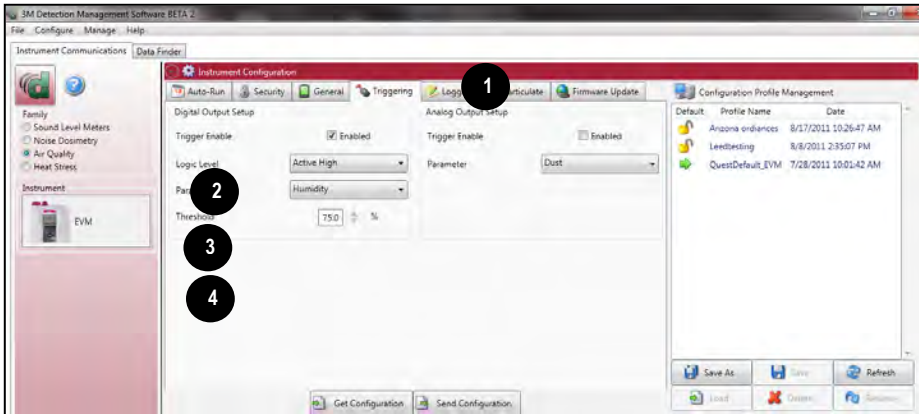

## EVM and particulate settings

The particulate settings may be programmed with up to 8 correction factor profiles. It also provides the capability to view the mass and volume of the gravimetric accumulator and gravimetric volume if get configuration is selected. To update, please follow below.

1. Click on the **Particulate** tab (see 1) from the EVM's Instrument Communications panel.
2. To customize particulate profile names, double-click on the Name of the particulates (see 2).
  - The edit profile screen will appear (see 3). Type in a name and type in the appropriate correction factor or use the  key to set the numeric value. Repeat this step as necessary to setup 8 correction factor profiles.
3. The active profile field (see 4) may be set to a customized profile name with a designated correction factor (see step two for details). To set an active profile, click on the  arrow and select one of the profile names. (Not applicable if step 2 was skipped.)
4. To set the Units, select the  arrow and select a unit of measurement.
5. To set the particulates setup, click on  or save and send to the EVM (for more details see **"Saving and sending configurations"**).

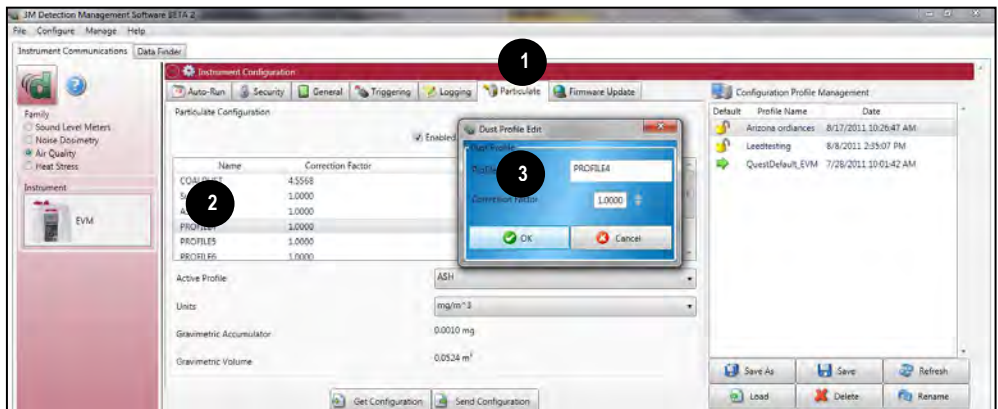


Figure 6-15: EVM Auto-Run with Day of Week

## EVM and Particulates setup


Particulates setup screen	Explanation
Particulates checkbox	Enables the particulates/dust sensor when checked.
Profile names	Names associated with a given correction factor managed within the EVM device. To edit a given profile name or user correction factor associated with a profile name, double click the profile name (i.e. PROFILE1) of the desired profile.
Active profile	The profile that is currently being used for dust measurements by the device.
Units	Particulate sampling is measured with either mg/m <sup>3</sup> or ug/m <sup>3</sup> . This is selectable via the drop down menu. Particulates setting is either in mg/m <sup>3</sup> (milligrams per cubic meter) or ug/m <sup>3</sup> (micrograms per cubic meter).
Gravimetric accumulator	The amount of dust, in milligrams, that has been accumulated by the dust sensor since the last time it has been reset.
Gravimetric volume	The volume of air that has passed through the gravimetric filter since the last time it has been reset.

Get setup from instrument button	Retrieves the setup configuration from the device for the General, Input / Output, and Dust Configuration tabs.
Send setup to instrument button	Sends the setup configuration from the General, Input / Output, and Dust Configuration tabs to the device.
Saved setups window	From this window you can save or load a default or custom configuration profile that has been or will be archived for quick access.



## EVM Firmware update

The firmware update screen is used to update the latest software to EVM Series. With a firmware update, the Web Server option enables you to update through an internet connection. If you do not have internet capability, the File option is used in place of the first option. Note: contact Quest Technologies, a 3M company, for details on obtaining a CD for updates ([www.questtechnologies.com](http://www.questtechnologies.com)). Please follow below to update your instrument.

1. Ensure the EVM Series is communicating. (See "EVM Communication setup" above for details.)
2. Click on the **Firmware Update** tab and either select **Web Server** or **File**.
3. Click on the  button to send to the instrument.

# Maintenance & cleaning

## Overview

The maintenance and cleaning chapter discusses how to care for the following items:

- Care and cleaning with the PID sensor
- Optical Engine: maintenance and cleaning
- Impactor care
- Gravimetric cassette and filter paper

## PID sensor

The following section explains basic installation, maintenance of the PID sensor, and cleaning the lamp.




The Photoionization detection (PID sensor) is used to measure airborne pollutants. As it is measuring and detecting for Volatile Organic Compounds (VOCs), the gases freely diffuse in and out of the sensor chamber which is formed by the filter, housing walls, and a UV lamp opening (window). It is important to keep the UV lamp clean and the electrode pellet (lid placed over the lamp housing) clean.

☑ **NOTE regarding PID and performance:** with the PID sensor and humidity sensitivity, this uses the **fence electrode technology** to minimize humidity.

## Removing and installing PID sensor

If you ordered a PID sensor with your instrument, it will be shipped with an installed PID sensor that was factory calibrated. The following procedures explain how to remove and install the PID sensor.

1. Verify the EVM is powered off and the external power supply is unplugged.
2. Remove the sensor bar by unscrewing the two screws. Next, gently remove the sensor bar, by titling the front and lifting up. (The rubber gasket may stick a little as you lift the sensor bar off.) Place the sensor bar to the side.
3. A black bar (called the manifold) will be placed over the sensors. Remove this by pulling it out of the housing and set aside.
4. Placing your fingers on the middle sensor (PID sensor), gently tilt the front of sensor up as you pull the sensor out with your thumb and index finger. Place to the side.

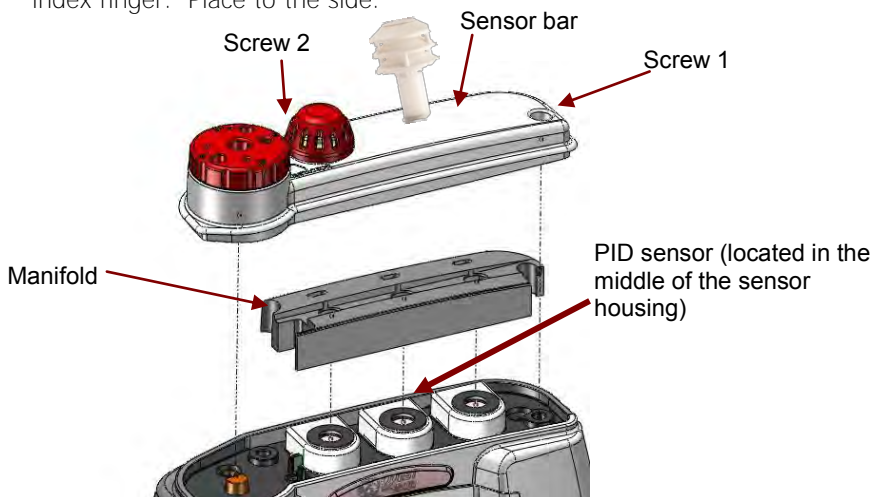

**Figure 7-1: Removing and inserting PID sensor**

5. To insert the PID sensor, line the pins up to the circuit board and lower it vertically down and gently push it into the sensor cavity. It will fit snug.
6. To reassemble, place the manifold over the sensor housing and then place the sensor bar on top of the manifold and sensor housing. Tighten down the two screws. (Then, please see the Calibration section to perform a calibration with the newly installed sensor on page 71).

## Maintenance and cleaning overview of PID

Periodic maintenance is encouraged to ensure accurate VOC measurements. Typically, in a clean air environment where VOCs are low with few particulates, cleaning and calibrating is recommended on a monthly basis or even less frequent. Conversely, if you are in an environment with high concentrations of VOCs with aerosols and high particulates, you will want to check the calibration frequently and clean the components. When the PID loses sensitivity, you will want to change the electrode pellet. NOTE: due to the increased sensitivity of the PID ppb sensor, it is recommended to replace this pellet more often. (See Appendix A Accessories and adapters for details.)

The following are **three recommended maintenance/cleaning benchmarks**, recommended by Ion Science.

1. After performing a zero calibration, the baseline climbs. (You should replace the electrode pellet).
2. Under highly humid conditions, replacement of the electrode is needed.
3. If the baseline is unstable or shifts when you move the PID, then cleaning is needed.


## Cleaning PID sensor

Cleaning of the PID sensor requires removing the plastic, intelligent sensor casing, removing the electrode pellet, and removing the lamp. Once removed, the lamp is cleaned off with the cleaning kit solution. The following procedures explain how to clean the PID sensor components.

### ➤ **Removing and Cleaning the sensor**

1. Remove the PID sensor (follow steps outlined in, "Removing and installing sensors.")


2. Using a flat-headed screwdriver, gently pry open the plastic, intelligent sensor casing where the small rectangle crevice is on the backside of the housing. Using some force, lift the top off (the bottom section is glued in.)

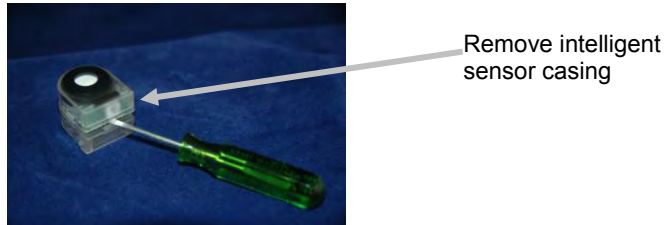

**Figure 7-2: Removing intelligent-sensor casing with PID**


3. Using the pellet removal **tool** (displayed below), insert into the side crevices and place your thumb over the black pellet.

☑ **NOTE:** *once you squeeze the pellet removal tool, the lid will pop off with the lamp. In order to prevent it from popping out, it is important to place your thumb over the black pellet first.*

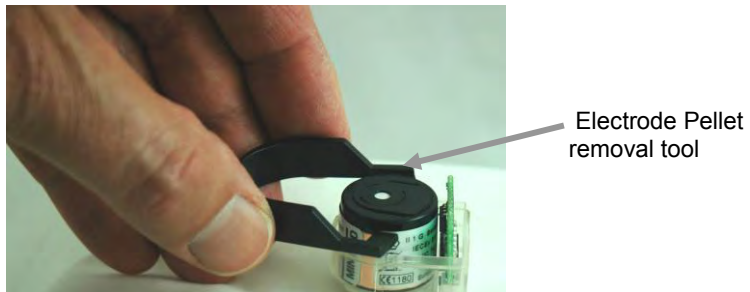

**Figure 7-3: Removing the lamp with removal tool**

4. Set the electrode pellet and lamp to the side. (**Note:** you may want to use paper towel, or a cloth without fibers, when handling these pieces to prevent oils from your hands transferring to the lamp or pellet.)

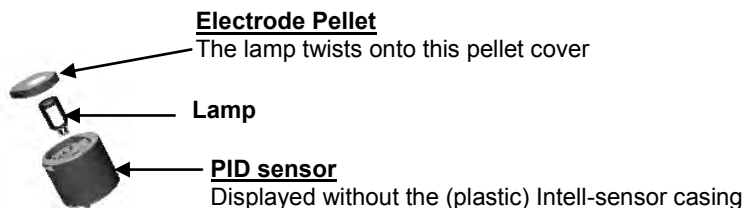

**Figure 7-4: Remove/insert PID sensor with lamp & pellet**

5. Using the PID cleaning kit, open the alumina oxide polishing compound and insert a Q-tip.
  - In a circular motion, polish the lamp until an audible squeaking sound is heard (about 15 seconds). Do not touch the lamp window with your fingers. Remove any residuals of the compound with a Q-tip.



**CAUTION:** the cleaning compound, alumina oxide, should not be inhaled and can be an irritant to your eyes. Be cautious when handling the powder compound.



**Figure 7-5: PID sensor cleaning kit**

6. To refit the lamp and electrode pellet properly, it is recommended to twist the lamp into the o-ring of the electrode pellet (twist clockwise one full turn) ensuring you use a cloth (with no fibers).

7. Then, lower into the PID sensor as displayed below.



Electrode Pellet and lamp attached

**Figure 7-6: Fitting/Inserting the lamp and pellet**

8. Place the plastic Intel-sensor casing over the sensor. Press firmly to snap it into place.
9. Insert it back into the sensor housing **as explained in "Removing and inserting PID sensor"**.
10. After cleaning, you need to perform a zero and span calibration (see PID calibration on page 49.)

## **Optical Engine: maintenance and cleaning**

The optical engine should be cleaned when the following conditions occur:

- It will not zero
- Exposed to oily or wet mists.
- Readings are falling lower and lower indicating dirty mirror

To clean the optical engine, this requires the use of a 1/16<sup>th</sup> Allen wrench and a Q-tip.

► **Maintenance and cleaning of the optical engine**

1. Remove the two screws on the optical engine using a **Phillip's** screwdriver.
2. You have two options when removing the screws:
  - Your first option is to loosen the two screws and turn the D-Ring so the flat angle is facing the circular metal plate.
  - Your second option is to remove the two screws and D-ring and set these aside.




**Figure 7-7: Optical engine and cleaning**

3. Next, lift the spherical mirror up and off by using a flat-headed screwdriver. Using a clean Q-tip, **gently** wipe the spherical mirror in a circular motion. Set aside.
4. Using a clean Q-tip, **gently** wipe around the outer cavity of the optical engine.
5. For the photodiode (positioned on the bottom of the optical engine), **gently** wipe around the bottom of the optical engine using a clean Q-tip/cotton ball.



Mirror from optical engine

Photodiode

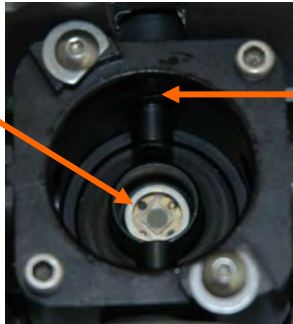

Outer cavity of optical engine

**Figure 7-8: Cleaning the optical engine**


6. Place the spherical mirror back over the optical engine. Gently push it into the cavity of the optical engine.
- ☑ **NOTE:** *if you loosened the d-ring and screws, ensure the flat side of the d-ring is facing the metal ring as you place it back into place. If you removed the screws and the d-ring, this will not apply.*
7. Tighten down the two screws and d-rings with the **Phillip's** screwdriver.

## Impactor care

The impactor will require periodic greasing and cleaning which is dependent on the density of air particulates floating in the intended measurement environment.

☑ **NOTE: The impactor must be greased before your first measurement.**


➤ **Greasing and cleaning impactors explained below:**

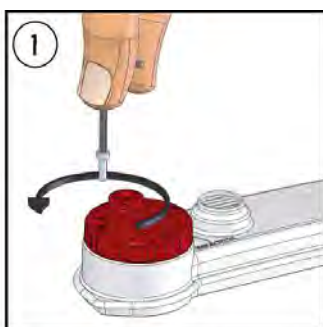


1 REMOVE TWO OUTER SCREWS. DO NOT REMOVE CENTER SCREW




2 REMOVE TURRET TOP

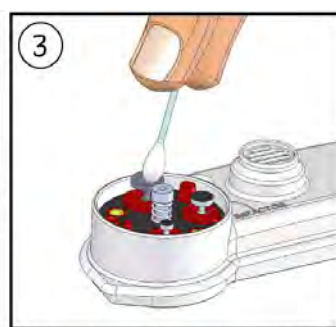


3 USE A SWAB OR PAPER TOWEL TO CLEAN DUST FROM THREE IMPACTORS

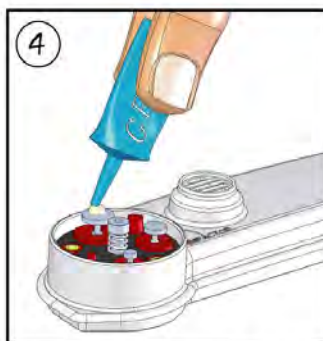

4 APPLY A SMALL AMOUNT OF GREASE TO TOPS OF THREE IMPACTORS

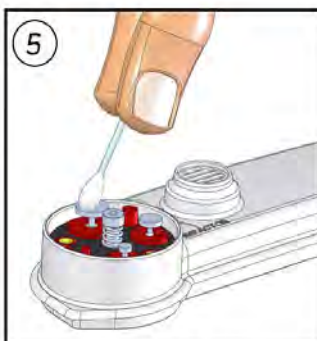

5 USE SWAB OR FINGER TO SPREAD GREASE INTO VERY THIN LAYER

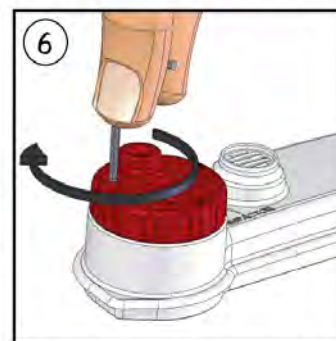


6 REPLACE TURRET TOP AND SECURE WITH SCREWS. IMPACTORS ARE NOW READY FOR DUST SAMPLING

## Impactors and when to clean

When the dust accumulates on top of impactor plate in a pyramid form (as displayed in the Figure below), this signifies the impactor plate requires cleaning.

For example, in a dense, dusty manufacturing plant, this may require greasing and cleaning after each measurement or every 10 hours of measuring.

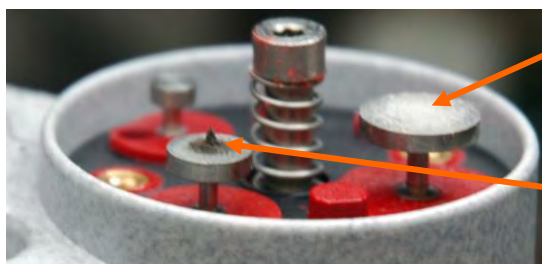

Apply a **very thin-film of silicone** grease before calibrating and measuring (on the appropriate impactor setting.)

When dust accumulates in a pyramid form on top of the impactor, this indicates cleaning is required.

**Figure 7-9: When to clean impactors**

## Gravimetric cassette and filter paper

A filter paper in the gravimetric cassette (also referred to as “gravimetric pump protection filter”) is user-replaceable and is included in your kit. It is suggested to replace the filter paper when the flow rate is not maintained. The instrument will display a warning message when it needs replacing.

### ➤ Replacing the filter paper in the gravimetric cassette

1. Remove the cassette by opening the back door and gently remove the cassette from the housing.
2. Open the gravimetric cassette by twisting the two pieces apart.
3. Remove the filter paper and replace it with a new paper.
4. Put the cassette back together and insert it back into the housing.

☑ **NOTE:** *when installing the cassette, make sure the side labeled inlet is attached to optical engine. Also the filter paper should be on the bottom of the cassette.*

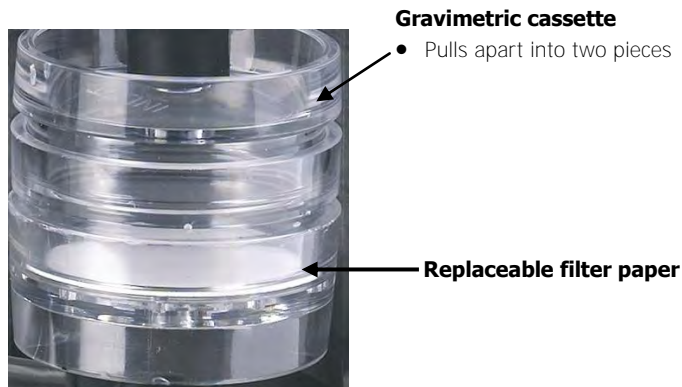


Figure 7-10: Gravimetric cassette and filter paper maintenance

# Specifications

## Particulate Sensor

Method	Display Range	Display Resolution	Accuracy/ Repeatability
Photometer	0.000- 200.0 mg /m <sup>3</sup> (Non-condensing)  0 to 20,000 ug/m <sup>3</sup>	0.001  1	+/-15% (Calibrated to Arizona road dust; ISO 12103-1, A2 Fine Test Dust)
Particulates	0.1 – 10 µm	N/A	*See note below

Particulate Sensor - General	
<b>Size</b>	0.1 µm to 10 µm* (*Note: the photometer can detect particles up to 100 µm; however, accuracy is reduced for sizes greater than 10 µm. It may not be as accurate.)
<b>Impactor- mechanical</b>	Top-mounted, rotary impactor particulate filter
<b>Impactor settings</b>	PM2.5, PM4, PM10 or PM at 1.67 Liter/minute flow rate
<b>Measures</b>	Real-time aerosol/dust concentration using a 90° optical light scattering photometer to report total mass concentration (mg/m <sup>3</sup> or ug/m <sup>3</sup> ) of particulate matter
<b>Gravimetric sampling</b>	<ul style="list-style-type: none"> <li>Flow: ± 5%, after calibration</li> <li>Back-pressure @ gravimetric cassette               <ul style="list-style-type: none"> <li>≥ 5 kPa</li> <li>≥ 20 inches of water @ 1.67 lpm</li> </ul> </li> </ul>
<b>Dust correction factors</b>	Up to 8 User-defined particulate correction factors. To correct for variation from "Arizona Road Dust".
<b>Life expectancy/Warranty</b>	5,000 hours (for the laser photo-meter)/1 year warranty

## Volatile Organic Compounds (VOCs) Gas Detector (PID Sensor)

Method & Detector	Display Range	Display Resolution	Accuracy/ Repeatability
<b>Low sensitivity PID</b>	0.00 to 2,000 ppm; (Non- condensing)	0.01 ppm	+/-5% / 2%; (relative Isobutylene) at cal value
<b>High sensitivity PID</b> • 10.6 electron-Volt Photo-Ionization Detector	0 – 50,000 ppb*; (Non-condensing) *0 – 20,000 ppb; hardware rev 3 & earlier (optional: upgradeable)	1 ppb	+/-5% / 2%; (relative Isobutylene) at cal value
<b>Life expectancy/Warranty</b> 2,000 hours in clean air environment (replaceable bulb and grid)/ 1 year warranty			

## Carbon Dioxide Sensor

Method & Detector	Display Range	Display Resolution	Accuracy/ Repeatability
<b>CO<sub>2</sub> sensor</b> • <b>NDIR</b> (non-dispersive infrared)	0 to 20,000 ppm; auto-ranging (Non- condensing)	1 ppm	+/-50 ppm between 0 – 2,500; repeatability is +/-2%
<b>Temperature Influence</b> additional +/-0.2%			
<b>Settling time</b> 90% of change in <90 seconds			
<b>Life expectancy/Warranty</b> 5 years/ 1 year warranty			

## Relative Humidity Sensor

Method & Detector	Display Range	Display Resolution	Accuracy/ Repeatability
<b>RH sensor</b> • <b>Capacitive</b>	0.0 to 100%	0.1	+/- <b>5%</b> RH signal between 10 – 90%
<b>Temperature Influence</b> 0.1%			
<b>Settling time</b> 90% of change in 15 seconds			
<b>Life expectancy/Warranty</b> 2 years/ 1 year warranty			

## Temperature Sensor

Method & Detector	Display Range	Display Resolution	Accuracy/ Repeatability
<b>Temp sensor</b> • <b>Junction Diode</b>	<ul style="list-style-type: none"> <li>0.0 °C to 60.0 °C</li> <li>14.0° F to 140.0° F</li> </ul>	0.1  0.1	+/- 1.1 °C (+/- 2 °F)  +/- 2°F
<b>Life expectancy/Warranty</b> 2 years/ 1 year warranty			

## Toxic Gas Sensors

Gas Type	Display Range	Display Resolution	Accuracy/ Repeatability	Life expectancy/ warranty
Carbon Monoxide (CO)	0 - 1000 ppm	1 ppm	5%/ 2% of signal	2 years/ 2 years
Chlorine (Cl <sub>2</sub> )	0.0 - 20 ppm	0.1 ppm	5%/ 2% of signal	2 years/1 year
Ethylene Oxide (EtO)	0.0 - 20 ppm	0.1 ppm	5%/ 2% of signal	2 years/1 year
Hydrogen Cyanide (HCN)	0 - 50 ppm	0.1 ppm	5%/ 2% of signal	2 years/1 year
Hydrogen Sulfide (H <sub>2</sub> S)	0 - 500 ppm	1 ppm	5%/ 2% of signal	2 years/1 year
Nitrogen Dioxide (NO <sub>2</sub> )	0.0 - 50 ppm	0.1 ppm	5%/ 2% of signal	2 years/1 year
Nitric Oxide (NO)	0y	0.1 ppm	5%/ 2% of signal	2 years/1 year
Oxygen (O <sub>2</sub> )	0.0 - 30 %	0.1 %	5%/ 2% of signal	2 years/ 2 years
Ozone (O <sub>3</sub> )	0 – 1.0 ppm	0.01 ppm	5%/ 2% of signal	18 months/12 months (sensitivity drift 10% over 6 years)
Sulphur Dioxide (SO <sub>2</sub> )	0.0 – 50 ppm	0.1 ppm	5%/ 2% of signal	2 years/1 year

## Air Velocity Accessory (Optional – AirProbe 10)

Method & Detector	Display Range	Display Resolution	Accuracy/ Repeatability
<b>Omni-directional heated thermistor windprobe</b>	0.0 – 20.0 m/s	0.1	+/- (0.12 m/s + 4.5 %) *
	0 - 3940.0 ft/min	1	+/- (23.6 ft/min + 4.5 %) *
*of measurement value			

<b>Battery life</b>	6 - 8 hours for fully charged NiMH battery
<b>Charge time</b>	9 hours
<b>Life expectancy/Warranty</b>	1 year/ 5 years

## Displayed Data

<b>Measurements</b>	Level, Minimum, Maximum, Average, Short-Term Exposure Level (STEL), Time Weighted Average (TWA)
<b>Real-time measurements</b>	Once per second display update rate
<b>Time history data logging intervals</b>	1, 5, 15, 30 seconds, 1, 5, 10, 15, 30 and 60 minutes
<b>Trend graphing intervals for all parameters</b>	1.5, 3, 15 minutes, 1.5, 3, 8, 12 and 24 hours
<b>Status indicators</b>	Battery, Run, Pause, Stop, Overload and UnderRange

## Electrical characteristics

<b>Battery life</b>	Approximately <b>8+</b> hours of continuous operation at normal operation under reference to environmental conditions when full capacity batteries are installed.
<b>Battery pack</b>	Rechargeable Lithium-Ion
<b>External DC power input</b>	10 to 16 Volt Power Inlet (Nominal 12VDC) 1.5A
<b>Power adapter</b>	Universal AC adapter 100 to 240 VAC; 50-60 Hz
<b>Memory capacity</b>	2MB – over 24 hours at 15 second logging interval

### Environmental effects

The typical time interval needed to stabilize after changes in environmental conditions is 5 minutes for each 10° C change.

<b>Operating Conditions</b>	<b>Temperature:</b> 0 °C to + 50 °C (32 °F to 122 °F)
	<b>Pressure Range:</b> 65 KPa to 108 kPa
	<b>Relative Humidity Range:</b> 10% to 90%, Non-Condensing
<b>Storage Conditions</b>	<b>Temperature:</b> -20 °C to + 60 °C (-4 °F to + 140 °F)
	<b>Relative Humidity Range:</b> 0 to 95%, Non-Condensing
	<b>Battery:</b> Insure battery is re-charged every 6 months during long-term storage.

### Physical characteristics

<b>Size and weight</b>	19 cm x 19 cm x 7 cm (7.5" x 7.5" x 2.75")
<b>Weight</b>	1.3 Kg (2.9 lb)
<b>Housing</b>	Static dissipative ABS-Polycarbonate
<b>Display size</b>	<i>128 x 64 pixel display that measures 6 cm x 4.8 cm (2.4" x 1.9")</i>
<b>Backlighting</b>	Manual setting
<b>Keys</b>	Five keys have dedicated control functions, another five are primarily used for selection and navigation, and another four provide variable functions when they are defined in the display (softkeys). Audible (beep) feedback

## Measurements units

<b>Particulates</b>	mg/m <sup>3</sup>
<b>Carbon Dioxide</b>	ppm
<b>Relative Humidity</b>	%
<b>Temperature</b>	°C or °F
<b>Toxic Gas</b>	ppm (Option) (Using one of Quest's toxic sensors indicated in "Toxic Sensors")
<b>VOC's</b>	ppm or ppb (Options) (Using PID – 10.6eV Photo Ionization Detector)
<b>Air Velocity</b>	m/s or m/ft (Options) (Using external air probe accessory)

## Operating Modes

<b>Live-view screen</b>	Pause/Stop modes and Time History Review screen Pause/Stop modes
<b>Logging screen</b>	Run mode and Time History Review screen Run mode
<b>Settings</b>	Stop mode
<b>Calibration</b>	Stop mode
<b>Power/Charging</b>	Off mode
<b>Charging</b>	Charging status screen

## Time Constants

1 second display update rate with 1 to 30 seconds time constants. (Specifications made at 15 seconds time constant.)

## Special functions

<b>Auto-Run</b>	Programmable via the EVM setup screen or in QSP-II
<b>Security</b>	Securing or locking run mode and/or setup via the EVM setup screen or in QSP-II
<b>Software</b>	User friendly compatible QuestSuite <sup>®</sup> Professional II software available for advanced analysis with charts and graphs and reporting options
<b>Sensors</b>	Auto-detectable when inserted at powered-off mode and then powered on
<b>Languages include</b>	English, Spanish, German, French, Italian, and Portuguese
<b>Certified</b>	CE Mark and RoHS compliance
<b>Patents</b>	Pending

## Estimated logged run times

Standard EVM-7 (Memory and logged time)					
(Logging the following Sensors: Dust, Temp, Humidity, CO2, Toxic, PID, Dew Pt)					
Run Time (Hours)					
Logging Rate	Number of Measurements Logged				
	1	2	3	4	5
<b>1 seconds</b>	31.0	15.5	10.3	7.7	6.2
<b>5 seconds</b>	154.9	77.5	51.6	38.7	31.0
<b>15 seconds</b>	464.8	232.4	154.9	116.2	93.0
<b>30 seconds</b>	929.6	464.8	309.9	232.4	185.9
<b>1 minute</b>	1859.2	929.6	619.7	464.8	371.8
<b>5 minutes</b>	9296.1	4648.0	3098.7	2324.0	1859.2
<b>10 minutes</b>	18592.1	9296.1	6197.4	4648.0	3718.4
<b>15 minutes</b>	27888.2	13944.1	9296.1	6972.1	5577.6
<b>30 minutes</b>	55776.4	27888.2	18592.1	13944.1	11155.3
<b>1 hour</b>	111552.8	55776.4	37184.3	27888.2	22310.6

Standard EVM-7 (continued)					
Run Time (Days)					
Logging Rate	Number of Measurements Logged				
	1	2	3	4	5
1 seconds	1.3	0.6	0.4	0.3	0.3
5 seconds	6.5	3.2	2.2	1.6	1.3
15 seconds	19.4	9.7	6.5	4.8	3.9
30 seconds	38.7	19.4	12.9	9.7	7.7
1 minute	77.5	38.7	25.8	19.4	15.5
5 minutes	387.3	193.7	129.1	96.8	77.5
10 minutes	774.7	387.3	258.2	193.7	154.9
15 minutes	1162.0	581.0	387.3	290.5	232.4
30 minutes	2324.0	1162.0	774.7	581.0	464.8
1 hour	4648.0	2324.0	1549.3	1162.0	929.6
Run Time (Years)					
Logging Rate	Number of Measurements Logged				
	1	2	3	4	5
1 seconds	0.0	0.0	0.0	0.0	0.0
5 seconds	0.0	0.0	0.0	0.0	0.0
15 seconds	0.1	0.0	0.0	0.0	0.0
30 seconds	0.1	0.1	0.0	0.0	0.0
1 minute	0.2	0.1	0.1	0.1	0.0
5 minutes	1.1	0.5	0.4	0.3	0.2
10 minutes	2.1	1.1	0.7	0.5	0.4
15 minutes	3.2	1.6	1.1	0.8	0.6
30 minutes	6.4	3.2	2.1	1.6	1.3
1 hour	12.7	6.4	4.2	3.2	2.5

<b>Standard EVM-4 (Memory and logged time)</b>					
(Logging the following Sensors: Temp, Humidity, CO2, Toxic, Dew Pt)					
<b>Run Time (Hours)</b>					
<b>Logging Rate</b>	<b>Number of Measurements Logged</b>				
	<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	<b>5</b>
<b>1 seconds</b>	49.6	24.8	16.5	12.4	9.9
<b>5 seconds</b>	247.9	123.9	82.6	62.0	49.6
<b>15 seconds</b>	743.7	371.8	247.9	185.9	148.7
<b>30 seconds</b>	1487.4	743.7	495.8	371.8	297.5
<b>1 minute</b>	2974.7	1487.4	991.6	743.7	594.9
<b>5 minutes</b>	14873.7	7436.9	4957.9	3718.4	2974.7
<b>10 minutes</b>	29747.4	14873.7	9915.8	7436.9	5949.5
<b>15 minutes</b>	44621.1	22310.6	14873.7	11155.3	8924.2
<b>30 minutes</b>	89242.2	44621.1	29747.4	22310.6	17848.4
<b>1 hour</b>	178484.5	89242.2	59494.8	44621.1	35696.9
<b>Run Time (Days)</b>					
<b>Logging Rate</b>	<b>Number of Measurements Logged</b>				
	<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	<b>5</b>
<b>1 seconds</b>	2.1	1.0	0.7	0.5	0.4
<b>5 seconds</b>	10.3	5.2	3.4	2.6	2.1
<b>15 seconds</b>	31.0	15.5	10.3	7.7	6.2
<b>30 seconds</b>	62.0	31.0	20.7	15.5	12.4
<b>1 minute</b>	123.9	62.0	41.3	31.0	24.8
<b>5 minutes</b>	619.7	309.9	206.6	154.9	123.9
<b>10 minutes</b>	1239.5	619.7	413.2	309.9	247.9
<b>15 minutes</b>	1859.2	929.6	619.7	464.8	371.8
<b>30 minutes</b>	3718.4	1859.2	1239.5	929.6	743.7
<b>1 hour</b>	7436.9	3718.4	2479.0	1859.2	1487.4
<b>Run Time (Years)</b>					
<b>Logging Rate</b>	<b>Number of Measurements Logged</b>				
	<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	<b>5</b>
<b>1 seconds</b>	0.0	0.0	0.0	0.0	0.0
<b>5 seconds</b>	0.0	0.0	0.0	0.0	0.0
<b>15 seconds</b>	0.1	0.0	0.0	0.0	0.0
<b>30 seconds</b>	0.2	0.1	0.1	0.0	0.0
<b>1 minute</b>	0.3	0.2	0.1	0.1	0.1
<b>5 minutes</b>	1.7	0.8	0.6	0.4	0.3
<b>10 minutes</b>	3.4	1.7	1.1	0.8	0.7
<b>15 minutes</b>	5.1	2.5	1.7	1.3	1.0
<b>30 minutes</b>	10.2	5.1	3.4	2.5	2.0
<b>1 hour</b>	20.4	10.2	6.8	5.1	4.1

<b>Standard EVM-3 (Memory and logged time)</b>					
(Logging the following Sensors: Dust, Temp, Humidity, Dew Pt)					
<b>Run Time (Hours)</b>					
<b>Logging Rate</b>	<b>Number of Measurements Logged</b>				
	<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	<b>5</b>
<b>1 seconds</b>	49.6	24.8	16.5	12.4	9.9
<b>5 seconds</b>	247.9	123.9	82.6	62.0	49.6
<b>15 seconds</b>	743.7	371.8	247.9	185.9	148.7
<b>30 seconds</b>	1487.4	743.7	495.8	371.8	297.5
<b>1 minute</b>	2974.7	1487.4	991.6	743.7	594.9
<b>5 minutes</b>	14873.7	7436.9	4957.9	3718.4	2974.7
<b>10 minutes</b>	29747.4	14873.7	9915.8	7436.9	5949.5
<b>15 minutes</b>	44621.1	22310.6	14873.7	11155.3	8924.2
<b>30 minutes</b>	89242.2	44621.1	29747.4	22310.6	17848.4
<b>1 hour</b>	178484.5	89242.2	59494.8	44621.1	35696.9
<b>Run Time (Days)</b>					
<b>Logging Rate</b>	<b>Number of Measurements Logged</b>				
	<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	<b>5</b>
<b>1 seconds</b>	2.1	1.0	0.7	0.5	0.4
<b>5 seconds</b>	10.3	5.2	3.4	2.6	2.1
<b>15 seconds</b>	31.0	15.5	10.3	7.7	6.2
<b>30 seconds</b>	62.0	31.0	20.7	15.5	12.4
<b>1 minute</b>	123.9	62.0	41.3	31.0	24.8
<b>5 minutes</b>	619.7	309.9	206.6	154.9	123.9
<b>10 minutes</b>	1239.5	619.7	413.2	309.9	247.9
<b>15 minutes</b>	1859.2	929.6	619.7	464.8	371.8
<b>30 minutes</b>	3718.4	1859.2	1239.5	929.6	743.7
<b>1 hour</b>	7436.9	3718.4	2479.0	1859.2	1487.4
<b>Run Time (Years)</b>					
<b>Logging Rate</b>	<b>Number of Measurements Logged</b>				
	<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	<b>5</b>
<b>1 seconds</b>	0.0	0.0	0.0	0.0	0.0
<b>5 seconds</b>	0.0	0.0	0.0	0.0	0.0
<b>15 seconds</b>	0.1	0.0	0.0	0.0	0.0
<b>30 seconds</b>	0.2	0.1	0.1	0.0	0.0
<b>1 minute</b>	0.3	0.2	0.1	0.1	0.1
<b>5 minutes</b>	1.7	0.8	0.6	0.4	0.3
<b>10 minutes</b>	3.4	1.7	1.1	0.8	0.7
<b>15 minutes</b>	5.1	2.5	1.7	1.3	1.0
<b>30 minutes</b>	10.2	5.1	3.4	2.5	2.0
<b>1 hour</b>	20.4	10.2	6.8	5.1	4.1

## Replacement and optional parts

**\*\*All accessories subject to change**

Base Unit Parts & Numbers	Description
074-718	EVM Carry Case, with foam and labels
074-300	EVM Owner's manual
053-263	12 VDC Universal input power supply
053-575	USB cable

Particulate Parts & Numbers	Description
100-456	Silicone dielectric grease for impactors
074-080	PID PPM cleaning kit
074-076-5	5-pack of 37mm gravimetric cassettes (for pump protection) includes one standard filter
074-090	10-pack of pump protection filters (for 37mm gravimetric cassette)
074-720	Dust zero calibration filter assembly

Toxic Parts & Numbers	Description
054-875	Carbon monoxide smart sensor
054-881	Chlorine smart sensor
054-722	Ethylene oxide smart sensor
054-886	Hydrogen cyanide smart sensor
054-874	Hydrogen sulfide smart sensor
074-102	Ozone sensor
054-873	Oxygen smart sensor
054-877	Nitric oxide smart sensor
054-880	Nitrogen dioxide smart sensor
054-878	Sulphur dioxide smart sensor
074-726	Toxic calibration adapter

PID Parts & Numbers	Description
074-713	PID PPM smart sensor (includes pellet removal tool)
074-080	PID PPM cleaning kit
074-081	PID PPM replacement lamp
074-082	PID PPM replacement electrode (grid) pellet
074-097	PID PPB smart sensor
074-098	PID PPB replacement lamp
100-460	10 PPM isobutylene cal gas
100-459	Ultra zero grade air cal gas
074-104	PID PPB replacement pellet (grid)

CO <sub>2</sub> Parts & Numbers	Description
074-712	CO <sub>2</sub> Smart sensor
054-972	1.0 LPM regulator with 2' (0.050" ID) inert tubing

Options Parts & Numbers	Description
054-899	Dummy sensor (used to seal the socket when no gas sensor is present)
053-870	12 VDC car charger adapter
AirProbe-10-120	Air-Probe 10 kit includes 120V charger, adapter cable and mounting bracket.
AirProbe-10-220	Air-Probe 10 kit includes 220V charger, adapter cable and mounting bracket.
074-083	Air-Probe adapter cable (included with each air probe option)

## **Appendix B: Customer service**

### **Contacting 3M Quest Technologies Instrumentation**

Should your 3M Quest Technologies equipment need to be returned for repair or for recalibration, please contact the service department at the following number or access the online form via the website. For technical issues, please contact Technical Support.

**Service Department and Technical Support:** 1 (800) 245-0779.

Fax: 1 (262) 567-4047. Office hours are 8:00 a.m. to 5:00 p.m. United States Central.

- **E-mail:** [3Mdetectionmail@mmm.com](mailto:3Mdetectionmail@mmm.com)
- **Internet:** [www.3M.com/detection](http://www.3M.com/detection)

### **International customers**

Contact your local, factory-authorized distributor from whom the product was purchased. You can obtain the name and contact information of your local factory-authorized distributor from Quest by using the e-mail, telephone, or fax information given under “Contacting 3M Quest Technologies” above.

## **Calibration**

The EVM Series and 3M Quest field calibrator devices should be examined regularly by the factory. An annual calibration is recommended. (Please see Service Department above.)

## Warranty

3M™ EVM Series Environmental Monitor LIMITED WARRANTY. 3M Quest Technologies warrants EVM Series Environmental Monitor will be from defective materials and workmanship for one year from date of purchase (indicated on the sales receipt), provided it is maintained and used in accordance with 3M instructions and/or recommendations. If any component becomes defective during the warranty period, it will be replaced or repaired free of charge. This warranty does not apply to units that have been altered or had repair attempted, or that have been subjected to abuse, accidental or otherwise. The above warranty is in lieu of all other express warranties, obligations or liabilities. For warranty outside the United States, a minimum of one year warranty applies subject to the same limitation and exceptions as above with service provided or arranged through the authorized Quest distributor or our 3M Quest European Service Laboratory. Foreign purchasers should contact the local 3M Quest authorized sales agent for detail. THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR PARTICULAR PURPOSE ARE LIMITED TO ONE YEAR FROM THE PURCHASE DATE. 3M shall not be liable for any other warranty, express or implied, arising out of or related to the appropriate use of hearing protection devices. Manufacturer or its agent's liability shall be limited to replacement or repair as set forth above. Buyer's sole and exclusive remedies are return of the goods and repayment of the price, or repair and replacement of defective goods or parts.

# Glossary of Terms

**ACGIH**

The American Conference of Governmental Industrial Hygienists organization in the United States.

**Air monitoring**

Sampling for pollutants in the air using a variety of means such as sorbent tubes, bags, filters and sampling conventions.

**Air pollutant**

Any substance in air that could, in high enough concentration, harm man, other animals, vegetation, or material. Pollutants may include almost any natural or artificial composition of airborne matter capable of being airborne. They may be in the form of solid particles, liquid droplets, gases, or in combination.

**Air pollution**

Air pollution are chemicals present in the atmosphere which are normally not a part of the atmosphere. Basically, air pollution is air that is contaminated, interferes with human health or welfare, or harms the environment. Some examples include dust, smoke, and a variety of toxic gases such as carbon monoxide.

**Air quality monitoring**

Sampling, measurement/analysis of airborne pollutants.

**Air quality standards**

The level of pollutants prescribed by regulations that are not to be exceeded during a given time in a defined area.

**Airborne particulates**

Total suspended particulate matter found in the atmosphere as solid particles or liquid droplets. Chemical composition of particulates varies widely, depending on location and time of year. Airborne particulates include: windblown dust, emissions from industrial processes, smoke from the burning of wood and coal, and motor vehicle or non-road engine exhausts.

**ASHRAE**

The American Society of Heating, Refrigeration and Air-Conditioning Engineers in the United States.

**Bump Test**

A functional test of the sensors installed in the gas monitor. Calibration gas is used for a bump test.

## Calculating particulate matter

The worker exposure assessment, on the EVM, is based on a gravimetric analysis with filter samples drawn over a period time. If acute effects exist from personal inhalable dust, the sampling analysis allows for short term analysis (STEL).

## Ceiling

This is the maximum allowable concentration of a chemical that an employee may be exposed to. It must never be exceeded, even for an instant.

## Confined Space (see also “Permit Required Confined Space”)

A “Confined Space” has 3 components:

- a. It is large enough to enter & perform work
- b. It has limited means for entry & exit
- c. It is not designed for continuous occupancy

## Dew Point

The dew point measurement is the absolute measurement of the amount of water vapor in the air (indicating how much humidity is in the air). **It is also defined by Wikipedia as, “the temperature to which a given parcel of air must be cooled, at constant barometric pressure, for water vapor to condense into water. The condensed water is called dew. The dew point is also referred to as the saturation point”.**

## Drift

Is a percentage of signal loss of a gas sensor per month.

## Correction Override Factor

This is the correction override factor that is applied during your run or after a run for particulate measurements or PID (VOCs) measurements. In QSP-II, an override factor can be applied after a run via the Correction Override icon. (Please see Optional Correction Override on page 124 for operational details.) The applied dust override is displayed in the General Data Panel (if selected under the sensor data list).

## Dust Override Profile

When setting up the Dust profile in QSP-II, there is an active profile field. The Dust Override profile field corresponds with the active (or applied) dust profile.

## Dummy Sensor

This is required to cover a sensor socket when no sensor is present to maintain unit to environment sealing capability.

## Engulfment

This is the surrounding of a person by finely divided solids or a liquid. A worker in a storage tank filled with sawdust, for example, could fall into an air pocket, be completely surrounded by sawdust, and suffocate to death.

## Dust monitoring

Dust is typically known as a type of particulate matter or an aerosol with a miniscule diameter of 0.1  $\mu\text{m}$  upwards.

## Filtered CO sensor vs. Unfiltered

There is a high cross-sensitivity between CO and  $\text{H}_2\text{S}$ . A filtered CO sensor lessens the sensitivity of the sensor to  $\text{H}_2\text{S}$ .

## Fire Triangle

A term for the three components required to start a fire: fuel, oxygen, and ignition.

## Gravimetric analysis

Describes an analytical chemistry methodology for determining the quantitative mass of a solid. The EVM collects particulates in an internal gravimetric sample holder that are filtered, collected, and weighed to determine the severity of the worker exposure.

## Hazardous Atmosphere

Means an atmosphere presenting a potential for death, disablement, injury, or acute illness from one or more of the following causes:

- a. A flammable gas, vapor or mist in excess of 10% of its' lower explosive limit (LEL).
- b. An oxygen deficient atmosphere containing less than 19.5% oxygen by volume or an oxygen enriched atmosphere containing more than 23.5% oxygen by volume.
- c. Airborne combustible dust at a concentration that meets or exceeds its LEL (airborne combustible dust which obscures vision at five feet or less).
- d. An atmospheric concentration of any substance for which a dose or a permissible exposure limit is published in Subpart G, *Occupational Health and Environmental Control*, or in subpart Z, *Toxic and Hazardous Substances*, which could result in an employee exposure in excess of its dose or permissible exposure limit, and that could cause death, incapacitation, impairment of ability to self-rescue, injury or acute illness.
- e. Any other atmospheric condition that is immediately dangerous to life or health (IDLH).

## IDLH (Immediately Dangerous to Life and Health )

Any condition that poses an immediate or delayed threat to life, or that would cause irreversible adverse health effects or that would interfere with an individual's ability to escape unaided from a confined space.

## Lockout-Tagout

Placing locks or tags on the energy-isolating device (e.g. breaker boxes, control switches, valves, etc.) to prevent the unauthorized re-energization of the device or circuit while work is being performed by personnel. Tags shall indicate that the energy-isolated device must not be operated until the tag is removed by the individual(s) that installed the tag.

**Material Safety Data Sheet**, published for every chemical or substance that may be hazardous; if an exposure limit has been published for a substance being discussed in an MSDS, that limit, such as TWA or PEL, is required to be included in the MSDS publication. Ref: 29 CFR 1910.1200 (g)(2)(i)(C)(2) and (g)(2)(vi). TWA's and PEL's are not available for most chemicals. There are simply too many chemicals, many of which have not gone through the rigorous scientific study and peer review required. The absence of an exposure limit for a substance should not be used to assume that a substance is not hazardous.

## Measurement parameters

The following measurements are displayed on the instrument and in the Logged data table/chart in QSP-II.

- **Average**  
The measurement value over the time interval (or logging interval)
- **Level**  
The instantaneous measurement at a specific point in time.
- **Minimum**  
The minimum measurement over the time interval (or logging interval).
- **Maximum**  
The maximum measurement over the time interval (or logging interval).
- **STEL (Short term Exposure Limit)**  
The maximum concentration above the time-weighted average that employees can be exposed to over a specific time period (usually 15 minutes) no more than four (4) times per day. (See PEL for more information.)
- **TWA**  
Most permissible exposure limits are based upon an 8-hour time weighted average (TWA). The air concentration may sometimes go above the TWA value, as long as the 8-hour average stays below. (See PEL for more information.)

## MSHA

The Mine Safety and Health Administration in the USA.

## NIOSH

The National Institute for Occupational Safety and Hygiene in the United States. An organization dedicated to investigating the harmful effects of varied industrial hazards on the working population and promulgating regulations to control their harmful effects.

## OSHA

The Occupational Safety and Health Administration in the United States. A division of the Department of Labor charged with dealing with the health and welfare of the working population that issues guidelines and legislation to control the hazards at work.

## Particulate matter (PM)

Particulate matter, [also referred to as total suspended particles (TSP)] consists of tiny inhalable dust which can be man made or natural. A wide range of particulates include the following pollutants: road dust, the burning of fossil fuel, diesel soot, environmental fires (forest or grassland), power plants, and wood smoke. These particles are a mixture of visible and microscopic solid particles and tiny liquid droplets referred to as aerosols.

- **Thoracic dust:** PM10 is the fraction of PM containing particles that are small enough to pass the PM10 impactor (10mm)
- **Respirable dust:** The cut-points for respirable dust are: PM4 (4 microns), PM2.5 (2.5 microns)

## Peak

The highest level of toxic gas or oxygen reached while the unit is on.

## PEL (Permissible Exposure Limit)

Permissible exposure limit. PEL's are a regulatory limitation to exposure used to specify the allowable exposure to a substance in the workplace and assume that the exposure takes place over an 8-hour shift in a 40-hour work week. Note that there are more stringent exposure limits for higher levels of exposure that may occur over a shorter time interval.

There are three types of PELs:

- **TWA**

Most permissible exposure limits are based upon an 8-hour time weighted average (TWA). The air concentration may sometimes go above the TWA value, as long as the 8-hour average stays below. **(NOTE: This measurement is not applicable with temperature, relative humidity, or air velocity sensors.)**

- **Ceiling Limit**

The maximum allowable concentration of a chemical that an employee may be exposed to. It must never be exceeded, even for an instant.

- **STEL**

The Short Term Exposure Limit (STEL) is the maximum concentration above the time-weighted average that employees can be exposed to over a specific time period (usually 15 minutes) no more than four (4) times per day. This stands for Short Term Exposure Limit and is the maximum average concentration of a toxic gas to which an unprotected worker may be exposed over any fifteen-minute interval during a work period. The EVM calculates the STEL by compiling fifteen one-minute averages, and updates that average each minute after the initial fifteen-minute exposure. If the STEL is reached or exceeded, the alarm activates, and the STEL enunciator turns on.

Different regulatory agencies have different acronyms for PELs: NIOSH (National Institute for Occupational Safety and Health) uses REL (Recommended Exposure Limit), and ACGIH (American Conference of Governmental Industrial Hygienists) uses TLV (Threshold Limit Value).

**(NOTE: This measurement is not applicable with temperature, relative humidity, or air velocity sensors.)**

## Photodiode

A type of photodetector that is able to convert light source into either current or voltage. With the EVM, it is used to measure the amount of light scattered from a particle cloud.

## ppm/ppb

Parts per million (or parts per billion) of concentration of the gas of interest in air. For example, 1 ppm signifies one part of gas to 1 million parts of air.

## REL (Recommended Exposure Limit)

Exposure limits set by the National Institute for Occupational Safety and Health (NIOSH).

**Relative Humidity**

The relative humidity of an air-water mixture is defined as the ratio of the partial pressure of water vapor in the mixture to the saturated vapor pressure of water at a prescribed temperature. This can be calculated by dividing the temperature and dew point readings and multiplying by 100%.

**Relative Sensitivity**

Toxic and LEL sensors are calibrated to detect a specific gas. However there may be some cross-sensitivity of the sensor to other toxics or combustibles.

**TIME**

Point in time when the maximum exposure will occur from the beginning of any 8-hour period

**TLV**

Threshold limit value: the level of exposure that a worker can experience in the workplace without an unreasonable risk of disease or injury. These are not estimates of "level of risk" for different exposure levels nor do they address the different means by which a person may be exposed to a substance. TLV's are specified by ACGIH, the American Conference of Government Industrial Hygienists. TLV's are guidelines prepared by ACGIH and are solely concerned with health risk. They do not address economic considerations. TLV's are not regulatory but rather are advisory. (See PEL and TWA which are specified by OSHA).

**VOC (Volatile Organic Compound)**

A type of air pollution that is a carbon-containing chemical, which is typically vaporized at ambient temperatures. Some examples of VOC's include: **biological agents (mold, dust, mites...etc.), carbon monoxide, formaldehyde, second hand tobacco smoke.** On the EVM, **VOC's are measured in air by using the Photoionization detection (PID) sensor.**

# Appendix C


## PID sensor and correction factors tables


The following chart details approximate correction factors (or response factors) for specific concentrations of VOCs.

It is recommended, for best test results, to calibrate the PID sensor with the relevant VOC you intend to measure. If this is not possible, the factors listed in the table, provided by Ion Science, can be used when calibrating the PID sensor. **NOTE: these are approximate values; so, for best accuracy you should calibrate with the relevant VOC.** (Please refer to Ion Science for details on linear range accuracy and table explanation.)

► **The table includes six columns:**

1. **Gas/ VOC:** The most common name for the VOC. If you cannot find the name of your VOC of concern, then please refer to **Ion Science's** website.
2. **Formula:** To further assist in identifying the VOC, this also is helpful in identifying its molecular weight, from which ppm measurements can be converted to say, mg/m<sup>3</sup> measurements.
3. **Response Factor:** (RF) also known as **correction factor**. Multiply the output response from the cell by the RF to provide a normalized scale of VOC concentration.
4. **Relative sensitivity:** (%) This is the inverse of the correction factor, specifying the percent response of the VOC, relative to isobutylene. If less than 100%, then the VOC is less responsive than isobutylene; if the relative sensitivity is greater than 100%, then the VOC is more responsive than isobutylene. Relative sensitivity (%) is specified the same way as cross-sensitivity for toxic gas sensors.
5. **Typical Minimum Detection Level (MDL) or Minimum Detectable Quantity (MDQ):** Typical lowest concentration that can be detected. The Mini PID HI has greater sensitivity **than the Mini PID LO, so MDL's for the Mini PID HI are much lower.** The RF is measured in dry air; high humidity will reduce this factor by 10% to 20%, so the RF should be increased in high **humidity's.**

 **Attention:** In the table below, a Correction factor listed as “NR” indicates no response since not all VOCs or gases can be measured with a PID sensor.

 **NOTE:** The “Typical minimum detection level” is listed in parts per billion in the table below. The EVM calculates VOCs in parts per million or parts per billion.

Gas/VOC	Formula (used to convert ppm measurement to mg/m <sup>3</sup> )	Correction factor	Relative sensitivity (%)	Typical PID (ppb)
Acetaldehyde	C <sub>2</sub> H <sub>4</sub> O	4.9	21	480
Acetic Acid	C <sub>2</sub> H <sub>4</sub> O <sub>2</sub>	36	3	3615
Acetic Anhydride	C <sub>4</sub> H <sub>6</sub> O <sub>3</sub>	4.0	25	400
Acetone	C <sub>3</sub> H <sub>6</sub> O	0.7	140	70
Acetonitrile	CH <sub>3</sub> CN	NR		
Acetylene	C <sub>2</sub> H <sub>2</sub>	NR		
Acrolein	C <sub>3</sub> H <sub>4</sub> O	4.0	25	400
Acrylic Acid	C <sub>3</sub> H <sub>4</sub> O <sub>2</sub>	2.7	36	275
Acrylonitrile	C <sub>3</sub> H <sub>3</sub> N	ZR		
Allyl alcohol	C <sub>3</sub> H <sub>6</sub> O	2.1	48	200
Allyl chloride	C <sub>3</sub> H <sub>5</sub> Cl	4.5	22	450
Ammonia	H <sub>3</sub> N	8.5	12	850
Amyl acetate, n-	C <sub>7</sub> H <sub>14</sub> O <sub>2</sub>	1.8	56	180
Amyl alcohol	C <sub>5</sub> H <sub>12</sub> O	3.2	31	320
Aniline	C <sub>6</sub> H <sub>7</sub> N	0.5	200	50
Anisole	C <sub>7</sub> H <sub>8</sub> O	0.5	211	50
Arsine	AsH <sub>3</sub>	2.5	40	250
Asphalt, petroleum fumes		1.0	100	100
Benzaldehyde	C <sub>7</sub> H <sub>6</sub> O	0.9	117	85
Benzene	C <sub>6</sub> H <sub>6</sub>	0.5	200	50
Benzenethiol	C <sub>6</sub> H <sub>5</sub> SH	0.7	143	70
Benzonitrile	C <sub>7</sub> H <sub>5</sub> N	0.7	141	70
Benzyl alcohol	C <sub>7</sub> H <sub>8</sub> O	1.3	80	125
Benzyl chloride	C <sub>7</sub> H <sub>7</sub> Cl	0.6	182	55

Gas/VOC	Formula (used to convert ppm measurement to mg/m <sup>3</sup> )	Correction factor	Relative sensitivity (%)	Typical PID (ppb)
Benzyl formate	C <sub>8</sub> H <sub>8</sub> O <sub>2</sub>	0.8	130	77
Biphenyl	C <sub>12</sub> H <sub>10</sub>	0.4	250	40
Boron trifluoride	BF <sub>3</sub>	NR		
Bromine	Br <sub>2</sub>	20	5	2000
Bromine pentafluoride	BrF <sub>5</sub>	NR		
Bromobenzene	C <sub>6</sub> H <sub>5</sub> Br	0.7	143	70
Bromochloromethane	CH <sub>2</sub> ClBr	NR		
Bromoethane	C <sub>2</sub> H <sub>5</sub> Br	5.0	20	500
Bromoethyl methyl ether	C <sub>3</sub> H <sub>7</sub> OBr	2.5	40	250
Bromoform	CHBr <sub>3</sub>	2.8	36	280
Bromopropane	C <sub>3</sub> H <sub>7</sub> Br	1.3	77	130
Bromotrifluoromethane	CF <sub>3</sub> Br	NR		
Bromoform	CHBr <sub>3</sub>	2.8	36	280
Bromopropane, 1-	C <sub>3</sub> H <sub>7</sub> Br			
Bromotrifluoromethane	CF <sub>3</sub> Br	NR		
Butadiene	C <sub>4</sub> H <sub>6</sub>	0.8	120	80
Butadiene diepoxide	C <sub>4</sub> H <sub>6</sub> O <sub>2</sub>	4.0	25	400
Butane, n-	C <sub>4</sub> H <sub>10</sub>	46	2	4600
Butanol	C <sub>4</sub> H <sub>10</sub> O	4.0	25	400
Buten-3-ol, 1-	C <sub>4</sub> H <sub>8</sub> O	1.2	87	115
Butene, 1-	C <sub>4</sub> H <sub>8</sub>	1.3	77	130
Butoxyethanol, 2-	C <sub>6</sub> H <sub>14</sub> O <sub>2</sub>	1.1	91	110
Butyl acetate, n-	C <sub>6</sub> H <sub>12</sub> O <sub>2</sub>	2.4	41	240
Butyl acrylate, n-	C <sub>7</sub> H <sub>12</sub> O <sub>2</sub>	1.5	67	150
Butyl lactate	C <sub>7</sub> H <sub>14</sub> O <sub>3</sub>	2.5	40	250
Butyl mercaptan	C <sub>4</sub> H <sub>10</sub> S	0.5	185	50
Butylamine, 2-	C <sub>4</sub> H <sub>11</sub> N	0.9	111	90
Butylamine, n-	C <sub>4</sub> H <sub>11</sub> N	1.0	100	100
Camphene	C <sub>10</sub> H <sub>16</sub>	0.5	222	45
Carbon dioxide	CO <sub>2</sub>	ZR	-	-
Carbon disulfide	CS <sub>2</sub>	1.4	71	140
Carbon monoxide	CO	NR	-	-
Carbon tetrabromide	CBr <sub>4</sub>	3.0	33	300
Carbon tetrachloride	CCl <sub>4</sub>	NR	-	-
Carbonyl sulphide	COS	NR	-	-
Carvone, R-	C <sub>10</sub> H <sub>14</sub> O	C <sub>10</sub> H <sub>14</sub> O	100	100
Chlorine	Cl <sub>2</sub>	NR	-	-
Chlorine dioxide	ClO <sub>2</sub>	1.0	100	100
Chlorine trifluoride	ClF <sub>3</sub>	NR	-	-
Chloro-1,1,1,2-tetrafluoroethane	C <sub>2</sub> HClF <sub>4</sub>	NR	-	-
Chloro-1,1,1-trifluoroethane, 2-	C <sub>2</sub> H <sub>2</sub> ClF <sub>3</sub>	NR		

Gas/VOC	Formula (used to convert ppm measurement to mg/m <sup>3</sup> )	Correction factor	Relative sensitivity (%)	Typical PID (ppb)
Dibromochloromethane	CHBr <sub>2</sub> Cl	10.0	10	1000
Dibromodifluoromethane	CF <sub>2</sub> Br <sub>2</sub> ZR	NR	-	-
Dibromoethane 1,2-	C <sub>2</sub> H <sub>4</sub> Br <sub>2</sub>	2.0	50	200
Dibromotetrafluoroethane, 1,2-	C <sub>2</sub> F <sub>4</sub> Br <sub>2</sub>	NR	-	-
Dibutyl hydrogen phosphate	HC <sub>8</sub> H <sub>18</sub> PO <sub>4</sub>	4.0	25	400
Dichloro-1,1,1- trifluoroethane, 2,2-	C <sub>2</sub> HCl <sub>2</sub> F <sub>3</sub>	NR	-	-
Dichloro-1,1- difluoroethane, 1,2-	C <sub>2</sub> H <sub>2</sub> Cl <sub>2</sub> F <sub>2</sub>	NR	-	-
Dichloro-1,2,2- trifluoroethane, 1,2-	C <sub>2</sub> HCl <sub>2</sub> F <sub>3</sub>	NR	-	-
Dichloro-1,2- difluoroethane, 1,2-	C <sub>2</sub> H <sub>2</sub> Cl <sub>2</sub> F <sub>2</sub>	NR	-	-
Dichloro-1-fluoroethane, 1,1-	C <sub>2</sub> H <sub>3</sub> Cl <sub>2</sub> F	NR	-	-
Dichloro-1-fluoroethane, 1,1-	C <sub>2</sub> H <sub>3</sub> Cl <sub>2</sub> F	NR	-	-
Dichloro-1-fluoroethane, 1,2-	C <sub>2</sub> H <sub>3</sub> Cl <sub>2</sub> F	NR	-	-
Dichloro-1-propene	C <sub>3</sub> H <sub>4</sub> Cl <sub>2</sub>	1.4	70	140
Dichloro-2,2,- difluoroethane, 1,1-	C <sub>2</sub> H <sub>2</sub> Cl <sub>2</sub> F <sub>2</sub>	NR	-	-
Dichloroacetylene	C <sub>2</sub> Cl <sub>2</sub>	5.0	20	500
Dichlorobenzene o-	C <sub>6</sub> H <sub>4</sub> Cl <sub>2</sub>	0.5	200	50
Dichlorodifluoromethane	CCl <sub>2</sub> F <sub>2</sub>	NR	-	-
Dichloroethane 1,2-	C <sub>2</sub> H <sub>4</sub> Cl <sub>2</sub>	NR	-	-
Dichloroethane, 1,1-	C <sub>2</sub> H <sub>2</sub> Cl <sub>2</sub>	NR	-	-
Dichloroethene, 1,1-	C <sub>2</sub> H <sub>2</sub> Cl <sub>2</sub>	1.0	105	100
Dichloroethene, cis-1,2-	C <sub>2</sub> H <sub>2</sub> Cl <sub>2</sub>	0.8	125	80
Dichloroethene, trans-1,2-	C <sub>2</sub> H <sub>2</sub> Cl <sub>2</sub>	0.7	143	70
Dichloroethylene 1,2-	C <sub>2</sub> H <sub>2</sub> Cl <sub>2</sub>	0.8	133	75
Difluoromethane	CH <sub>2</sub> F <sub>2</sub>	NR	-	-
Dihydrogen selenide	H <sub>2</sub> Se	1.0	100	100
Dihydroxybenzene, 1,2	C <sub>6</sub> H <sub>6</sub> O <sub>2</sub>	1.0	100	100
Diisobutylene	C <sub>8</sub> H <sub>16</sub>	0.6	156	60
Diisopropyl ether	C <sub>6</sub> H <sub>14</sub> O	0.7	150	70
Diisopropylamine	C <sub>6</sub> H <sub>15</sub> N	0.7	140	70
Diketene	C <sub>4</sub> H <sub>4</sub> O <sub>2</sub>	2.2	45	220

Gas/VOC	Formula (used to convert ppm measurement to mg/m <sup>3</sup> )	Correction factor	Relative sensitivity (%)	Typical PID (ppb)
Dimethoxymethane	C3H8O2	1.4	71	140
Dimethyl cyclohexane, 1,2-	C8H16	1.1	95	105
Dimethyl disulphide	C2H6S2	0.2	435	23
Dimethyl ether	C2H6O	1.3	80	130
Dimethyl phthalate	C10H10O4	1.0	100	100
Dimethyl sulphate	C2H6O4S	NR	-	-
Dimethyl sulphide	C2H6S	0.5	200	50
Dimethylacetamide N,N-	C4H9NO	1.3	75	130
Dimethylamine	C2H7N	1.4	70	140
Dimethylaminoethanol	C4H11NO	1.5	70	150
Dimethylaniline, NN-	C8H11N	0.6	167	60
Dimethylbutyl acetate	C8H16O2	1.6	60	160
Dimethylethylamine, NN-	C4H11N	0.8	125	80
Dimethylformamide	C3H7NO	0.9	110	90
Dimethylheptan-4-one, 2,6-	C9H18O	0.8	125	80
Dimethylhydrazine, 1,1-	C2H8N2	1.0	100	100
Dinitrobenzene, m-	C6H4N2O4	3.0	33	300
Dinitrobenzene, o-	C6H4N2O4	NR	-	-
Dinitrobenzene, p-	C6H4N2O4	5.0	20	500
Dinonyl phthalate	C26H42O4	1.0	100	100
Dioxane 1,2-	C4H8O2	1.5	67	150
Dioxane 1,4-	C4H8O2	1.5	67	150
Dipentene	C10H16	0.9	110	90
Diphenyl ether	C12H10O	0.8	125	80
Disulphur decafluoride	S2F10	NR	-	-
Disulphur dichloride	S2Cl2	3.0	33	300
Di-tert-butyl-p-cresol	C11H16O	1.0	100	100
Divinylbenzene	C10H10	0.4	250	40
Dodecanol	C12H26O	0.9	110	90
Enflurane	C4H2F5ClO	NR	-	-
Epichlorohydrin	C3H5ClO	8.0	15	800
Epoxypropyl isopropyl ether, 2,3-	C6H12O2	1.1	90	110
Ethane	C2H6	NR	-	-
Ethanol	C2H6O	8.7	10	870
Ethanolamine	C2H7NO	3.0	33	300
Ethoxy-2-propanol, 1-	C5H10O2	2.0	50	200
Ethoxyethanol, 2-	C4H10O2	29.8	3	3000
Ethoxyethyl acetate, 2-	C6H12O3	3.0	33	300
Ethyl (S)-(-)-lactate	C5H10O3	3.0	33	300
Ethyl acetate	C4H8O2	3.6	28	360
Ethyl acrylate	C5H8O2	2.0	50	200
Ethyl amine	C2H7N	1.0	100	100

Gas/VOC	Formula (used to convert ppm measurement to mg/m <sup>3</sup> )	Correction factor	Relative sensitivity (%)	Typical PID (ppb)
Ethyl benzene	C <sub>8</sub> H <sub>10</sub>	0.5	185	50
Ethyl butyrate	C <sub>6</sub> H <sub>12</sub> O <sub>2</sub>	1.0	105	100
Ethyl chloroformate	C <sub>3</sub> H <sub>5</sub> O <sub>2</sub> Cl	80	1	8300
Ethyl cyanoacrylate	C <sub>6</sub> H <sub>7</sub> O <sub>2</sub> N	1.5	67	150
Ethyl decanoate	C <sub>12</sub> H <sub>24</sub> O <sub>2</sub>	1.8	56	180
Ethyl formate	C <sub>3</sub> H <sub>6</sub> O <sub>2</sub>	30	3	3000
Ethyl hexanoate	C <sub>8</sub> H <sub>16</sub> O <sub>2</sub>	2.6	38	260
Ethyl hexanol, 2	C <sub>8</sub> H <sub>18</sub> O	1.5	67	150
Ethyl hexyl acrylate, 2-	C <sub>11</sub> H <sub>20</sub> O <sub>2</sub>	1.0	100	100
Ethyl mercaptan	C <sub>2</sub> H <sub>6</sub> S	0.7	145	70
Ethyl octanoate	C <sub>10</sub> H <sub>20</sub> O <sub>2</sub>	2.3	40	230
Ethylene	C <sub>2</sub> H <sub>4</sub>	8.0	13	800
Ethylene dinitrate	C <sub>2</sub> H <sub>4</sub> O <sub>6</sub> N <sub>2</sub>	NR	-	-
Ethylene glycol	C <sub>2</sub> H <sub>6</sub> O <sub>2</sub>	20.0	5	2000
Ethylene oxide	C <sub>2</sub> H <sub>4</sub> O	15.0	7	1500
Ferrocene	C <sub>10</sub> H <sub>10</sub> Fe	0.8	125	80
Fluorine	F <sub>2</sub>	NR	-	-
Fluoroethane	C <sub>2</sub> H <sub>5</sub> F	NR	-	-
Fluoromethane	CH <sub>3</sub> F	NR	-	-
Formaldehyde	CH <sub>2</sub> O	NR	-	-
Formamide	CH <sub>3</sub> ON	2.0	50	200
Formic acid	CH <sub>2</sub> O <sub>2</sub>	NR	-	-
Furfural	C <sub>5</sub> H <sub>4</sub> O <sub>2</sub>	1.4	70	140
Furfuryl alcohol	C <sub>5</sub> H <sub>6</sub> O <sub>2</sub>	2.0	50	200
Gasoline vapors		1.1	95	105
Germane	GeH <sub>4</sub>	10.0	10	1000
Glutaraldehyde	C <sub>5</sub> H <sub>8</sub> O <sub>2</sub>	0.9	111	90
Halothane	CF <sub>3</sub> CHBrCl	NR	-	-
Helium	He	NR	-	-
Heptan-2-one	C <sub>7</sub> H <sub>14</sub> O	0.7	140	70
Heptan-3-one	C <sub>7</sub> H <sub>14</sub> O	0.8	133	75
Heptane n-	C <sub>7</sub> H <sub>16</sub>	2.1	50	200
Hexachloroethane	C <sub>2</sub> Cl <sub>6</sub>	NR	-	-
Hexafluoroethane	C <sub>2</sub> F <sub>6</sub>	NR	-	-
Hexamethyldisilazane, 1,1,1,3,3,3-	C <sub>6</sub> H <sub>19</sub> NSi <sub>2</sub>	1.0	100	100
Hexamethyldisiloxane	C <sub>6</sub> H <sub>18</sub> OSi <sub>2</sub>	0.3	350	30
Hexan-2-one	C <sub>6</sub> H <sub>12</sub> O	0.8	125	80
Hexane n-	C <sub>6</sub> H <sub>14</sub>	4.2	25	420
Hexene, 1-	C <sub>6</sub> H <sub>12</sub>	0.9	110	90
Hydrazine	H <sub>4</sub> N <sub>2</sub>	3.0	33	300
Hydrazoic acid	HN <sub>3</sub>	NR	-	-

Gas/VOC	Formula (used to convert ppm measurement to mg/m <sup>3</sup> )	Correction factor	Relative sensitivity (%)	Typical PID (ppb)
Hydrogen	H <sub>2</sub>	NR	-	-
Hydrogen bromide	HBr	NR	-	-
Hydrogen chloride	HCl	NR	-	-
Hydrogen cyanide	HCN	NR	-	-
Hydrogen fluoride	HF	NR	-	-
Hydrogen peroxide	H <sub>2</sub> O <sub>2</sub>	4.0	25	400
Hydrogen sulfide	H <sub>2</sub> S	4.0	25	400
Hydroquinone	C <sub>6</sub> H <sub>6</sub> O <sub>2</sub>	0.8	125	80
Hydroxypropyl acrylate 2-	C <sub>6</sub> H <sub>10</sub> O <sub>3</sub>	1.5	67	150
Iminodi(ethylamine) 2,2-	C <sub>4</sub> H <sub>13</sub> N <sub>3</sub>	0.9	110	90
Iminodiethanol 2,2'-	C <sub>4</sub> H <sub>11</sub> NO <sub>2</sub>	1.6	60	160
Indene	C <sub>9</sub> H <sub>8</sub>	0.5	220	50
Iodine	I <sub>2</sub>	667	1	15
Iodoform	CHI <sub>3</sub>	1.5	67	150
Iodomethane	CH <sub>3</sub> I	0.4	250	40
Isoamyl acetate	C <sub>7</sub> H <sub>14</sub> O <sub>2</sub>	1.6	8	160
Isobutane	C <sub>4</sub> H <sub>10</sub>	8.0	40	800
Isobutanol	C <sub>4</sub> H <sub>10</sub> O	3.5	30	350
Isobutyl acetate	C <sub>6</sub> H <sub>12</sub> O <sub>2</sub>	2.3	45	230
Isobutyl acrylate	C <sub>7</sub> H <sub>12</sub> O <sub>2</sub>	1.3	80	130
Isobutylene	C <sub>4</sub> H <sub>8</sub>	1.0	100	100
Isobutyraldehyde	C <sub>4</sub> H <sub>8</sub> O	1.2	80	120
Isodecanol	C <sub>10</sub> H <sub>22</sub> O	0.9	110	90
Isoflurane	C <sub>3</sub> H <sub>2</sub> ClF <sub>5</sub> O	NR	-	-
Isononanol	C <sub>9</sub> H <sub>20</sub> O	1.5	67	150
Isooctane	C <sub>8</sub> H <sub>18</sub>	1.1	90	100
Isooctanol	C <sub>8</sub> H <sub>18</sub> O	1.7	60	170
Isopentane	C <sub>5</sub> H <sub>12</sub>	6.0	20	600
Isophorone	C <sub>9</sub> H <sub>14</sub> O	0.8	133	75
Isoprene	C <sub>5</sub> H <sub>8</sub>	0.7	140	70
Isopropanol	C <sub>3</sub> H <sub>8</sub> O	4.4	20	440
Isopropyl acetate	C <sub>5</sub> H <sub>10</sub> O <sub>2</sub>	2.2	50	220
Isopropyl chloroformate	C <sub>4</sub> H <sub>7</sub> O <sub>2</sub> Cl	1.6	60	160
Jet Fuel JP-4		0.8	133	75
Jet Fuel JP-5		0.7	150	60
Jet Fuel JP-8		0.7	150	60
Kerosene		0.8	120	90
Ketene	C <sub>2</sub> H <sub>2</sub> O	3.0	33	300
Liquefied petroleum gas		NR	-	-
Maleic anhydride	C <sub>4</sub> H <sub>2</sub> O <sub>3</sub>	2.0	50	200
Mercaptoacetic acid	C <sub>2</sub> H <sub>4</sub> O <sub>2</sub> S	1.0	100	100
Mercury	Hg	NR	-	-

Gas/VOC	Formula (used to convert ppm measurement to mg/m <sup>3</sup> )	Correction factor	Relative sensitivity (%)	Typical PID (ppb)
Mercury alkyls		NR	-	-
Mesitylene	C <sub>9</sub> H <sub>12</sub>	0.3	300	30
Methacrylic acid	C <sub>4</sub> H <sub>6</sub> O <sub>2</sub>	2.3	40	230
Methacrylonitrile	C <sub>4</sub> H <sub>5</sub> N	5.0	20	500
Methane	CH <sub>4</sub>	NR	-	-
Methanol	CH <sub>4</sub> O	200	1	20000
Methoxyethanol, 2-	C <sub>3</sub> H <sub>8</sub> O <sub>2</sub>	2.7	40	270
Methoxyethoxyethanol, 2-	C <sub>5</sub> H <sub>12</sub> O <sub>3</sub>	1.4	70	140
Methoxymethylethoxy-2-propanol	C <sub>7</sub> H <sub>16</sub> O <sub>3</sub>	1.3	80	130
Methoxypropan-2-ol	C <sub>4</sub> H <sub>10</sub> O <sub>2</sub>	3.0	33	300
Methoxypropyl acetate	C <sub>6</sub> H <sub>12</sub> O <sub>3</sub>	1.2	80	120
Methyl acetate	C <sub>3</sub> H <sub>6</sub> O <sub>2</sub>	5.2	20	500
Methyl acrylate	C <sub>4</sub> H <sub>6</sub> O <sub>2</sub>	3.4	30	340
Methyl bromide	CH <sub>3</sub> Br	1.9	50	190
Methyl cyanoacrylate	C <sub>5</sub> H <sub>5</sub> O <sub>2</sub> N	5.0	20	500
Methyl ethyl ketone	C <sub>4</sub> H <sub>8</sub> O	0.8	130	80
Methyl ethyl ketone peroxides	C <sub>8</sub> H <sub>18</sub> O <sub>2</sub>	0.8	125	80
Methyl formate	C <sub>2</sub> H <sub>4</sub> O <sub>2</sub>	NR	-	-
Methyl isobutyl ketone	C <sub>6</sub> H <sub>12</sub> O	0.8	125	80
Methyl isocyanate	C <sub>2</sub> H <sub>3</sub> NO	NR	-	-
Methyl isothiocyanate	C <sub>2</sub> H <sub>3</sub> NS	0.6	167	60
Methyl mercaptan	CH <sub>4</sub> S	0.7	140	70
Methyl methacrylate	C <sub>5</sub> H <sub>8</sub> O <sub>2</sub>	1.6	60	160
Methyl propyl ketone	C <sub>5</sub> H <sub>10</sub> O	0.8	130	80
Methyl salicylate	C <sub>8</sub> H <sub>8</sub> O <sub>3</sub>	1.2	80	120
Methyl sulphide	C <sub>2</sub> H <sub>6</sub> S	0.5	200	50
Methyl t-butyl ether	C <sub>5</sub> H <sub>12</sub> O	0.8	125	80
Methyl-2-propen-1-ol, 2-	C <sub>4</sub> H <sub>8</sub> O	1.1	90	100
Methyl-2-pyrrolidinone, N-	C <sub>5</sub> H <sub>9</sub> NO	0.9	110	90
Methyl-4,6-dinitrophenol, 2-	C <sub>7</sub> H <sub>6</sub> N <sub>2</sub> O <sub>5</sub>	3.0	33	300
Methyl-5-hepten-2-one, 6-	C <sub>8</sub> H <sub>14</sub> O	0.8	125	80
Methylamine	CH <sub>5</sub> N	1.4	70	140
Methylbutan-1-ol, 3-	C <sub>5</sub> H <sub>12</sub> O	3.4	30	340
Methylcyclohexane	C <sub>7</sub> H <sub>14</sub>	1.1	90	110
Methylcyclohexanol, 4-	C <sub>7</sub> H <sub>14</sub> O	2.4	40	240
Methylcyclohexanone 2-	C <sub>7</sub> H <sub>12</sub> O	1.0	100	100
Methylheptan-3-one, 5-	C <sub>8</sub> H <sub>16</sub> O	0.8	133	75
Methylhexan-2-one, 5-	C <sub>7</sub> H <sub>14</sub> O	0.8	133	75
Methylhydrazine	CH <sub>6</sub> N <sub>2</sub>	1.3	80	130
Methyl-N-2,4, 6-tetranitroaniline, N-	C <sub>7</sub> H <sub>5</sub> N <sub>5</sub> O <sub>8</sub>	3.0	33	300

Gas/VOC	Formula (used to convert ppm measurement to mg/m <sup>3</sup> )	Correction factor	Relative sensitivity (%)	Typical PID (ppb)
Methylpent-3-en-2-one, 4-	C <sub>6</sub> H <sub>10</sub> O	0.7	140	70
Methylpentan-2-ol, 4-	C <sub>6</sub> H <sub>14</sub> O	2.8	40	280
Methylpentane-2,4-diol, 2-	C <sub>6</sub> H <sub>14</sub> O <sub>2</sub>	4.0	25	400
Methylpropan-2-ol, 2-	C <sub>4</sub> H <sub>10</sub> O	3.5	30	350
Methylstyrene	C <sub>9</sub> H <sub>10</sub>	0.5	200	50
Mineral oil		0.8	125	80
Mineral spirits		0.8	125	80
Naphthalene	C <sub>10</sub> H <sub>8</sub>	0.4	230	45
Nitric oxide	NO	8.0	15	800
Nitroaniline	C <sub>6</sub> H <sub>6</sub> N <sub>2</sub> O <sub>2</sub>	0.8	125	80
Nitrobenzene	C <sub>6</sub> H <sub>5</sub> NO <sub>2</sub>	1.7	60	170
Nitroethane	C <sub>2</sub> H <sub>5</sub> NO <sub>2</sub>	NR	-	-
Nitrogen dioxide	NO <sub>2</sub>	10.0	10	1000
Nitrogen trichloride	NCI <sub>3</sub>	1.0	100	100
Nitrogen trifluoride	NF <sub>3</sub>	NR	-	-
Nitromethane	CH <sub>3</sub> NO <sub>2</sub>	NR	-	-
Nitropropane, 1-	C <sub>3</sub> H <sub>7</sub> NO <sub>2</sub>	NR	-	-
Nitropropane, 2-	C <sub>3</sub> H <sub>7</sub> NO <sub>2</sub>	NR	-	-
Nitrous oxide	N <sub>2</sub> O	NR	-	-
Nonane, n-	C <sub>9</sub> H <sub>20</sub>	1.3	80	130
Norbornadiene, 2,5-	C <sub>7</sub> H <sub>8</sub>	0.6	167	60
Octachloronaphthalene	C <sub>10</sub> Cl <sub>8</sub>	1.0	100	100
Octane, n-	C <sub>8</sub> H <sub>18</sub>	1.6	60	160
Octene, 1-	C <sub>8</sub> H <sub>16</sub>	0.7	140	70
Oxalic acid	C <sub>2</sub> H <sub>2</sub> O <sub>4</sub>	NR	-	-
Oxalonitrile	C <sub>2</sub> N <sub>2</sub>	NR	-	-
Oxydiethanol 2,2-	C <sub>4</sub> H <sub>10</sub> O <sub>3</sub>	4.0	25	400
Oxygen	O <sub>2</sub>	NR	-	-
Ozone	O <sub>3</sub>	NR	-	-
Paraffin wax, fume		1.0	100	100
Paraffins, normal		1.0	105	100
Pentacarbonyl iron	FeC <sub>5</sub> O <sub>5</sub>	1.0	100	100
Pentachloroethane	C <sub>2</sub> Cl <sub>5</sub>	NR	-	-
Pentachlorofluoroethane	C <sub>2</sub> Cl <sub>5</sub> F	NR	-	-
Pentafluoroethane	C <sub>2</sub> HF <sub>5</sub>	NR	-	-
Pentan-2-one	C <sub>5</sub> H <sub>10</sub> O	0.8	125	80
Pentan-3-one	C <sub>5</sub> H <sub>10</sub> O	0.8	125	80
Pentandione, 2,4-	C <sub>5</sub> H <sub>8</sub> O <sub>2</sub>	0.8	133	75
Pentane, n-	C <sub>5</sub> H <sub>12</sub>	7.9	15	800
Peracetic acid	C <sub>2</sub> H <sub>4</sub> O <sub>3</sub>	2.0	50	200
Perchloryl fluoride	ClO <sub>3</sub> F	NR	-	-
Perfluoropropane	C <sub>3</sub> F <sub>8</sub>	NR	-	-
Petroleum ether		0.9	110	90

Gas/VOC	Formula (used to convert ppm measurement to mg/m <sup>3</sup> )	Correction factor	Relative sensitivity (%)	Typical PID (ppb)
Phenol	C <sub>6</sub> H <sub>6</sub> O	1.2	85	120
Phenyl propene, 2-	C <sub>9</sub> H <sub>10</sub>	0.4	230	45
Phenyl-2,3-epoxypropyl ether	C <sub>9</sub> H <sub>10</sub> O <sub>2</sub>	0.8	125	80
Phenylenediamine	C <sub>6</sub> H <sub>8</sub> N <sub>2</sub>	0.6	167	60
Phosgene	COCl <sub>2</sub>	NR	-	-
Phosphine	PH <sub>3</sub>	2.0	50	200
Picoline	C <sub>6</sub> H <sub>7</sub> N	0.9	110	90
Pinene, alpha	C <sub>10</sub> H <sub>16</sub>	0.3	315	30
Pinene, beta	C <sub>10</sub> H <sub>16</sub>	0.3	315	30
Piperidine	C <sub>5</sub> H <sub>11</sub> N	0.9	110	90
Piperylene	C <sub>5</sub> H <sub>8</sub>	0.7	150	67
Prop-2-yn-1-ol	C <sub>3</sub> H <sub>4</sub> O	1.3	80	130
Propan-1-ol	C <sub>3</sub> H <sub>8</sub> O	4.8	20	480
Propane	C <sub>3</sub> H <sub>8</sub>	NR	-	-
Propane-1,2-diol, total	C <sub>3</sub> H <sub>8</sub> O <sub>2</sub>	10.0	50	1000
Propene	C <sub>3</sub> H <sub>6</sub>	1.4	70	140
Propionaldehyde	C <sub>3</sub> H <sub>6</sub> O	1.7	60	169
Propionic acid	C <sub>3</sub> H <sub>6</sub> O <sub>2</sub>	8.0	15	800
Propyl acetate, n-	C <sub>5</sub> H <sub>10</sub> O <sub>2</sub>	2.5	40	250
Propylene dinitrate	C <sub>3</sub> H <sub>6</sub> N <sub>2</sub> O <sub>6</sub>	NR	-	-
Propylene oxide	C <sub>3</sub> H <sub>6</sub> O	7.0	15	700
Propyleneimine	C <sub>3</sub> H <sub>7</sub> N	1.3	80	130
Pyridine	C <sub>5</sub> H <sub>5</sub> N	0.8	133	75
Pyridylamine 2-	C <sub>5</sub> H <sub>6</sub> N <sub>2</sub>	0.8	125	80
Silane	SiH <sub>4</sub>	NR	-	-
Sodium fluoroacetate	C <sub>2</sub> H <sub>2</sub> O <sub>2</sub> FNa	NR	-	-
Styrene	C <sub>8</sub> H <sub>8</sub>	0.4	230	50
Sulphur dioxide	SO <sub>2</sub>	NR	-	-
Sulphur hexafluoride	SF <sub>6</sub>	NR	-	-
Sulphur tetrafluoride	SF <sub>4</sub>	NR	-	-
Sulphuric acid	H <sub>2</sub> SO <sub>4</sub>	NR	-	-
Sulphuryl fluoride	SO <sub>2</sub> F <sub>2</sub>	NR	-	-
Terphenyls	C <sub>18</sub> H <sub>14</sub>	0.6	167	60
Terpinolene	C <sub>10</sub> H <sub>16</sub>	0.5	210	50
Tert-butanol	C <sub>4</sub> H <sub>10</sub> O	2.6	40	260
Tetrabromoethane, 1,1,2,2-	C <sub>2</sub> H <sub>2</sub> Br <sub>4</sub>	2.0	50	200
Tetracarbonylnickel	NiC <sub>4</sub> O <sub>4</sub>	1.0	100	100
Tetrachloro-1,2-difluoroethane,	C <sub>2</sub> Cl <sub>4</sub> F <sub>2</sub>	NR	-	-

Gas/VOC	Formula (used to convert ppm measurement to mg/m <sup>3</sup> )	Correction factor	Relative sensitivity (%)	Typical PID (ppb)
Tetrachloro-1-fluoroethane, 1,1,2,2-	C <sub>2</sub> HCl <sub>4</sub> F	NR	-	-
Tetrachloro-2,2-difluoroethane	C <sub>2</sub> Cl <sub>4</sub> F <sub>2</sub>	NR	-	-
Tetrachloro-2-fluoroethane	C <sub>2</sub> HCl <sub>4</sub> F	NR	-	-
Tetrachloroethane, 1,1,1,2-	C <sub>2</sub> H <sub>2</sub> Cl <sub>4</sub>	NR	-	-
Tetrachloroethane, 1,1,2,2-	C <sub>2</sub> H <sub>2</sub> Cl <sub>4</sub>	NR	-	-
Tetrachloroethylene	C <sub>2</sub> Cl <sub>4</sub>	0.7	140	70
Tetrachloronaphthalenes, all isomers	C <sub>10</sub> H <sub>4</sub> Cl <sub>4</sub>	1.0	100	100
Tetraethyl orthosilicate	C <sub>8</sub> H <sub>20</sub> O <sub>4</sub> Si	2.0	50	200
Tetraethyllead	C <sub>8</sub> H <sub>20</sub> Pb	NR	-	-
Tetrafluoroethane, 1,1,1,2-	C <sub>2</sub> H <sub>2</sub> F <sub>4</sub>	NR	-	-
Tetrafluoroethane, 1,1,2,2-	C <sub>2</sub> H <sub>2</sub> F <sub>4</sub>	NR	-	-
Tetrafluoroethylene	C <sub>2</sub> F <sub>4</sub>	1.0	100	100
Tetrafluoromethane	CF <sub>4</sub>	NR	-	-
Tetrahydrofuran	C <sub>4</sub> H <sub>8</sub> O	1.6	65	150
Tetramethyl orthosilicate	C <sub>4</sub> H <sub>12</sub> O <sub>4</sub> Si	NR	-	-
Tetramethyl succinonitrile	C <sub>8</sub> H <sub>12</sub> N <sub>2</sub>	1.0	100	100
Therminol		1.0	100	100
Thionyl chloride	SOCl <sub>2</sub>	NR	-	-
Toluene	C <sub>7</sub> H <sub>8</sub>	0.5	200	50
Toluene-2,4-diisocyanate	C <sub>9</sub> H <sub>6</sub> N <sub>2</sub> O <sub>2</sub>	1.6	60	160
Toluenesulphonyl chloride, p-	C <sub>7</sub> H <sub>7</sub> SO <sub>2</sub> Cl	3.0	33	300
Toluidine, o-	C <sub>7</sub> H <sub>9</sub> N	0.5	200	50
Tributyl phosphate	C <sub>12</sub> H <sub>27</sub> O <sub>4</sub> P	5.0	20	500
Tributylamine	C <sub>12</sub> H <sub>27</sub> N	1.0	100	100
Trichloro-1,1-difluoroethane, 1,2,2-	C <sub>2</sub> HCl <sub>3</sub> F <sub>2</sub>	NR	-	-
Trichloro-1,2-difluoroethane, 1,1,2-	C <sub>2</sub> HCl <sub>3</sub> F <sub>2</sub>	NR	-	-
Trichloro-2,2-difluoroethane, 1,1,1-	C <sub>2</sub> HCl <sub>3</sub> F <sub>2</sub>	NR	-	-
Trichloro-2-fluoroethane, 1,1,2-	C <sub>2</sub> H <sub>2</sub> Cl <sub>3</sub> F	NR	-	-

Gas/VOC	Formula (used to convert ppm measurement to mg/m <sup>3</sup> )	Correction factor	Relative sensitivity (%)	Typical PID (ppb)
Trichlorobenzene 1,2,4-	C6H3Cl3	0.6	180	50
Trichloroethane, 1,1,1-	C2H3Cl3	NR	-	-
Trichloroethane, 1,1,2-	C2H3Cl3	NR	-	-
Trichloroethylene	C2HCl3	0.7	150	65
Trichlorofluoromethane	CCl3F	NR	-	-
Trichloronitromethane	CCl3NO2	NR	-	-
Trichlorophenoxyacetic acid, 2,4,5-	C8H5O3Cl3	1.0	100	100
Trichloropropane 1,2,3-	C3H5Cl3	NR	-	-
Trichlorotrifluoroethane, 1,1,1-	C2Cl3F3	NR	-	-
Trichlorotrifluoroethane, 1,1,2-	C2Cl3F3	NR	-	-
Triethylamine	C6H15N	0.9	110	90
Trifluoroethane, 1,1,1-	C2H3F3	NR	-	-
Trifluoroethane, 1,1,2-	C2H3F3	NR	-	-
Trifluoroethanol, 2,2,2-	C2H3F3O	NR	-	-
Trifluoromethane	CHF3	NR	-	-
Trimethylamine	C3H9N	0.5	200	50
Trimethylbenzene mixtures	C9H12	0.3	300	35
Trimethylbenzene, 1,3,5-	C9H12	0.3	300	35
Trinitrotoluene 2,4,6-	C7H5N3O6	NR	-	-
Turpentine	C10H16	0.6	167	60
TVOC		1.0	100	100
Undecane, n-	C11H24	0.9	110	100
Vinyl acetate	C4H6O2	1.1	90	110
Vinyl bromide	2 C2H3Br	1.0	100	100
Vinyl chloride	C2H3Cl	2.1	50	200
Vinyl-2-pyrrolidinone, 1-	C6H9NO	0.9	110	90
Xylene mixed isomers	C8H10	0.4	230	240
Xylene, m-	C8H10	0.4	230	50
Xylene, o-	C8H10	0.6	167	60
Xylene, p-	C8H10	0.6	180	50
Xylidine, all	C8H11N	0.7	140	70

# Appendix D: FAQ's

## Particulate measurements

### 1. Question: What do the impactor cut-points represent?

**Response/Solution:** Depending on the environment and the industrial processes (such as sanding, cutting, crushing, grinding, and transportation), the type and size of the particulates will impact the human body in different areas, affecting the nasal, throat, and/or lung area.

The impactor cut-points represent the particle size you will be sampling. Inhalable dust is 100 microns and smaller. This dust is usually filtered through the hairs and membranes in your sinuses. 10 microns and smaller is thoracic, and dust in the 4 - 10 micron size can get caught in you windpipe and other regions. 4 microns and smaller is respirable and this is what causes concerns and the need for PM4.

### 2. Question: How does the impactor function when there is a build-up of particulates (in a conical shaped pyramid)?

**Response/Solution:** When the build-up of particulates form a shaped pyramid, it will not measure appropriately. This is the indicator to clean the impactor.

**The reason:** As with any impactor-type filter, this filter relies on the larger particles being unable to "turn the corner", striking the greased-plate and being filtered out of the stream. As the pyramid builds up more and more, particles will begin to gently slide on past the impactor plate. We provide a fourth inlet which can be connected to a cyclone if extreme environments and/or longer run-times are needed. **NOTE: the impactors are designed to work correctly ONLY at 1.67 lpm.**

### 3. Question: Is it possible to do an inhalable or respirable gravimetric sample?

**Response/Solution:** Yes, it is possible to do inhalable and respirable gravimetric sampling. This can be accomplished through the "dial-in" impactors or with a cyclone in the open (4th) hole on the turret. This hole is used for zeroing the instrument as well as allowing the use of a cyclone in that inlet port.

### 4. Question: How do I set the cut-points for particulate measurements?

**Response/Solution:** Turn the turret until the appropriate setting is displayed on the instrument's screen. (Settings include: PM2.5, PM4, PM10, and PM. **NOTE: PM is unfiltered particulate collector and allows all sizes through the dust path for collection and measurement.**)

### 5. Question: How often do you need to apply the grease to the impactors?

**Response/Solution:** The impactors require periodic cleaning (and greasing) which is dependent on the density of air particulates floating in the intended environment. A relatively dusty environment (approximately under  $10\text{mg}/\text{m}^3$ ) should last an entire day. When dust pyramids form on impactor plates this signifies they require cleaning and greasing. Please refer to Impactor Care Section and the Optical Engine Maintenance and Cleaning Section in Chapter 7 of the EVM Series User Manual for cleaning details.

### 6. Question: How do I know when to clean the optical engine/photometer?

**Response/Solution:** The following conditions may occur: (1) If calibrating the particulate (PM) sensor and it will not zero, this indicates the optical engine will need cleaning. (2) The instrument is exposed to oily or wet mists. (3) The readings are falling lower and lower indicating the mirror is dirty. (Please see Chapter 7 of the EVM series manual for details on cleaning and maintenance.)

### 7. Question: how is the EVM-7 and EVM-3 calibrated in the factory?

**Response/Solution:** Each instrument is factory calibrated to the ISO 12103-A2 Fine (Arizona Road Dust). A factory calibration is conducted with a "golden" instrument that is calibrated using a certifiable gravimetric sample. Quest Technologies recommends a yearly factory calibration.

### 8. Question: Do I need to calibrate before I run real-time particulate measurements?

**Response/Solution:** Yes, it is recommended to perform a zero calibration in each environment you will be measuring particulates. To perform a zero calibration, ensure that the zero filter/HEPA filter is attached, the impactor is well greased, and the turret is set to PM. Then, using the keypad navigate to Calibrate>PM screen and perform a zero calibration. (Please see Chapter 4I for specific details.) **NOTE:** a zero calibration may be used when performing area-survey monitoring. However, if you are testing in accordance to NIOSH0600 or if you want to measure the actual mass concentration in a specific environment, you would run a gravimetric calibration to determine a correction factor referenced to the ARD.

### 9. Question: When test collecting real-time particulate measurements for a period of time, how do I verify the calibration?

**Response/Solution:** First, ensure you performed a zero calibration prior to your testing (with the supplied Zero/HEPA filter). Run your real-time particulate measurements. Then, perform a Calibration (PM) Verify via the Verify softkey/quick key. (Please see Chapter 4 for specific details.)


### 10. Question: What if I need to calibrate particulates in accordance to NIOSH0600?

**Response/Solution:** A gravimetric calibration is performed. The steps below outline a gravimetric calibration. (Please see Chapter 4 for specific details.)

**11. Question: How many correction factors can be stored on the monitor and in QSP-II?**

**Response/Solution:** The EVM supports 8 different particulate matter (PM) configurations/profiles with customized name settings and user correction factor settings. See Chapter 3 for instrument profile set-up or Chapter 6 for QSP-II set-up for more details.

**12. Question: What if I want to enter in the correction factor after running/logging particulate measurements?**

**Response/Solution:** You can adjust/change the correction factor in QuestSuite Professional II after the session has been downloaded. The Dust Correction Override feature is a type of scaling factor that will re-calculate the data instantly in the chart or graph you are viewing. (NOTE: the Dust Correction Override field is displayed in the General Data panel and is applied to the dust measurements in the logged data chart/table when dust is the selected parameter. To apply, select the dust override icon  and add a new value.)

## Gravimetric Sample (optional for particulate calibration)

**1. Question: What is the backpressure capabilities? (Inches/water column)**

**Response/Solution:** >= 15 inches of water @ 1.67 LPM

**2. Question: What type of cassettes can be installed?**

**Response/Solution:** Both 25mm and 37mm cassettes can be used in the EVM monitor.

**3. Question: How do you replace the filters (which are supplied in the kit)?**

**Response/Solution:** The cassettes are separated using a "larger"-sized screwdriver. The backing should always remain in the cassette (white, thin cardboard-like circular disc) and the filter is placed on top of the backing. An EVM-7 or EVM-3 is shipped with 10-pack of replaceable filters. (Filters can be ordered in 5-packs via Quest.)

**4. Question: Can we run the unit without a cassette?**

**Response/Solution:** The monitor should *not* be run without a cassette. The monitor is installed with a pump protection filter cassette. As its name indicates, it protects the pump from particulate matter. This cassette or a new cassette (if performing a gravimetric sample) should *always* be installed. It should be noted that the pump protection filter cassette will periodically need to be cleaned or replaced.

**5. Question: Does Quest offer cassettes?**

**Response/Solution:** Quest Technologies offers a 5-pack of 37mm gravimetric cassettes (for pump protection). Order Part Number 074-076-5. Quest Technologies also offers a 10-pack, order Part Number 074-090; However, Quest does not offer any other filters for special testing.

## Toxic Sensor measurements

**1. Question: How many toxics can I measure simultaneously?**

**Response/Solution:** One toxic sensor (which is located in the left position of the housing); in addition to PID (middle position) and CO<sub>2</sub> (right position).

**2. Question: What's the life expectancy and warranty on the various Sensors?**

**Response:**

Sensor Type	Life expectancy	Warranty
Particulates sensor	5000 hours (for the laser photo-meter)	1 year
CO <sub>2</sub> sensor	5 years	1 year
PID sensor (for measuring VOC's)	2000 hours in clean air environment (replaceable bulb and grid)	1 year
Carbon Monoxide (CO)	2 years	2 years
Chlorine (CL <sub>2</sub> )	2 years	1 year
Ethylene Oxide (EtO)	2 years	1 year
Hydrogen Cyanide (HCN)	2 years	1 year
Hydrogen Sulfide (H <sub>2</sub> S)	2 years	2 years
Nitrogen Dioxide (NO <sub>2</sub> )	2 years	2 years
Nitric Oxide (NO)	2 years	2 years
Oxygen (O <sub>2</sub> )	2 years	1 year
Sulphur Dioxide (SO <sub>2</sub> )	2 years	2 years

## Pump/Airflow measurements

**1. Question: How is the flow rate controlled?**

**Response:** There is a differential pressure sensor on the PC board that is used to measure the pressure drop across the orifice above. The reason is to maintain the correct pressure drop across the orifice.

**2. Question: Will the pump always regulate?**

**Response:** The pump tries to maintain 1.67 lpm flow rate. When the flow rate is not maintained, the message "Pump unable to regulate" will appear on the screen's display.

**Solution:** (1) the gravimetric cassette may need to be replaced, (2) detach any external devices (such as a cyclone).

### 3. How often do we need to calibrate the pump?

**Response/Solution:** Quest Technologies recommends an annual factory calibration. If the user has an accurate flow meter, such as a bubble-flow meter, the user may perform more periodic pump calibrations.

### 4. How do we calibrate the pump?

**Response/Solution:** An accurate flow meter (such as a primary standard calibrator) and tubing is required to perform this calibration. The primary standard calibrator tubing is inserted in the air flow outlet (located at the back of the housing). Navigate to the CALIBRATION/FLOW RT screen. Press the CAL quick key and then the START quick key. Adjust the flow rate (using the up and down arrow keys) to 1.67 LPM and then confirm by pressing the SAVE quick key. It should be noted that in order for the impactors to work properly the flow rate **must be** adjusted to 1.67 LPM.

### 5. Can we adjust the flow rate?

**Response/Solution:** The flow rate can be adjusted (see the "How do we calibrate the pump?" question above). It should be noted that in order for the impactors to work properly the flow rate **MUST** be adjusted to 1.67 LPM.

### 6. How can we verify the constant flow?

**Response/Solution:** Using an accurate flow meter (or primary standard), calibrate before your run/logging and verify after to ensure a constant flow rate. *NOTE: The primary standard calibrator tubing is inserted in the air flow outlet (located at the back of the monitor).*

## Digital Output (using stereo plug & diagram)

### 1. How do I access my analog or digital out connection?

**Response/Solution:** Using a Stereo plug (as the example shows below), connect the analog tip of the plug to the analog/digital output port (Figure A). Use Diagrams below to connect external device. (Please contact Quest tech. support for stereo plug details.) (Figure B).

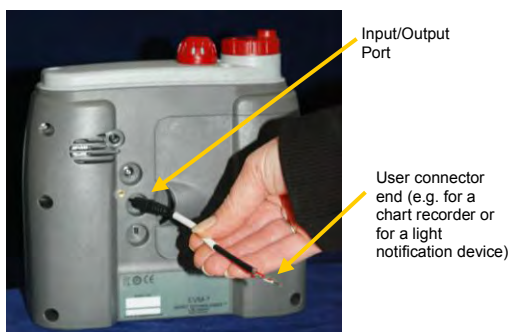


Figure A: Analog/Digital Output


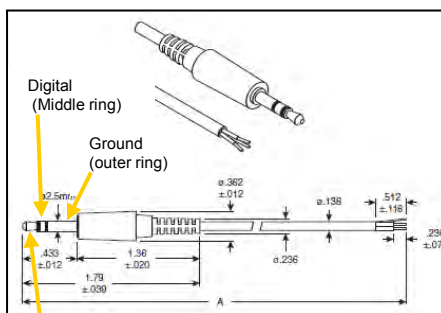


Figure B: Stereo plug

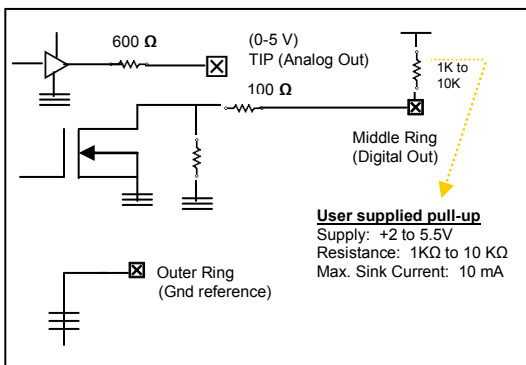

Stereo Plug Specifications (See "Figure B" above)	
Type:	2.5mm Stereo Plug, Stripped & Tinned, Shielded
Temperature:	60°C
Voltage Rating:	24VDC
Conductor:	26AWG (.12mm x 10) Copper Wire with PVC Jacket
Shield:	.12mm x 30 Wrapped Copper Wire
Plug:	Brass
Tip Insulator:	ABS
Body & Jacket:	PVC
Wire Color Coding:	Plug Tip (White), Ring (Red), Sleeve (Shielding)

## PID Questions (for Volatile organic compound measurements)

1. **Measuring range and display** - The difference between Accuracy and Resolution is as follows: (1) Actual accuracy, resolution, and repeatability are related to the full operating range from 0 to 2000ppm; (2) Resolution, also called the **Display Resolution**, will display 0.01 resolution when less than 20ppm. (This is due to Quest's ability to program a low-noise sampling system that provides 18-bits of resolution with stable zeroing results. Thus, the display resolution appears as 0.01 compared to other brands which display 0.1.)  
**Accuracy:** +/- 5% (+/- 100ppm)  
**Display Resolution** – +/-2% repeatability (+/- 40ppm)
2. **Lamp Questions:**
  - a. **What lamps will be available? (9.8, 10.6, 11.7 eV)**  
**Response/Solution:** The EVM PID sensor supports a 10.6eV lamp.
  - b. **Will we offer a moisture trap or hydrophobic filter attachment?**  
**Response/Solution:** Each gas sensor installed in the EVM, including PID, has a hydrophobic filter contained in the sensor housing.
3. **Maintenance Questions:**
  - a. **Is the lamp field replaceable?**  
**Response/Solution:** The PID lamp can be replaced by the user in the field. A replacement lamp can be ordered from Quest Technologies (Part number 074-081). See Chapter 7 (Maintenance & Cleaning) of the EVM Series user Manual for instructions on replacing the PID lamp. **NOTE:** You need to recalibrate the PID sensor after the lamp is replaced (or cleaned).
  - b. **Can the lamp be cleaned in the field?**  
**Response/Solution:** The lamp can be cleaned in the field with the PID cleaning kit. A PID cleaning kit is shipped with an EVM unit if ordered with a PID sensor option. A PID cleaning kit can also be ordered from Quest Technologies (Part Number 074-080). See Chapter 7 (Maintenance & Cleaning) of the EVM Series user manual for instructions on cleaning the PID lamp.
4. **Calibration Questions:**
  - a. **How do we calibrate the PID?**  
**Response/Solution:** A PID calibration is a two point calibration consisting of a zero and a span calibration. The flow rate at LPM is recommended for best performance results (i.e., accuracy and repeatability). To perform a zero calibration Pure Air or Nitrogen should be used. To perform a span calibration Isobutylene gas should be used if the specific VOC is unknown or a specific VOC gas can be used. To calibrate the PID sensor navigate to the CALIBRATIONPID screen and perform a zero and span cal by applying gas to the monitor using the supplied calibration cup. See Chapter 4 of the EVM Series User Manual for details on PID calibration.
  - b. **How often is calibration recommended?**  
**Response/Solution:** Quest Technologies recommends calibrating the PID sensor prior to running a log session to adjust for sensor drift and wear.
5. **PID Correction Factors:**
  - a. **Question: Do you have a correction factor chart (or a library of PID correction factors) for various VOCs?**  
**Response/Solution:** Quest has included a correction factor chart with the various VOC's in Appendix C of the EVM series user manual. Please reference as needed.
6. **Cleaning/Maintenance Question:**
  - a. **How do I know when to clean the PID sensor for VOC measurements?**  
**Response/Solution:** A "PID sensor error" message will appear on the screen which indicates (1) clean the sensor, (2) the lamp needs replacing.

## Power

1. **Question: How long will the battery last with the EVM series?**  
**Response/Solution:** The battery is an internal lithium-ion rechargeable battery pack which will last at least 8 hours with continuous setup time, run time, and viewing your results time. (**NOTE: the battery is not user accessible or user replaceable.**) Battery life-time is estimated at **500 charge cycles** or around **3 years** of use before you will need to replace the battery pack.

## Alarm outputs

1. **Question: Is there an alarm output?**  
**Response/Solution:** The Digital-Out (or digital-output) can be configured for any installed sensor at user specified threshold.

## General: Mechanical

1. **Manifold positioned over sensors: What is the long, black plastic bar over the sensors and how is it used?**  
**How is it used:** The manifold is used to improve response time during the calibration process and use (running, logging, and viewing measurements).
2. **What is the Path for Gas (Toxic, CO2 and PID):** (Please refer to Figure 1-3 in Chapter 1.)

## Calibrating sensors

**Question:** What calibration gases or calibration equipment are needed for calibrating sensors on the EVM series?

Sensor Type	Zero Calibration	Advanced calibration (correction factors)
Particulates sensor	Performed with a zero/HEPA filter (shipped in kit)	Gravimetric filtering (optional) is used to determine a reference point/correction factor relative to the Arizona Road Dust factory calibration. (Please refer to the EVM Series User Manual for details.)

Sensor Type	Zero Calibration	Span Calibration
CO <sub>2</sub> sensor	Performed with Nitrogen	CO <sub>2</sub> gas with a 1 Liter/minute flow rate  <i><b>*NOTE:</b> The range of the CO<sub>2</sub> sensor is 0 to 20,000 ppm. It is recommended to span cal to the value you will be measuring (i.e., 10,000 ppm) for best results. Note settling time with 1 LPM gas flow has a response time of &lt;90 seconds.</i>
PID ppm sensor	Performed with Pure Air or Nitrogen  <i><b>*NOTE:</b> Room air can be applied in clean air environments (such as a school with no toxic cleaners present).</i>	Isobutylene is used when the VOC's are unknown.  <i><b>*NOTE:</b> in order to measure a specific VOC, you will use the relevant VOC for your calibrated gas source.</i>
PID ppb sensor	No user cal performed in the field. (Factory cal. only.)	PID sensor ppb – span: 10 ppm (or 10,000 ppb) of Isobutylene whether the gas of interest is known/unknown.
Carbon Monoxide (CO)	Performed with Pure Air or Nitrogen	CO gas
Chlorine (Cl <sub>2</sub> )	Performed with Pure Air or Nitrogen	Cl <sub>2</sub> gas
Ethylene Oxide (EtO)	Performed with Pure Air or Nitrogen	EtO gas
Hydrogen Cyanide (HCN)	Performed with Pure Air or Nitrogen	HCN gas
Hydrogen Sulfide (H <sub>2</sub> S)	Performed with Pure Air or Nitrogen	H <sub>2</sub> S gas
Nitrogen Dioxide (NO <sub>2</sub> )	Performed with Pure Air or Nitrogen	NO <sub>2</sub> gas
Nitric Oxide (NO)	Performed with Pure Air or Nitrogen	NO gas
Oxygen (O <sub>2</sub> )	Performed with Nitrogen	Room air  <i><b>*NOTE:</b> The range of the O<sub>2</sub> sensor is 0 – 30% with a typical span of 20.9%.</i>
Sulphur Dioxide (SO <sub>2</sub> )	Performed with Pure Air or Nitrogen	SO <sub>2</sub> gas

Sensor Type	Calibration
Pump Flow rate	An accurate flow meter (i.e., bubble-flow meter) and tubing is required to perform this calibration. The tubing and flow meter are connected to the back outlet or in the turret. (Please see the EVM Series manual for details.)
Temperature	An accurate temperature sensing instrument (i.e., thermometer) is required to perform this calibration. The instrument is then placed in the location where you will log and the calibration is conducted. <i><b>*NOTE:</b> when calibrating temperature, ensure the unit is not charging by unplugging the external power cord before proceeding.</i>
Relative Humidity	An accurate temperature sensing instrument (i.e., psychrometer) is required to perform this calibration. The instrument is then placed in the location where you will log and the calibration is conducted. <i><b>*NOTE:</b> when calibrating relative humidity, ensure the unit is not charging by unplugging the external power cord before proceeding.</i>

**\*\*NOTE:** before performing a user calibration, ensure that your calibration is performed in an area known not to contain hazardous or interfering gases if ambient air will be used as the zero gas for operation. If this is not possible, pure bottled air (Nitrogen is recommended) should be substituted.

**About Zero Calibration:** A Zero calibration is advised each time you log a session to adjust for drift in the sensor's sensitivity which occurs over time and after use.

**About Span Calibration:** A span calibration proceeds a zero calibration and is used to set the linear measuring range. The span should be a sizeable fraction of the selected full scale range of the gas.

# Appendix E

## System errors displayed on the EVM series

There are two types of pop-up notifications that may appear on your instrument.

- **Monitor system errors** – The EVM is equipped with numeric system errors which range from 101-108. If a numeric system error appears, please call Quest Technologies for Technical Support and Service. Noting the System Error code is very useful for the call.
- **Monitor errors** – Pop-up screens may appear as you are using the instrument. These are to notify you of various errors/cautions statements. All of the errors are listed below with an explanation. Please press Enter and adhere to the monitor warning screens. If you have any questions, please call Quest Technologies for Technical Support.

### System errors displayed on the EVM series

Monitor Errors	Explanation
<b>Battery charger disabled at current temperature</b>	The battery is either too hot or too cold to charge.
<b>Battery charging failure</b>	If this appears frequently, this indicates the instrument may need to be serviced. Please contact Quest's Technical Support for help.
<b>Battery low</b>	The battery is almost depleted and powering off of external power. (NOTE: you should turn the monitor off or plug in the power cord.)
<b>Right error: Duplicate profile name</b>	The dust profile names that the user can set must be unique or this error will appear. (Please see chapter 3 for details.)
<b>Analog-out channel sensor invalid</b>	If analog-out is enabled and a sensor is selected (such as CO) and you remove that sensor, this monitor warning will appear. (Re-insert the sensor if desired.) NOTE: the Digital-out field will automatically disable and select the next available detectable sensor.

### ***System errors displayed on the EVM series***

<b>Monitor Errors</b>	<b>Explanation</b>
<b>Invalid impactor setting to start logging</b>	When the impactor reads at an incorrect setting, it will not allow you to log without turning the turret to a correct setting.
<b>Laser not functioning properly</b>	Either the laser is unplugged or needs to be serviced. Please make sure the laser is connected. (This is the multi-colored cable which attaches from the laser to the connectors located by the gravimetric cassettes.)
<b>Logging stopped due to impactor change</b>	The instrument does not allow you to change the impactor setting during run mode. To correct this, stop logging. Change the impactor and then continue with Running/logging measurements.
<b>File system full. Delete files to continue</b>	Files will need to be deleted before proceeding with logged measurements. (Please see File System menu for more information.)
<b>File system error. Logging failed</b>	Message will appear when there is not enough memory to store new files. You will want to delete files in order to proceed. (See File System menu for more details.)
<b>PID sensor error</b>	This indicates one of the following: (1) Clean the sensor, (2) The lamp needs replacing, (3) replace the electrode pellet, (4) or replace the sensor
<b>Pump unable to regulate</b>	The pump tries to maintain 1.67 lpm flow rate. When the flow rate is not maintained, this message will appear.  <b>Reason:</b> The gravimetric cassette may need to be replaced or detach any external devices (such as a cyclone). Or it will need to be serviced.
<b>Set time and date – clock has been reset</b>	This will appear if the battery was depleted. You will want to reset the time and date. NOTE: the time and date field are used for calibration and logged files.
<b>Digital-out channel sensor invalid</b>	If digital-out is enabled and a sensor is selected (such as PM) and you remove that sensor, this monitor warning will appear. (Re-insert the sensor if desired.) NOTE: the Digital-out field will automatically disable and select the next available detectable sensor.

### ***System errors displayed on the EVM series***

<b>Monitor Errors</b>	<b>Explanation</b>
<b>Sensor not found xxx (i.e.CO)</b>	A warning message will appear when a sensor (gas, toxic, PID, RH/Temp, or dust) is removed. (NOTE: the instrument needs to be turned off when sensors are removed.). This is to notify you that a sensor has been removed or changed.
<b>Sensor found xxx (i.e, CO)</b>	Likewise, a monitor warning message will appear when a sensor is removed and replaced back in. This is helpful if you are changing different toxic sensors.
<b>PM disabled</b>	If the user disabled particulates via the particulates setup screen. Then the pump key will not function.

**INDEX**

%.....	84	Toxic Gas overview.....	63
ACGIH		Verify calibration.....	77
Defined.....	140	Zero cal and span cal for CO <sub>2</sub> or for O <sub>2</sub> sensor.....	67
Air monitoring		Zero cal for toxic gas.....	63
Defined.....	140	Zero Cal set for Particulates.....	55
Air pollution		Calibrating particulates	
Defined.....	140	Arizona Road Dust.....	49
Air quality monitoring		Calibration	
Defined.....	140	Example of Cal history chart in QSP-II.....	61
Air quality standards		calibration history screen,.....	76
Defined.....	140	Carbon Monoxide	
Air Velocity Accessory		Measuring range.....	59
Specifications.....	128	Ceiling	
Airborne particulates		Defined.....	141
Defined.....	140	Charging.....	19
Analog out.....	37	Check battery power.....	23
Analog output.....	19	Chlorine	
ASHRAE		Measuring range.....	59
Defined.....	140	Communicating with QSP-II via USB cable.....	18
Average		Composite measurement screen.....	91
Defined.....	143	Composite with details screen.....	93
Backlight key.....	39	Confined Space	
Batteries		Defined.....	141
indicator.....	15	Cyclone	
Battery.....	19	Using.....	87
Bubble flow meter		Delete session message.....	98
Connecting.....	58	Deleting all sessions.....	98
Bump Test		Deleting sessions.....	97
Defined.....	140	Digital out/Logic settings.....	35
Calculating particulate matter		Digital output.....	19
Defined.....	141	Digital Output	
Calibrating		Using stereo plug and diagram.....	160
Gravimetric cal overview.....	56	Display settings explained.....	24
Reset gravimetric setting.....	57	Drift	
Connecting gas sensor.....	62	Defined.....	141
Drifting analysis.....	77	Dummy Sensor	
Flow Rate Calibration.....	59	Defined.....	141
Inert tubing.....	62	Dust Override Factor	
Ozone zero and span cal.....	63	Defined.....	141
Particulates zero cal.....	52	Dust Override Profile	
Performing a gravimetric.....	57	Defined.....	141
Photo-Ionization Detector (PID) Sensor.....	71	Engulfment	
PID PPB span cal.....	73	Defined.....	141
PID PPM span cal.....	72	Estimated Run Time	
PID PPM zero cal.....	71	Screen.....	100
PID Span Cal steps.....	73	Ethylene Oxide	
Pump flow rate calibration.....	58	Measuring range.....	59
Relative Humidity or Temperature calibration.....	75	EVM keypad and display explained.....	12
Saved Calibration screen.....	66	EVM kit.....	11
Selecting a calibration sensor screen.....	68	FAQ.....	159
Setting CO <sub>2</sub> Span Cal screen.....	70	FAQ's	
Span cal for Toxic gas.....	65	Alarm outputs (See Analog Input/Output).....	161

Analog or digital out connection.....	160
Battery power.....	161
Calibration Questions.....	161
Can we adjust the flow rate .....	160
Can we run the unit without a cassette.....	159
Does 3M Quest offer cassettes .....	159
Gravimetric cassette sizes .....	159
Gravimetric Sample	
Backpressure capabilities (inches/water column) .....	159
How can we verify the constant flow .....	160
How do we calibrate the pump .....	160
How is the flow rate controlled .....	159
How Particulates are calibrated in the factory .....	158
How many toxics can I measure simultaneously.....	159
How often to calibrate the pump .....	160
Lamps will be available? (9.8, 10.6, 11.7 eV).....	161
Life expectancy and warranty on sensors .....	159
Maintenance and lamp questions.....	161
Measuring range and display.....	161
Mechanical	
What is the long, black plastic bar over the sensors	
and how is it used?.....	161
Particulates	
Adding Correction factor after running/logging	
particulate measurements .....	159
Calibrate before I run real-time particulate	
measurements .....	158
Calibrate particulates to NIOSH0600 .....	158
Clean the optical engine/photometer.....	158
Correction factors.....	159
Cut-points.....	158
How often do you need to apply the grease to the	
impactors .....	158
Impactor cut-points .....	158
Impactor function when there is a build-up of	
particulates (in a conical shaped pyramid).....	158
Inhalable or respirable gravimetric sample.....	158
Verify the calibration .....	158
Replacing filters (which are supplied in the kit) .....	159
What calibration gases or calibration equipment are	
needed for calibrating sensors on the EVM? .....	162
What is the path for gas (Toxic, CO2 and PID): .....	161
Will the pump always regulate .....	159
File system menu .....	97
File systems properties screen.....	99
Filtered CO sensor vs. Unfiltered	
Defined .....	142
Fire triangle	
Defined .....	142
ft/m. ....	84
Gas calibration softkeys	
Explained .....	65
Gas measurement screen.....	90
Gases	
Cross sensitivity .....	60
Gravimetric analysis	
Defined .....	142
Gravimetric cassette and filter paper .....	125
Replacing .....	125
Hazardous Atmosphere	
Defined .....	142
Hydrogen Cyanide	
Measuring range .....	59
Hydrogen Sulfide	
Measuring range .....	59
Identifying your equipment.....	11
IDLH	
Defined .....	142
Impactor	
Adjusting impactor/turret setting .....	51
Greasing and cleaing .....	49
How it operates .....	49
Use .....	50
Impactors	
Cut-points.....	50
Indicators (i.e., run, stop, battery, Altf ) .....	15
Keypad/user interface explained.....	13
Level	
Defined .....	143
Lock/secure	
Run and Setup screen .....	41
Lock/Security	
Lock Softkey.....	40
Run mode steps .....	40
Setup steps .....	40
Lookup icon (eyeglasses) softke.....	85
m/s.....	84
m³.....	84
Magnifying glass symbol .....	85
Material Safety Data Sheet	
Defined .....	142
Maximum	
Defined .....	143
Measurement parameters	
Defined .....	143
Measurement values	
AVG .....	89
Level.....	89
MAX.....	89
Min.....	89
STEL .....	89
TWA.....	89
Measurements	
Zoomed in .....	91
Zoomed out.....	91

Measurements units	
Specifications .....	131
Measuring	
Changing views .....	88
Logged data .....	81
Quick help list .....	80
Sample summary data in QSP-II .....	81
Stored data .....	81
Summary data .....	81
Time History data .....	82
Memory	
Estimated logged run time .....	100
Memory remaining and file properties .....	99
mg .....	84
mg/m <sup>3</sup> .....	84
Minimum	
Defined .....	143
MSHA	
Defined .....	143
Navigating .....	15
Navigating screens .....	83
NIOSH	
Defined .....	143
Nitric Oxide	
Measuring range .....	59
Nitrogen Dioxide	
Measuring range .....	59
°C .....	84
°F .....	84
OL .....	84
Optical engine and cleaning .....	121
OSHA	
Defined .....	143
Overload .....	15
Oxygen	
Measuring range .....	59
Particulates	
User profiles .....	49
Particulates correction factors	
Setting .....	31
Particulate matter	
Defined .....	143
Particulate Measurement screen .....	86
Particulate Sensor	
Specifications .....	126
Parts	
Listing .....	136
Past session	
Summary screen .....	97
Past session screen .....	95
Peak	
Defined .....	144
PEL	
Defined .....	144
Photodiode	
Defined .....	144
PID sensor	
Correction factor setup screen .....	28
PID sensor & correction factors table .....	146
PM measurements	
Extending run-time .....	87
Power	
Turn on .....	14
ppb .....	84
Defined .....	144
ppm .....	84
Defined .....	144
Relative Humidity	
Defined .....	145
Relative Humidity Sensor	
Specifications .....	127
Relative Sensitivity	
Defined .....	145
Resetting the EVM .....	39
Restoring Default factory settings .....	38
RH and temperature measurement screen .....	89
run a noise study .....	83, 95
Run mode .....	15
Run Time	
Explained .....	26
Running .....	83
Running a study	
Steps .....	80
Select softkey .....	85
Sensors	
Cleaning of the PID .....	117
ID sensor with lamp and electrode pellet	
Removed/inserted .....	119
Inserting and removing .....	47
PID - Removing intelligent-sensor casing .....	118
PID - Removing the lamp with removal tool .....	118
PID maintenance/cleaning benchmarks .....	117
PID sensor cleaning kit .....	119
Removing and inserting PID .....	116
Sensor housing and manifold .....	48
Serial numbers .....	61
Sensors' locations	
Diagram .....	48
Setting or changing digital output .....	35
Settings	
Air velocity .....	36
Correction factor .....	31
Edit profiles for dust calibration .....	31
Gravimetric Mass and Gravimetric volume fields .....	30
Particulate field .....	30

Particulates .....	30	Specifications .....	128
Profile field .....	30	Trend data screen	
Pump: enable or disable .....	33	About .....	93
Resetting the Gravimetric .....	33	Trend Screen .....	94
Temperature and air velocity .....	29	Trend softkey .....	86
Time and Date .....	21	Turning off .....	16
Start screen .....	23	TWA	
Start screen defined .....	14	Defined .....	143
STEL		Unit Information screen .....	16
Defined .....	143	Unlock	
Stereo plug		Quest default code .....	41
How to connect .....	160	Unlock/Security	
Stop mode .....	15	Run mode .....	41
Stopping .....	83	Setup .....	41
Sulphur Dioxide		UR .....	84
Measuring range .....	59	USB, power jack and digital output port .....	21
TIME		Viewing installed sensors .....	17
Defined .....	145	VOC	
Time-Date screen .....	22	Defined .....	145
TLV		Volatile Organic Compounds	
Defined .....	145	Specifications .....	127
Toxic Gas Sensors		µg/m <sup>3</sup> .....	84



Quest Technologies, a 3M company, is a world class manufacturer and leader in the field of occupational safety, industrial hygiene and environmental instrumentation. Quest products are used in more than 80 countries worldwide. 3M Quest has a strong reputation of rugged, reliable instrumentation and software systems that monitor and evaluate occupational and environmental health and safety hazards including noise, vibration, heat stress, indoor air quality and toxic/combustible gases.

3M Quest monitoring instruments serve a variety of occupations and industries with clients in mining, research, enforcement, military, education, insurance and manufacturing business sectors.



**Occupational Health &  
Environmental Safety Division**

Quest Technologies, a 3M company  
ISO 9001 Registered Company  
ISO 17025 Accredited Calibration Lab  
1060 Corporate Center Drive  
Oconomowoc, WI 53066  
Customer Service: 262-567-9157  
Toll Free: 800-245-0779



[www.3M.com/detection](http://www.3M.com/detection)  
[www.questtechnologies.com](http://www.questtechnologies.com)  
Please recycle. Printed in USA.  
© 2011 3M Company  
All rights reserved.  
074-300, Rev.F. 12/11