

NEED HELP?

SCAN OR CLICK HERE
TO CONTACT US



Air-Met Scientific
www.airmet.com.au

QUICK START GUIDE

SoundPro® SE/DL Series Sound Level Meters



SoundPro® Display and User Keypad

Softkey Menu

Measurement type
+ Repeatedly press 1st softkey
to toggle through to select
1/1, 1/3, SLM (if purchased)

Backlight Key

Stop Key

Left Arrow Key

Up/Down Arrow Keys

Run/Pause Key

Indicators

+ Battery power: 
+ Stop: 
+ Run time: 00:00:00

Softkeys

AltF Key

Enter Key

Right Arrow Key

On/Off and
ESC (Escape) Key



Turning On/Off and Navigating

1. To turn on the SoundPro, press the  key until the start screen appears.
2. To navigate, press the up/down  arrows and left/right arrows  for most of the navigational functions.
 - + The  key is used to move back one level (or escape from a menu/screen). Press repeatedly to return to the start screen.
 - + The  key is used to open the selected menu/screen.

Resetting





1. Format the card or delete the session files from the SoundPro (optional).
 - + To format, select the File softkey from the start screen. Press the down arrow continuously to select Format. Press .

Settings

1. Adjust the settings to fit the specifications of your sound study.
 - + To open the Setup menu from the start screen, press the  arrow keys and press  key when selected. The setup menu will appear. To change the parameters, navigate to the appropriate menus and make changes as needed. (See the user manual for specific details and term explanations for more information.)

Calibrate the SoundPro (Pre/Post Cals)

1. Ensure the SoundPro is turned On and is either stopped or paused.
2. Attach the calibrator and cal adapter to the SoundPro. Set the calibrator to 1 KHz and 114 dB (if it is a selectable).
3. From the Start screen, press the **Cal** softkey and the Cal screen will open. Press  when Calibrate is highlighted. The Pre-Cal screen will open.
4. Allow the measurement to stabilize and press  **Arrows** to set 114.0 dB level (see A). Then, press  key. When set, the Calibration history screen appears (see B).
5. Press  key to exit the Cal screen.
6. For a **Post Calibration**, ensure the SoundPro is in "Pause" mode. (Essentially, run a measurement and press the run/pause key.) The Pause indicator will appear at the top of the display.) Then repeat the Calibration steps above and press Enter to store the Post Calibration information. A sample screen is displayed below with post calibration history.

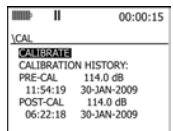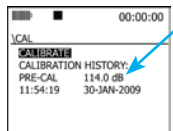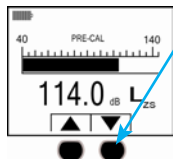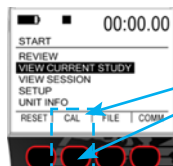


Run/Pause/Stop Measurements

Position the SoundPro in the field. Press the run key to start measuring. To pause a study (for example: lunch breaks), press the run/pause key. To start measuring again, press the run/pause key. Continue this process until your measurements are complete by press the Stop key. This will end the session.

1. From the **Start screen**, select either **View Session** or select **View Current Study** by press the ▲▼ arrows and ↻ key to select.
2. Press ▶ key to begin measuring. Press ▶|| key to Pause (optional). At any time, press ■ to end the session/study.

Lookup Softkey:

Select to change measurement parameter (Lpk, Lmx, Lmn, Leq, Las)

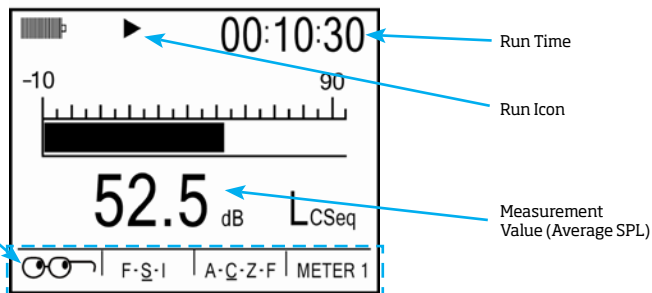

Detection Management Software DMS and Working with SoundPro Data Viewing data and Data Finder Page


1. Communicating/Connecting the SoundPro to the PC

- Turn On  the Sound Pro.
- Plug in USB cable from SoundPro to pc.




2. DMS Welcome Page and Instrument Communication

- Click on  icon (see A) to access the Instrument download panel.

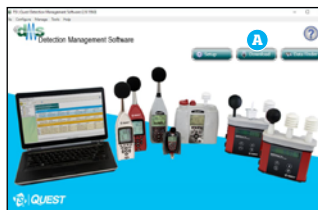


3. SoundPro and Downloading

- Select the SLM family and the SoundPro mode from the Instrument window (see A). Click on “Go to session finder after download” box.
- Click the  button (See B).
- Once downloaded, click the Data Finder tab (if you did not select “go to session finder in step A”). (See C).

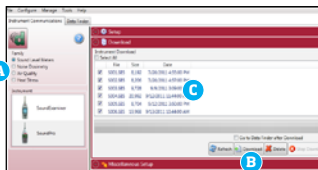

4. Selecting and Viewing Data

- The Data Finder page is used to view, select, and preview reports. Note: Click Browse to view all data files.
- Select the data by clicking on either the session/study (Note: you may need to expand to see the study data).
- To view in Graphs and Tables, click on  or  buttons.

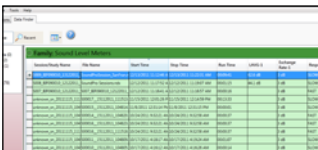

5. Viewing Data in Graphs, Tables and Report View

- The graphs and tables page is noted as the panel layout view page.
- The session/study data page displays the data in logged data charts/tables (see A).
 - Click on  to view the panels in a report format (see B).



Quest is a trademark, and SoundPro, TSI and the TSI logo are registered trademarks of TSI Incorporated.



TSI Incorporated - Visit our website www.tsi.com for more information.

North America and Asia Pacific

Telephone: +1 800-680-1220 (USA)
+1 651-490-2860 (Outside USA)

Fax: +1 651-490-3824

E-mail: technical.services@tsi.com

Europe, Middle East, and Africa

Telephone: +49 241-52303-0

Fax: +49 241 52303-49

E-mail: tsigmbh@tsi.com

